

	X	
15		

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Lead Office Santa Fe
Lease No. 078094
Unit Gov't Fullerton

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	JAN 30 1959
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Set Production Casing</u>	

(INDICATE ABOVE BY CHECK-MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 28, 1959

Well No. 5 is located 660 ft. from N line and 1980 ft. from E line of sec. 15

G. M. NE Section 15 27N 11W New Mexico PM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)


W.C. San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of ^{G.L.}the derrick floor above sea level is 6321 ft. Ungraded

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled to 6794' KB TD. Conditioned hole and ran 97 jts 5 1/2" OD, 8rd, 15.5#, J-55 sube csg and 113 jts 5 1/2" OD, 8rd, 14#, J-55 sube csg equipped w/ centralizers, scratchers, and Baker float equipment. Casing landed @ 6791' KB and cemented w/200# Mageosphae in 20 bbls water ahead of 400 cu. ft. Diesel and 150 cu. ft. stratacrete. Displaced to 2280 KB under 1500# psi. Ran temperature survey, found top of cement @ 1850 KB.

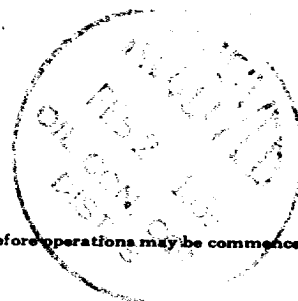

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company The British-American Oil Producing Company

Address Box 180

Denver 1

Colorado

Original Signed By:
By Thomas M. Hogan

Title District Superintendent