


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. S-078872-A
Unit SW/4 Sec. 4

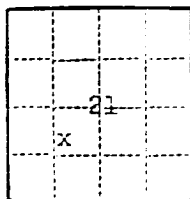

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

February 28, 19 63

Bolack

Well No. 9 is located 1650 ft. from EX line and 1650 ft. from EX line of sec. 21

SW NE SW Sec. 4 27N 11W N.M.P.M.
($\frac{1}{4}$ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
W. Kutz Pictured Cliffs San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6164 ft. (Ground)

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

RECEIVED
MAR 6 1963

Dumped 15 sacks cement from 2013' to 1900'
(5 $\frac{1}{2}$ " casing set @ 1948', total depth @ 2013'
Shot off 5 $\frac{1}{2}$ " casing @ 721' and dumped 12 sacks cement
from 695' to 745'.
Dumped 13 sacks cement @ base of 9 5/8" surface casing,
from 75' to 105'. (9 5/8" casing set @ 95'.)
Set marker in top of 9 5/8" casing w/5 sacks cement and
cleaned location. (2-18-63)

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company The Frontier Refining Company
Address 4040 E. Louisiana Ave.
Denver 22, Colorado

By A. Morrison
Title Petroleum Engineer

cc: New Mexico Oil Conservation Commission
in lieu of NMOCC Form C-103.