# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wel	le /
	5. Lease Number SF-078935
1. Type of Well GAS	6. If Indian, All. or Tribe Name
	7. Unit Agreement Name
2. Name of Operator Meridian Oil Inc.	one of the state o
	8. Well Name & Number
3. Address & Phone No. of Operator PO Box 4289, Farmington, NM 87499 (505) 326-9700	Thompson C #5 9. API Well No.
	30-045
4. Location of Well, Footage, Sec., T, R, M 990'FNL, 990'FLL Sec.3, T-27-N, R-12-W, NMPM	10. Field and Pool Basin Ft Coal
N	W. Kutz PC
	11. County and State San Juan Co, NM
12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE	·
Type of Submission Type of Act	, REPORT, OTHER DATA
_x_ Notice of Intentx Abandonment	Change of Plans
Recompletion	New Construction
Subsequent Report Plugging Back	Non-Routine Fracturing
Final Abandonment — Casing Repair  Altering Casing	_ Water Shut off _ Conversion to Injection
Other	_ conversion to injection
BLM approval for the completion and commingling of Pictured Cliffs formations was received the rig on location to perform this work, casing had extensive holes below 1420'. cancellation of the intended workover open held indle until BLM approval for the plube obtained. Verbal approval for the attrobation of the intended workover open held indle until BLM approval for the plube obtained 11-23-92 @ 7:15 am from S. Mason DEC-2 1992  OIL CON DIV.  14. I hereby certify that the foregoing is true and considered workover open held indle until BLM approval for the plube obtained 11-23-92 @ 7:15 am from S. Mason DEC-2 1992  OIL CON DIV.  Signed Mash Mash (A(KAS) Title Regulatory Affections). Title Regulatory Affections of the right of the plube	1-10-92. After moving it was found that the These holes forced the erations. The rig was ag & abandonment could tached procedure was
(This space for Federal or State Office use)	
APPROVED BYTitle CONDITION OF APPROVAL, if any:	APP#OVED
NMOCD	NOV 27 1992
	AREA MANAGEP

#### THOMPSON C #5 PC

#### UNIT D SECTION 3 T27N R12W San Juan County, New Mexico P & A Procedure


- 1. TIH w/7" cmt ret on 2-3/8" tbg & set @ 1150' (50' above top Fruitland). Establish rate w/water & sq Pictured Cliffs open hole w/165 sx Cl "B" cmt. This is 100% excess. Max pressure is 1000 psi. Sting out of cmt ret & dump 13 sx cmt on top of ret.
- Circ hole w/ mud: 15# sodium bentonite w/non-fermenting polymer, 9# gal weight, & 50 qs vis or greater. TOH.
- 3. Perf 2 sq holes @ 425' (50' below top of Kirtland). Attempt to est circ down 7" csg & out bradenhead valve. Pump Cl "B" cmt down 7" csg & circ out bradenhead valve (about 143 sx cmt).
- 4. Cut off wellhead below surface csg flange and install dry hole marker to BLM specs.

7. Restore location to BLM specs.

Approve:

J. A. Howieson


PMP

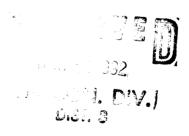

#### **CURRENT**

## THOMPSON C #5

UNIT D SECTION 3 T27N R12W SAN JUAN COUNTY, NEW MEXICO

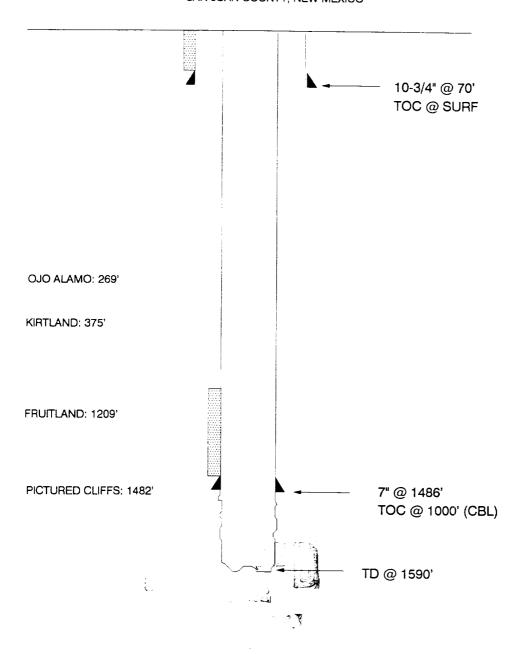

#### **PROPOSED**

### THOMPSON C #5

UNIT D SECTION 3 T27N R12W SAN JUAN COUNTY, NEW MEXICO

