

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

1-89-IND-57

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Navajo

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Table Mesa

9. WELL NO.

28

10. FIELD AND POOL, OR WILDCAT

Table Mesa Penn. "C"

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 33, T28N, R17W

12. COUNTY OR PARISH

San Juan

13. STATE

N.Mex.

1.

OIL WELL ☐ GAS WELL ☐ OTHER ☒

Drilling

2. NAME OF OPERATOR

Continental Oil Company

3. ADDRESS OF OPERATOR

P. O. Box 3312, Durango, Colorado

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)

At surface

660' PSL, 1980' FWL - SW/4

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5378' DF

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Intermed. Csg. & Liner

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

REPAIRING WELL


ALTERING CASING

ABANDONMENT*

X

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work).*

Drilled out from under surface casing 9-7-63. Drilled sand and shale to 5224' 9-28-63. Ran Schlumberger Induction-Electric log. Ran 903' of 9 5/8", 40#, N-80 casing, 845' of 9 5/8", 40#, J-55 casing, and 3476' of 9 5/8", 36#, J-55 casing, landed at 5224' RB with stage collar at 1740'. Cemented through shoe with 175 sacks regular mixed with 175 cubic feet stratocrete followed by 150 sacks regular. Cemented through stage collar with 125 sacks regular. WOC 24 hours. Drilled out stage collar. Drilled shale and lime to 7075'. Ran Gamma Ray-Neutron log. Ran 1981' of 7" liner, landed at 7075' with top at 5094'; cemented with 175 sacks regular mixed with 175 sacks stratocrete followed by 175 sacks regular around shoe. WOC 24 hours. Drilling ahead.

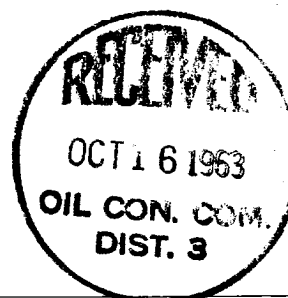

18. I hereby certify that the foregoing is true and correct

SIGNED Original signed by

H. D. HALEY

TITLE District Manager

DATE 10-15-63

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side

USGS(3) NMCC(2) CHG HDE

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.