

RANKING SCORE (TOTAL POINTS): _____

Date Remediation Started: N/A Dated Completed: _____

Remediation Method: Excavation _____ Approx. cubic yards _____
(Check all appropriate sections) Landfarmed _____ Insitu Bioremediation _____
Other _____

Remediation Location: Onsite _____ Offsite _____
(ie. landfarmed onsite, name and location of offsite facility)

General Description Of Remedial Action: N/A

Initial assessment of the pit showed the soils to be clean at
bedrock which was 1 foot below the pit bottom.

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit: Sample location Deepest part of pit. Sampled with a backhoe.
Closure Sampling: _____
(if multiple samples, attach sample results and diagram of sample locations and depths) Sample depth 1 ft below pit bottom (bedrock)
Sample date 11-18-93 Sample time _____

Sample Results

Benzene(ppm) -
Total BTEX(ppm) -
Field headspace(ppm) 26
TPH 4800

Ground Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE

11-18-94

SIGNATURE

Ed Hasely

PRINTED NAME Ed Hasely
AND TITLE Environmental Engineer

PHILLIPS PETROLEUM PIT ASSESSMENT SUMMARY
REVISED DATE: NOVEMBER 22, 1993

1993

ENVIROTECH, INC.

REO

REVISED DATE: NOVEMBER 22, 1993

HEO

PIT NO.	WELL NAME	U-S-T-R	PIT TYPE	RANK SCORE	CLOSURE STANDARD TPH (PPM)	DATE 1993	GROUNDWATER ENCOUNTERED Sub. Surf. Depth	SOIL TYPE	PIT TYPE	SAMPLE NO.	Organic Vapor Mater (PPM)	Total Recoverable Petr. Hydro. (PPM)	EPA METHOD 8020 (PPB)				STATUS	
													METHOD 5030 PURGE - AND - TRAP					
													Benzene	Toluene	Ethyl Benzene	Xylene	TOTAL BTEX	
PA087	SAN JUAN 29-6, #73A	D202006	SEP	10	1000	11-11	NO	CL/SP	EARTHEN	T1-4 T1-0.5	38 5	12						CLOSE
PA088	SAN JUAN 29-6, #74A	I202006	SEP	10	1000	11-11	NO	CL/SP/SM	EARTHEN	T1-7 T1-12 T1-15 T2-13	669 926 1124 6	7200 4800 2500 16						REM
PA089	SAN JUAN 29-6, #41-24	A242006	SEP	0	5000	11-17	NO	CL	EARTHEN	T1-4.5 T1-7	41 2047	110	2510	28200	2200	50000	82910	REM
PA090	SAN JUAN 29-6, #80	H242006	SEP	0	5000	11-17	NO	CL/SP	EARTHEN	T1-4 T1-0.5	46 131	1200	0	0	0	262	262	CLOSE
PA091	SAN JUAN 29-6, #82	A252006	SEP	10	1000	11-17	NO	SC	EARTHEN	T1-5	36	940						CLOSE
PA092	SAN JUAN 29-6, #42-25	H252006	SEP	10	1000	11-17	NO	CL	EARTHEN	T1-5.5	721	580	4380	19700	102	7000	31191	CLOSE
PA093	SAN JUAN 29-6, #79	M242006	SEP	0	5000	11-17	NO	SM	EARTHEN	T1-4.5 T1-7	587 103	1200	0	418	22	550	990	TEST
PA094	SAN JUAN 29-6, #40-23	H232006	SEP	0	5000	11-17	NO	CL	EARTHEN	T1-4.5 T1-7	32 908	20	139	930	51	1139	2253	CLOSE
PA095	SAN JUAN 29-6, #75	H232006	SEP	0	5000	11-17	NO	CL	EARTHEN	T1-4.5 T1-7	0 0	0						CLOSE
PA096	SAN JUAN 29-6, #27	K232006	SEP	0	5000	11-18	NO	CL	EARTHEN	T1-4.5 T1-7	0 0	0						CLOSE
PA097	SAN JUAN 29-6, #83	M132006	SEP	0	5000	11-18	NO	CL	EARTHEN	T1-2 T2-2 T3-2	26 0 0	4800 86 20						CLOSE
PA098	SAN JUAN 29-6, #26-13	K132006	SEP	0	5000	11-18	NO	SC	EARTHEN	T1-4.5 T1-7	0 2.5	10						CLOSE
PA099	SAN JUAN 29-6, #103	G112006	SEP	10	1000	11-18	NO	SC/SM	EARTHEN	T1-1.5 T2-2	134 2.5	15100 0	319	0	700	11500	12510	REM
PA100	SAN JUAN 29-6, #84	G142006	SEP	10	1000	11-18	NO	CL	EARTHEN	T1-4.5 T1-7	58 758	680	106	2000	167	3030	5303	CLOSE
PA101	SAN JUAN 29-6, #104	N142006	SEP	10	1000	11-19	NO	CL	EARTHEN	T1-3.5 T1-6	0 0	0						CLOSE
PA102	SAN JUAN 29-6, #93	B162006	SEP	10	1000	11-19	NO	SM	EARTHEN	T1-5	20	680						CLOSE

C.C.C. NO: —

DATE STARTED: 11-18-93
DATE FINISHED: 11-18-93
ENVIRO. SPCLT: RED
OPERATOR: CIMARRON
ASSISTANT: K.S.

SURFACE CONDITIONS: EARTHEN PIT - FENCED 25' x 25' - NO SURFACE STAINING

T1: PIT DUG INTO SANDSTONE
WET, BROWN/GRAY SILTY-SANDY-CLAY-
SLIGHT ODR.

1178. $\therefore \Delta \text{ILUTE } 10:1 = 238 \times 2 \text{ mo} = 4760 \cdot \text{GAC}^* \text{ O } 338$


43 x 2 = 86 • GAC # 0339

10 x 2 = 20 • GAC # 0340

SCALE

0 10 20 FEET

SITE DIAGRAM

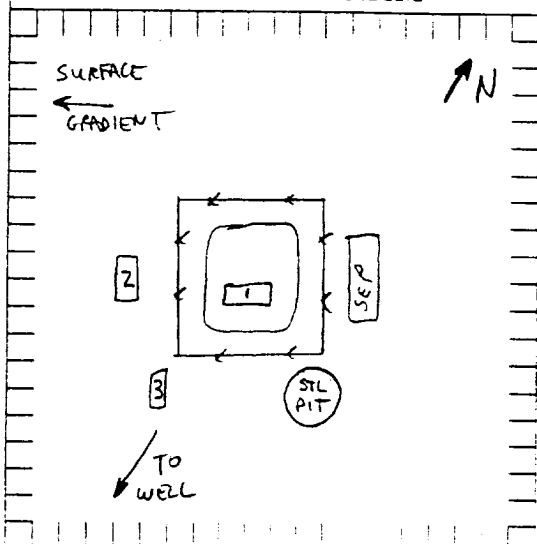

SOIL TYPE: C - Clay, M - Silt, S - Sand, G - Gravel Plasticity: - - None, + - Plastic Loading: P - Primary, S - Secondary