

1-Comm. Pub. Lands DEPARTMENT OF THE INTERIOR

2-Phillips (Wolcast, ~~Geological~~) GEOLOGICAL SURVEY

1-Canfield, 1-F SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR	San Juan 29-6
3. ADDRESS OF OPERATOR	8. FARM OR LEASE NAME
Beta Development Co.	
234 Petr. Club Plaza, Farmington, N. M.	9. WELL NO.
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface	10. FIELD AND POOL, OR WILDCAT
1190/S 1040/W	Basin Dakota
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
	12-29N-6W NMPM
14. PERMIT NO.	12. COUNTY OR PARISH 13. STATE
	Rio Arriba N.M.
15. ELEVATIONS (Show whether DF, RT, GR, etc.)	
6578'	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL


ALTERING CASING

ABANDONMENT*

(Note: Report results of multiple completion on Well *
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 8-26-65 T.D. 7989'. Ran logs, log stuck @ 5387', pulled line off tool.
8-27-65 Fishing for logging tool.
8-28-65 Fishing for logging tool.
8-29-65 POH recovered logging tool. WIH w/bit on bottom, circ. & conditioned hole 8 hrs. Went back to bottom, circ. & conditioned mud. POH.
8-30-65 Corrected TD 7994'. Ran logs, WIH w/bit, circ., LDDP & DC. Ran 251 jts 7982' 4-1/2" 11.6 & 10.54 J-55 ST2C csg set @ 7994' w/2 stage collar @ 5370' & 3587'. Cemented 1st stage w/150 sx reg + 2% gel, 1% Halad-9. PD @ 3:30 AM. Cemented 2nd stage w/160 sx 50-50 Pozmix & Class C + 8% gel. PD @ 4:30 AM. WOC 3-1/2 hrs.
8-31-65 Opened 2nd stage collar @ 3587'. Cemented 3rd stage w/250 sx 50-50 Pozmix & Class C + 8% gel. Plug stopped @ 1800'. Set slips, cut off pipe & released rig @ 10:00 AM 8-31-65.

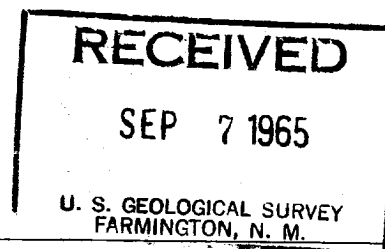

18. I hereby certify that the foregoing is true and correct

Original signed by:
SIGNED JOHN T. HAMPTON

TITLE Manager

DATE 9-3-65

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.