

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR
Northwest Pipeline Corporation

3. ADDRESS OF OPERATOR
P.O. Box 90 Farmington, New Mexico 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

1830' FNL & 2210' FE1

14. PERMIT NO.

15. ELEVATIONS (Show whether DEPT. GR. etc.)
6600 GR

5. LEASE DESIGNATION AND SERIAL NO.

SF 078281

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

San Juan 29-5 Unit

8. FARM OR LEASE NAME

San Juan 29-5 Unit

9. WELL NO.

72

10. FIELD AND POOL, OR WILDCAT


Basin Dakota

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec 17, T29N, R6W
NMPM

12. COUNTY OR PARISH
Rio Arriba

13. STATE
New Mexico

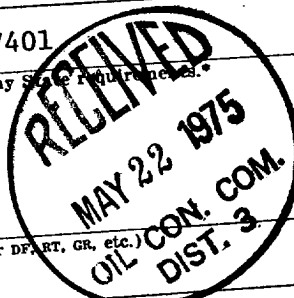

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

SUBSEQUENT REPORT OF:

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	

WATER SHUT-OFF ☐
FRACTURE TREATMENT ☐
SHOOTING OR ACIDIZING ☐
(Other) ☐

REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

5-20-75:

It is proposed to abandon this well in the following manner:

- (1) Run 2" tubing & spot 200' cement plug from 6421' to 6221'.
- (2) Spot 150' cement plug from 6000' to 5850'.
- (3) Cut off 4-1/2" casing @ approximately 3500' & pull same - spot 200' cement plug from 3650' to 3450'.
- (4) Spot 300' cement plug from 3000' to 2700'.
- (5) Cut off 7" csg @ approximately 2000' & pull same. Spot 50' cement plug across cut off.
- (6) Spot 50' cement plug across 9-5/8" surface casing shoe from 325' to 275'.
- (7) Spot 30' cement plug in top of surface casing from 30'-0'.

A dry hole marker constructed of 4-1/2" pipe and extending 5' above ground level will be installed in the 9-5/8" casing.

The location will be cleaned and leveled when plugging operations are complete.

18. I hereby certify that the foregoing is true and correct

SIGNED O.B. Whitenburg JS

TITLE Drilling Engineer

DATE 5-20-75

(This space for Federal or State office use)

TITLE

DATE

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side