

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)


1. oil well ☒ gas well ☐ other ☐
2. NAME OF OPERATOR
Merrion Oil & Gas Corporation
3. ADDRESS OF OPERATOR
P. O. Box 1017, Farmington, New Mexico 87401
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 510' FSL & 1980' FEL
AT TOP PROD. INTERVAL: Same
AT TOTAL DEPTH: Same
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

- TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☐

SUBSEQUENT REPORT OF:

- ☐
☐
☐
☐
☐
☐
☐
☒
☐

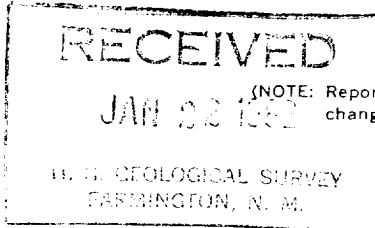

5. LEASE
14-20-603-2198
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
Navajo Tribal
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Navajo # Tribal II
9. WELL NO.
3
10. FIELD OR WILDCAT NAME
Totah Gallup
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 13, T29N, R14W
12. COUNTY OR PARISH
San Juan
13. STATE
New Mexico
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)
5327 KB

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Well was plugged and abandoned 5/18/81 as per attached reports.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED James H. Hannon TITLE President DATE 1/22/82

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

APPROVED
AS AMENDED

Approved as to plugging of the well bore.
Liability under bond is retained until
surface restoration is completed.

*See Instructions on Reverse Side

NMOCC

JAN 15 1985
S/ James K. Edwards, Jr.
M. MILLENBACH
Acting AREA MANAGER

May 18, 1981

Merrion & Bayless
P. O. Box 507
Farmington, New Mexico 87401

INVOICE

For plug and abandonment of your Navajo H #3, located in the South-east Quarter (SE $\frac{1}{4}$) of Section 13, in Township 29 North of Range 14 West, San Juan County, New Mexico, as follows:

Rig Time

<u>5-13-81</u>	Move in, rig up, unseat pump, pull rods and pump. work tubing free, pull on joint. 11 Hrs. @90.00	990.00
<u>5-14-81</u>	Circulate hole, spot 10 sx at 5112', pull tubing to 4730', spot 10 sx at 4730', pull tubing out of hole. Set 1 joint tubing in slips with Packer off and Boom down. 11 Hrs. @90.00	990.00
<u>5-14-81</u>	Perf. 4 holes at 3510', perf. 4 holes at 2650' Perf. 4 holes at 2045'. Go in hole with Packer on tubing. Set Packer at 3250', Dowell squeeze with 35 sx. Pull Packer to 2470', set Packer Dowell squeezed with 165 sx. WOC Release Packer, circulate. 15 hrs. @90.00	1,350.00
<u>5-16-81</u>	Pull tubing and Packer out of hole. Set and level Hydraulic Jacks. Remove landing slips, work casing. Shut well in with swedge and valve. 8 Hrs. @90.00	720.00
<u>5-18-81</u>	Shot casing off at 2018', spot 23 sx plug 2050' to 1950', pull casing to 1020', spot 38 sx, pull casing to 650', spot 38 sx, pull casing to 256'. Spot 38 sx plug. Pull rest of casing. Rig down, prep. to move. Install P & A marker with 10 sx. 5 Hrs. NRT CH 5 Hrs. @90.00	450.00