

E-24-29N-9W
45-30650

**Simmons E3C
Completion Reports**

12/31/01

SICP = 300 psi. Well logged off @ 3:00 am. TIH and tag sand at 5329'. Clean out to 5456' w/air & mist. TOH with 20 stands. RU for flowback overnight. SDFN.

1/2/02

SICP = 310 psi. Blow well down. TIH and tag sand at 5,320'. Clean out to 5,354'. TOH to 4,360'. Flow natural 3 hrs. Secure well, SDFN.

1/3/02

SICP = 325 psi. TIH. Tag sand at 5,424'. Clean out to remainder of composite bridge plug. RU power swivel and drill plug in 36 mins. RD power swivel. Clean out to 5,521'. TOH with 18 stands. SDFN.

1/04/02

REPAIR HYDROMATIC

1/05/02

SICP = 325 psi. TIH and tag sand at 5,500', 25' fill. Clean out to 5,650'. TOH. LD bit and sub. MU expendable check 1 jt from bottom. TIH and tag 15' sand after 2 hrs and 45 mins. Secure well, SDFN.

1/07/02

SICP = 320 psi. TIH and tag sand at 5,620', 30' fill. Clean out to 5,683'. LD 14 jts tubing. Land well at 5,275'. ND BOPE. Pump OFF ex check at 650 psi. Blow well around. RD unit & equipment and move off. Well released to Production foreman.

**Simmons E3C
Completion Reports**

12/14/01

MIRU DJS Rig 111

12/15/01

RU floor, NU BOPE. TIH, slm, with bit, bit sub and 178 jts of 2 3/8 tubing. Tag cement at 5738'. TOH 10 stds. SDFN.

12/17/01

RU pump, TIH and tag cement @ 5738'. Clean out to 5742'. Circ hole clean. TOH, lay down bit. SDFN.

12/18/01

RU Blue Jet. Ran CBL, top of good cement at 3060', stringers above at least to top of log at 2725'. to log w/ Blue jet. Run CBL & GSL. RD Blue jet. Travel in. SDFN

12/19/01

RU Blue Jet. Perforate first stage with one hole each at 5274', 5267', 5254', 5250', 5241', 5239', 5224', 5218', 5215', 5210', 5195', 5193', 5189', 5184', 5181', 5178', 5162', 5037', 4997', 4985', 4981', 4973', 4957', 4953', and 4908' (25 holes). Inspect gun all 25 shots OK. RD Blue Jet. MU casing scraper & bit. Round trip same, no fill. Change tools to 2 7/8" tbg for frac. SDFN.

12/20, 12/21, 12/22, 12/23, 12/24, 12/25, 12/26/01

Standby for Frac.

**Simmons E3C
Completion Reports**

12/27/01

PU 2 jts 2 7/8 tbg for Frac isolation. MU packer and set same at 64'. American Energy did not have correct x-over on location. LD packer and tbg. RU Stinger and American Energy. Break down perforations with 1500 gals 15% HCL and 30 balls at 11 bpm. No ball action, did not ball off. RU Blue Jet and ran junk basket. Recovered 20 balls with 10 hits. RU Stinger. Frac First Stage with 87,145.8 gals 3% KCL slick water and 112,720 lbs of 20/40 sand. Average rate 44 bpm at 1000 psi. ISIP = vacuum. RD Stinger. RU Blue Jet. Set Weatherford composite bridge plug @ 4800'. Pressure test plug to 3,950 psi. RU Blue Jet and perforate Second Stage as follows: 4664', 4660', 4654', 4650', 4647', 4643', 4641', 4636', 4634', 4617', 4613', 4610', 4573', 4570', 4563', 4561', 4556', 4554', 4514', and 4425' (20 holes). RU Blue Jet and ran junk basket. Did not land on composite bridge plug and did not recover balls. RU to frac Second Stage. Frac second stage with 134,400 gals 3% KCL slick water and 118,270 lbs of 20/40 sand, average rate 45 bpm at 2400 psi. ISIP = 760 psi. RD and SDFN.

12/28/01


Well on vacuum. RU floor & Blooie line. TIH with bit and 2 3/8" tubing. Tag sand @ 4,329'. Clean out to 4,450'. TOH 9 stands. SDFN.

12/29/01

SICP = 315 psi. Blow well down. TIH with 9 stands. Unload well, had 50' new fill. TOH with 6 stands. Repair air compressor. TIH. Clean out to 4,778'. TOH with 10 stands. SDFN.

12/30/01

SICP = 550 psi. Blow well down. TIH with 10 stands. Tag 30' new fill. Clean out to composite bridge plug. Drill plug in 36 min. Circ with air mist. TOH with 12 stands. RU to flow back overnight. Note: Report from flow back men @ 8:25 pm, 25' flare and water flowing at 7.8 bbls/hr, flowing natural.

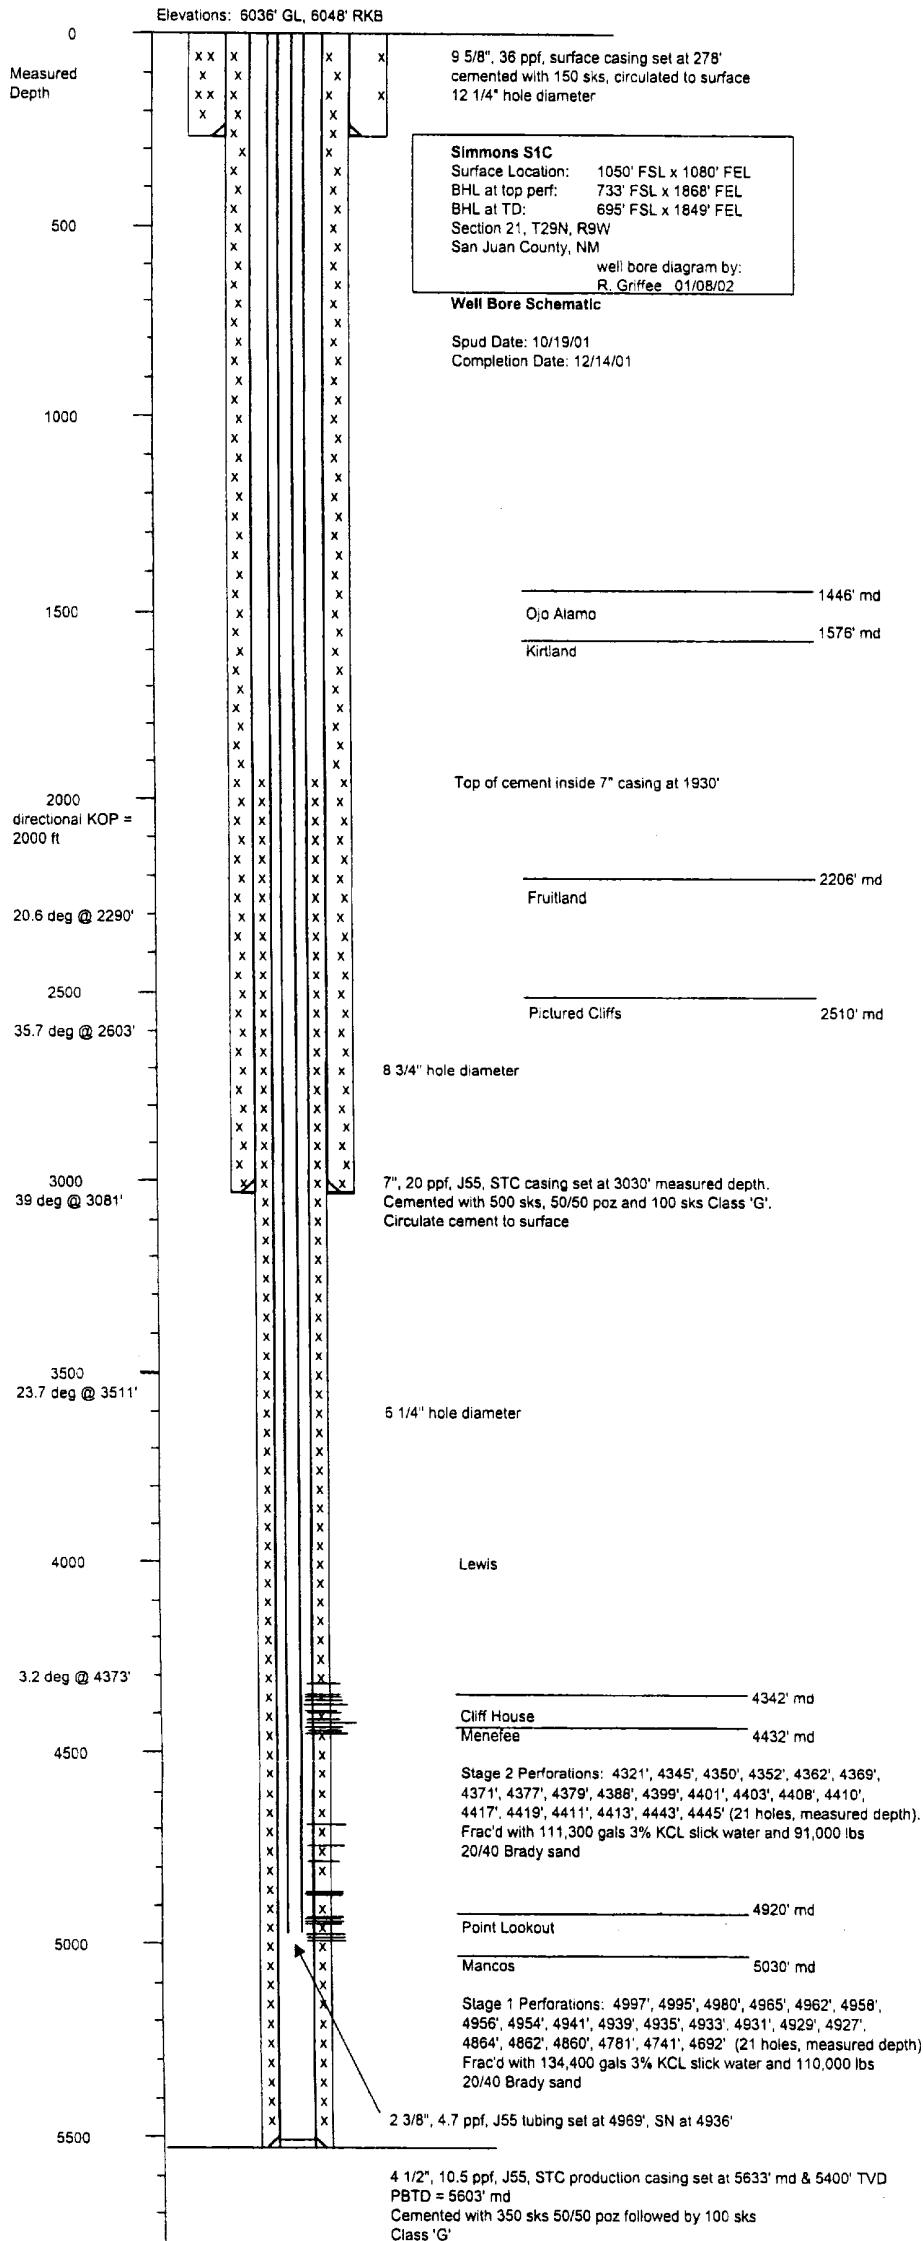

21/11