

N. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	/
FILE	/
U.S.G.S.	
LAND OFFICE	
OPERATOR	/

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
E-505-6

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - 1" (FORM C-101) FOR SUCH PROPOSALS.)


1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name Northeast Blanco Unit No. 1, Sec. 929
2. Name of Operator Blackwood & Nichols Company	8. Farm or Lease Name Northeast Blanco Unit
3. Address of Operator P. O. Box 1237, Durango, Colorado 81301	9. Well No. 21
4. Location of Well UNIT LETTER N, 990' FEET FROM THE S LINE AND 1800 FEET FROM THE W LINE, SECTION 36, TOWNSHIP 31N, RANGE 7W, NMPM.	10. Field and Pool, or Wildcat Blanco Mesaverde
15. Elevation (Show whether DF, RT, GR, etc.) 6475 GL	12. County Rio Arriba

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Set 7" retainer at 5200', squeeze Mesaverde perforations (5348' - 5830') with 175 sacks cement. Perforate 7" casing at 3025', cement with 50 sacks cement; 100' inside and outside casing. Perforate 7" casing at 2150', cement with 50 sacks cement; 100' inside and outside casing. Perforate 7" casing at 750', cement with 50 sacks cement; 100' inside and outside casing. Spot 20 sacks cement plug in 7" casing at surface and squeeze Bradenhead (between 7" and 10-3/4" casing) with 25 sacks cement.

See attached diagram

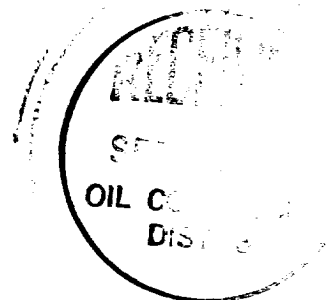

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED DeLasso Loos TITLE District Manager DATE 8-30-76

APPROVED BY AM Bendrick TITLE SUPERVISOR DIST. #3 DATE SEP 3 1976

CONDITIONS OF APPROVAL, IF ANY:

NEBU NO. 21  
 990' F/SL - 1800' F/WL  
 Sec. 36-31N-7W  
 Rio Arriba County, New Mexico  
 Elevation 6475' G.L.  
 Plug and Abandon

