

NEW MEXICO OIL CONSERVATION COMMISSION  
Santa Fe, New Mexico

MISCELLANEOUS NOTICES

Submit this notice in TRIPLICATE to the District Office, Oil Conservation Commission, before the work specified is to begin. A copy will be returned to the sender on which will be given the approval, with any modifications considered advisable, or the rejection by the Commission or agent, of the plan submitted. The plan as approved should be followed, and work should not begin until approval is obtained. See additional instructions in the Rules and Regulations of the Commission.

Indicate Nature of Notice by Checking Below

NOTICE OF INTENTION TO CHANGE PLANS		NOTICE OF INTENTION TO TEMPORARILY ABANDON WELL		NOTICE OF INTENTION TO DRILL DEEPER	
NOTICE OF INTENTION TO PLUG WELL		NOTICE OF INTENTION TO PLUG BACK		NOTICE OF INTENTION TO SET LINER	
NOTICE OF INTENTION TO SQUEEZE		NOTICE OF INTENTION TO ACIDIZE		NOTICE OF INTENTION TO SHOOT (Nitro)	
NOTICE OF INTENTION TO GUN PERFORATE		NOTICE OF INTENTION (OTHER)		NOTICE OF INTENTION (OTHER) <b>Re-work</b>	<b>X</b>

OIL CONSERVATION COMMISSION  
SANTA FE, NEW MEXICO

**Farmington, New Mexico**  
(Place)

**July 3, 1961**  
(Date)

Gentlemen:

Following is a Notice of Intention to do certain work as described below at the.....

**El Paso Natural Gas Company** **Thompson** Well No. **2** in **M**  
(Company or Operator) (Unit)

**SW**  $\frac{1}{4}$  **SW**  $\frac{1}{4}$  of Sec. **34**, T. **30-N**, R. **8-W**, NMPM., **Blanco Mesa Verde** Pool  
(40-acre Subdivision)

**San Juan** County.

FULL DETAILS OF PROPOSED PLAN OF WORK

(FOLLOW INSTRUCTIONS IN THE RULES AND REGULATIONS)


It is intended to workover this well in the following manner:

1. Pull tubing, make trip with bit to 4670'.
2. Set bridge plug att approximately 4600'.
3. Attempt to clean out to bridge plug using gas. If well dries up, run Lane Wells Potential Survey and McCullough Magnetic Survey. If Surveys show that casing is extremely bad, run free point, cut and pull 7" casing for inspection.
4. If well does not dry up, run McCullough Magnetic Survey, cut and pull casing if survey warrants such action.
5. Mud up and condition open hole.
6. Run new 7" casing with casing bowl.
7. Clean out to bridge plug and test casing to 2000 psi. Squeeze if necessary.
8. Drill bridge plug and clean out to total depth.
9. Run tubing.

Approved JUL 7 1961, 19.....  
Except as follows:

**El Paso Natural Gas Company** **CON. COM.**  
Company or Operator  
 Original Signed **D. W. Meehan** **DIST. 3**

By.....  
**Petroleum Engineer**  
 Position.....  
 Send Communications regarding well to:

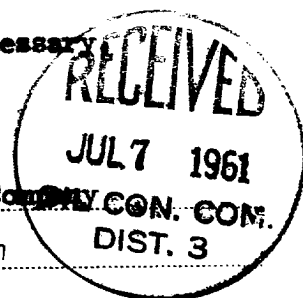

Approved  
 OIL CONSERVATION COMMISSION  
 By **Original Signed Emery C. Arnold**  
 Title **Supervisor Dist. # 3**

Name **E. S. Oberly**  
 Address **Box 990, Farmington, New Mexico**

STATE OF NEW MEXICO		
OIL CONSERVATION COMMISSION		
AZTEC DISTRICT OFFICE		
NUMBER OF COPIES RECEIVED		3
DISTRIBUTION		
SANTA FE		1
FILE		1
U.S.G.S.		1
LIMIT OFF.		
TRANSPORTER	OIL	
	GAS	
PROMOTION OFFICE		
OPERATOR		1