

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

N. M. 05859

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☒ GAS WELL ☐ OTHER Water Injection well

2. NAME OF OPERATOR

Clinton Oil Co.

3. ADDRESS OF OPERATOR

P. O. Box 2434, Casper, Wyoming 82601

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

560' FSL & 660' FWL

7. UNIT AGREEMENT NAME

L. W. Swarts

8. FARM OR LEASE NAME

N. E. Hogback Unit

9. WELL NO.

17

10. FIELD AND POOL, OR WILDCAT

Horseshoe Gallup

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 13, T30N-R16W

12. COUNTY OR PARISH

San Juan

13. STATE

N. M.

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5351' G. L.

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Squeeze 25 sks cement down tbgs. below pkr @ 3816'

Spot 20 sk. plug 3816'-3666'.

Shoot 5 1/2" csg. @ 2850'.

Spot 25 sk. cement plug 2900'-2800'.


Spot 50 sk. plug 2190'-2040'.

Spot 30 sk. plug 900'-800'.


Spot 20 sk. plug 211'-161'.

Spot 10 sk. plug 0'-30'.

Install hole marker.

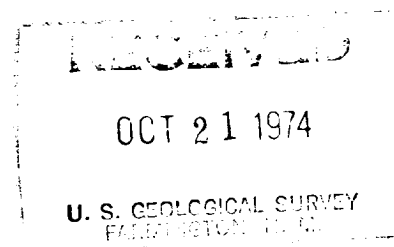

USGS will be notified when location is cleaned up and ready for final inspection.

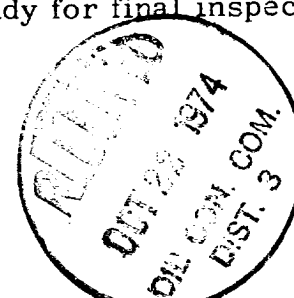

18. I hereby certify that the foregoing is true and correct

SIGNED

Walter B. Barnes

TITLE

Production Engineer

DATE October 11, 1974

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side