

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE\*  
(Other instructions on re-  
verse side)

Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF-080244

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Riddle

9. WELL NO.

4

10. FIELD AND POOL, OR WILDCAT

Blanco-Pictured Cliff

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 21, T-30-N, R-9-W

12. COUNTY OR PARISH 13. STATE

San Juan

New Mexico

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐ Convert to Dual

2. NAME OF OPERATOR

Tenneco Oil Company

3. ADDRESS OF OPERATOR

Suite 1200 Lincoln Tower Building, Denver, Colorado 80203

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface

1185' F/NL and 790' F/EL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5933 GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other) Convert to Dual

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)


REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Move in completion unit to recomplate in Fruitland and dual produce well, Kill well with treated water, pull out 1-1/4" tubing, set Baker Model FA Packer with Knock out plug at 2650', test Packer w/4000 psi, Perforate Fruitland Zone w/2 SPF at 2366-2375, 2398-2410, 2453-2462, Acidize with 250 gals 15% HCL, Frac SI well for 12 hours, open well to clean up and Run AOF, Re-Run tubing into Model FA Packer.

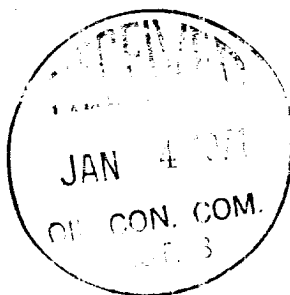

DEC 3 1970

U.S. GEOLOGICAL SURVEY

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Sr. Production Clerk

DATE 12-23-70

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: