

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE\*  
(Other instructions on re-  
verse side)

Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF- 078385

6. INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Florence

9. WELL NO.

39A

10. FIELD AND POOL, OR WILDCAT

Blanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 35-T30N-R8W

12. COUNTY OR PARISH 13. STATE

San Juan

New Mexico

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Tenneco Oil Company

3. ADDRESS OF OPERATOR

1860 Lincoln Street, Denver, Colorado 80203

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface

1745' FSL and 810' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6130' GL

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON\* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☒

SHOOTING OR ACIDIZING ☒

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT\* ☐

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

7/10 PB 5215. Swabbed perfd in acid, 11 holes in Chacra 3707, 10, 19, 25, 27, 35, 39, 41, 43. Fractured down tubing 30,000 gallons F4G w/7000#100 mesh; 50,000 20/40, breakdown 1000 psig AIR 24 bpm average press. 1200. Followed with 3,000 gallon 15% acid at 7 bpm at 800 psi, ISIP 400, 15 min SIP-vac. 979 wtr. POH with tubing & SN, set at 4704' started swabbing. FL 1200.


7/15 Squeezed perfs. with 150 sacks cement. Final press 2000.

7/17 Perforated Fruitland 2857, 2833, 2824, 2790, 2783, 2778, 2762, 2760, 2703, 2693, 2688, 2685, 2645, 2642, 2638 15 holes. Fractured down casing with 50,000 gallons slick water, 50,000 #20-40 sd, 25,000 #10-20 S.D. air 40 bpm, average testing pressure 2400 psi. ISIP 1500 psi 5 min SIP 1200 psi.

7/18- 7/21 Cleaned and tested

7/22 Installed dual X-mas tree

7/31 12 hrs. SITP 400, CP 750. Ran dual tubing string to 2741. Ran swab found FL at 1700 made 3 runs received 12 blw.

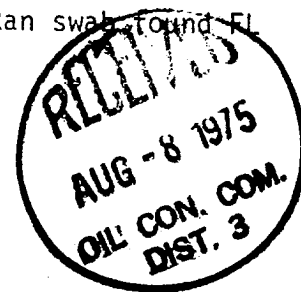

18. I hereby certify that the foregoing is true and correct

SIGNED

*[Signature]*

TITLE

Production Clerk

DATE

8/5/75

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

\*See Instructions on Reverse Side