

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATES
(Other instructions on reverse side)

Expires AUGUST 31, 1984

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Amoco Production Co.

3. ADDRESS OF OPERATOR

2325 E. 30 St., Farmington, NM 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)

At surface

1100' FNL x 990' FWL

BUREAU OF LAND MANAGEMENT
FARMINGTON RESOURCE AREA

14. PERMIT NO.

15. ELEVATIONS (Show whether DT, RT, OK, etc.)

5701' GR

5. LEASE DESIGNATION AND SERIAL NO.

SF-081239

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Johnson Gas Com E

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Flora Vista Mesaverde

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

NW/NW Sec 15, T30N, R12W

12. COUNTY OR PARISH

San Juan

13. STATE

NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PLUG OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

(NOTE: Report results of multiple completion or Well Completion or Recompletion Report and Log form.)

SUBSEQUENT REPORT OF:

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Amoco Production Company requests approval to plug and abandon the subject well according to the attached procedure.

NOTE: Verbal approval for this procedure was given to Ed Alizadeh of Amoco by Errol Becher on 12-11-86.

18. I hereby certify that the foregoing is true and correct

SIGNED

B. Shaw

TITLE

Adm. Supervisor

APPROVED

DATE 12-11-86

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

John Skellern

FARMINGTON RESOURCE AREA

*See Instructions on Reverse Side



FARMINGTON DISTRICT
COMPLETION PROCEDURE
PxA

Date: 12/10/86

WELL NAME: Johnson G.C. E No. 1

FIELD Flora Vista Mesaverde

LOCATION: 1100' ENL x 496' FWL S. 15 30N - 12W

FORMATION(S) Mesaverde

Sin Juan County, New Mexico

ELEVATIONS: KB: 5714 TD: 4726 PBD: 4620

CASING: 9 5/8" 32.3 # 4-40 @ 328

7" 20 # k-55 @ 2365

Liner 4 1/2" 10.5 # from 2247 - 4725

LOGS: Induction, Density - Neutron

DV TOOL SET AT: None

PURPOSE: Plug and abandon the wellbore

DBB TWE GOM MCH RWO/AJM 2DF ENGR FILE


BJW

RGH
BVD
GMK

Note: Place 9.2 ppg mud between all plugs
Verbal approval from Earl Becker 12/11/86

WELLBORE SKETCH

PROCEDURE

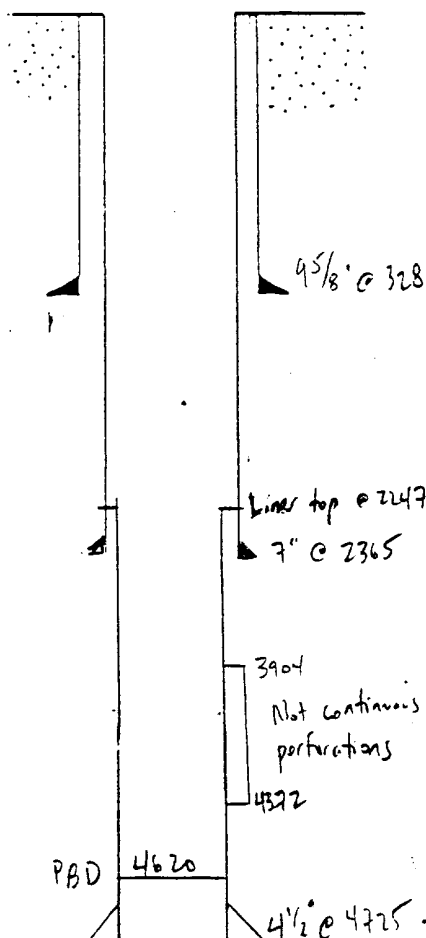

1) MURUSU

2) Tolt x plug x rods if rods are still in the well.

3) Tilt x cast iron BP. set BP @ 3875'

4) Spot 5 sacks of cement in the BP.

5) Pull up and spot cement from 3681 - 3581

6) Pull up and spot cement from 2824 - 2724.

7) Pull up and spot cement from 2000 - 1900

8) Pull up and spot cement from 1733 - 1638.

9) Pull up and cement from 373 to surface.

10) Erect a dry hole marker w/ a metal sheet displaying section, township, and range on a concrete block at least 4' above ground level.

DISTRICT MANAGER

DISTRICT ENGINEER

DISTRICT DRILLING SUPERVISOR

ENGINEER

DATE

