

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well  gas well  other

2. NAME OF OPERATOR  
Dugan Production Corp.

3. ADDRESS OF OPERATOR  
P O Box 208, Farmington, NM 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: 1840' FSL - 790' FWL  
AT TOP PROD. INTERVAL: 1755'  
AT TOTAL DEPTH: 1870'

5. LEASE  
NM 030555A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
Dare Devil

9. WELL NO.  
#2

10. FIELD OR WILDCAT NAME  
Pictured Cliffs

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Sec 10 T30N R13W

12. COUNTY OR PARISH  
San Juan

13. STATE  
NM


14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)  
5720' GL

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:		SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF	<input type="checkbox"/>	<input type="checkbox"/>
FRACTURE TREAT	<input type="checkbox"/>	<input type="checkbox"/>
SHOOT OR ACIDIZE	<input type="checkbox"/>	<input checked="" type="checkbox"/>
REPAIR WELL	<input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING	<input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE	<input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES	<input type="checkbox"/>	<input type="checkbox"/>
ABANDON*	<input type="checkbox"/>	<input type="checkbox"/>
(other)		

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

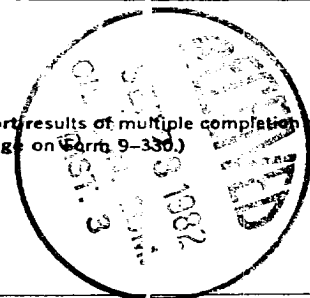

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

7-2-82 MI & RU Hinson Service Co. and Geosource perforators. Swabbed well down to 600'. Perforated Fruitland Formation at intervals from 1302-1313', 11 feet total, 1 SPF. Swabbed well down, waited 10 minutes, made another run, no indication of fluid entry; slight show of gas following swab.

Rigged up Cementer's Inc. Acidized with 250 gal. of 15% HCL. Breakdown - 1000#. Displaced with 7 bbls. of water. (2 1/2 BPM at 650# - pumping rate, acid). Made 2 swab runs. Well kicked off, making est. 20-40 MCF. Swabbed well dry. Shut in. Rigged down.

Plan to run tubing by 9-24-82 and test well.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Sherman E. Dugan TITLE Agent DATE 9-15-82  
Sherman E. Dugan

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

ACCEPTED FOR RECORD

SEP 22 1982