

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☐ GAS WELL ☒ OTHER-

Name of Operator

C. & E. Operators, Inc.

Address of Operator

Suite 1100, Two Energy Square, Dallas, Texas 75206

Location of Well

UNIT LETTER A . 1010 FEET FROM THE North LINE AND 900 FEET FROM
THE East LINE, SECTION 12 TOWNSHIP 30N RANGE 12W NMPM.

7. Unit Agreement Name

8. Farm or Lease Name

Fee

9. Well No.

12 - A

10. Field and Pool, or Wildcat

Blanco *mv*

15. Elevation (Show whether DF, RT, GR, etc.)

5850' Gr.; 5862' KB

12. County

San Juan

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

FORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
PERMANENTLY ABANDON ☐
REPAIR OR ALTER CASING ☐ CHANGE PLANS ☐
OTHER ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☒ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Set 60' of 13-3/8" 48# conductor pipe by Corrosion Control in May, 1982. Not cemented. Had boulders in the area.

June 16, 1982. Move in Young Drlg. Rig #2. Rig up and start drilling @ 8:00 PM under conductor @ 72' KBM, 60' GL. Drill 12-1/4" hole to 276'. Ran 6 jts. 9-5/8" 36# J SS, C1. A Casing. Tally 256.21'. Set @ 270' and cemented by WOODCO with 145 sx. C1. B, 2% CaCl. & 1/4#/sx. cello flakes. Displace plug to 250'. Cement circulated. Plug down @ 1:30 AM June 17, 1982. WOC 14 1/2 hrs. Install BOP's and bleed-off lines. Pressure test to 600 psi. for 30 min. OK. Drill out after 16 hrs. with light gel chemical mud.

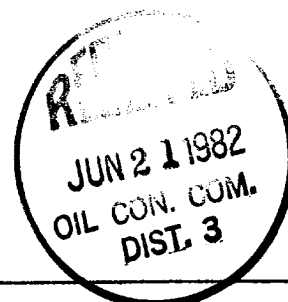

hereby certify that the information above is true and complete to the best of my knowledge and belief.

John M. Heller
John M. Heller

Consultant
Field Agent

DATE June 19, 1982

Original Signed by CHARLES GHOLSON

TITLE DEPUTY OIL & GAS INSPECTOR, DIST. #1

DATE JUN 21 1982

CONDITIONS OF APPROVAL, IF ANY: