

Submit 3 Copies To Appropriate District Office
 District I _____
 1625 N. French Dr., Hobbs, NM 88240
 District II _____
 1301 W. Grand Ave., Artesia, NM 88210
 District III _____
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV _____
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 March 4, 2004

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-025-02185
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-4118
7. Lease Name or Unit Agreement Name West Vacuum Unit
8. Well Number 16
9. OGRID Number
10. Pool name or Wildcat Vacuum Grayburg San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
 Oil Well Gas Well Other Injection

2. Name of Operator
 Chevron USA Inc

3. Address of Operator
 15 Smith Rd, Midland, TX 79705

4. Well Location
 Unit Letter G : 1980 feet from the North line and 1980 feet from the East line
 Section 33 Township 17-S Range 34-E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached)

Pit Location: UL G Sect 33 Twp 17S Rng 34E Pit type Steel Depth to Groundwater 87 Distance from nearest fresh water well Over 1000'
 Distance from nearest surface water _____ Below-grade Tank Location UL _____ Sect _____ Twp _____ Rng _____ ;
1980 feet from the North line and 1980 feet from the East line (Steel Tank)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:


- PERFORM REMEDIAL WORK PLUG AND ABANDON
 TEMPORARILY ABANDON CHANGE PLANS
 PULL OR ALTER CASING MULTIPLE COMPLETION
 OTHER:

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ALTERING CASING
 COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT
 CASING TEST AND CEMENT JOB
 OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- Notified OCD with P&A intent.
- RIH Tag CIBP at 4050, spot 25sx, plug from 4050-3800 (S. Andres) WOC Tag at 3797.
- Displace hole w/MLF, 9.5# Brine w/12.5# gel P/BBL.
- Spot 25sx, plug from 2600-2400 (Yates, B-Salt).
- Perf 5 1/2" csg at 1725, unable to pump in, spot 25sx (8 5/8 Shoe, T-Salt) WOC Tag at 1450.
- Perf 5 1/2" csg at 250 (Surf), Circ cmt to Surf with 75sx cmt, WOC Tag at Surf.
- Install dry hole marker 11-29-04

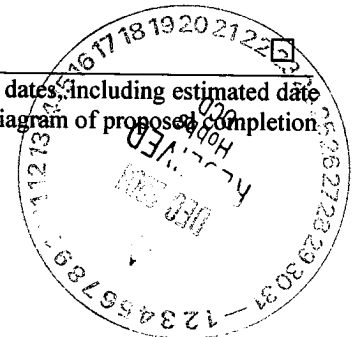

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative OCD-approved plan .

SIGNATURE _____ TITLE Consultant DATE 11-29-04

Type or print name Jimmy Bagley E-mail address: _____ Phone No. 432-561-8600

(This space for State use)

APPROVED BY Larry W. Wink TITLE _____ DATE DEC 06 2004

Conditions of approval, if any:

Approved as to plugging of the Well Bore.
 Liability under bond is retained until
 surface restoration is completed.