
• ~								
Form 3160-5 (August 2007) DE	UNITED STATE PARTMENT OF THE			~	OMB	M APPROVED No. 1004-0137 es: July 31, 2010		
BUR	PARTMENT OF THE REAU OF LAND MAN NOTICES AND REPO	IAGEMENT	HOBRE	Ca	LESSAD For			
				OCD	6. If I di Altre Tr	ibe Name	e	
Do not use this abandoned well.	form for proposals t Use Form 3160-3 (A	to drill or to PD) for su	ch proposals	1.200		UDDS		
	IT IN TRIPLICATE - Other	instructions o	npage 2.EIV	ED	7. If Unit of CA/Agreemer	nt, Name and/or No.		
1. Type of Well Gas W	Well Other				8. Well Name and No. G. L. ERWIN "B"	FEDERAL NCT-2 #	10	
2. Name of Operator CHEVRON U.S.A	A. INC.				9. API Well No. 30-025-3			
3a. Address 6301 DEAUVILLE BLVD. RM #N3002 MIDLAND, TX. 79706		3b. Phone No.	(include area code	2)	10. Field and Pool or Explo JUSTIS; TUBB DRI	oratory Area NKARD / BLINEBR	Y	
4. Location of Well (Footage, Sec., T.,	R., M., or Survey Description,				11. Country or Parish, Stat	e		
2,450' FSL & 1,225' FEL, SEC-35, T- 24S, R-3	37E	/			LEA CO	OUNTY, NM.		
12. CHEC	CK THE APPROPRIATE BC	X(ES) TO IND	ICATE NATURE	OF NOTIC	E, REPORT OR OTHER I	DATA		
TYPE OF SUBMISSION			TYP	E OF ACTI	ACTION			
Notice of Intent	Acidize	Deep			action (Start/Resume)	INT TO PA	Ans	
	Alter Casing		ure Treat Construction		mation	P&A NR		
Subsequent Report	Change Plans		and Abandon		nplete orarily Abandon	P&A R		
Final Abandonment Notice	Convert to Injection	Plug		_	Disposal			
Attach the Bond under which the w following completion of the involv testing has been completed. Final determined that the site is ready for ON OR ABOUT 02 / 08 / 17 MI & RI WOC & TAG & TEST. (BLINEBRY MIX & SPOT 25 SX CL "C" CMT FR MIX & SPOT 130 SX CL "C" CMT FR TURN OVER TO RECLAMATION. (CLASS "C" CEMENT USED W/ CLO BOND COVERAGE: CA 0329	red operations. If the operatio Abandonment Notices must be r final inspection.) U, NDWH & NU BOP, RIH) ROM 4,050'-3,850'. (DV TO ROM 3,070'- 2,870'. (QUEI ROM 2,300'- 2,100', (YATE ROM 1,100'- SURFACE, O SURFACE SHOE, SALAI	on results in a m be filed only after TO TOC ON (DOL) EN) ES) CUT OFF WEL	ultiple completion er all requirements, CIBP @ 4,945', C L HEAD 3' BGL,	INSTALL	etion in a new interval, a For reclamation, have been com	orm 3160-4 must be fingleted and the operator	led once or has	
14. I hereby certify that the foregoing is tr	ue and correct Name (Printed	1/Tuned)	CO	NDITIC	JNS OF AFFRO	VAL .		
Monty L. McCarver		-) []	Title SR Mana	der / Agen	t for Chervon U.S.A. Inc.			
	le le				18/2017			
Signature			Date 01/18/201	6 011	10 / 2017			
	THIS SPACE	FOR FEDE	RAL OR STA	TE OFF	ICE USEAPPR	OVED		
Approved by	ngku Muchlis Krue	ng	Title	PETRO	LEUM ENGINE ER	1 0047		
Conditions of approval, if any, are attached that the applicant holds legal or equitable ti entitle the applicant to conduct operations t	tle to those rights in the subject hereon.	t lease which wo	ertify uld Office		BUREALLOFTAND	2017		
Title 18 U.S.C. Section 1001 and Title 43 U fictitious or fraudulent statements or repres	U.S.C. Section 1212, make it a sentations as to any matter with	crime for any per nin its jurisdiction	rson knowingly and	willfully to	make to any department of a	Ency op the United Sta	tes any false,	
(Instructions on page 2)				F	MW OCD 03	20 ONLY		

	A B	AP Within with		
00.1	h	CD	22	In/
	10	UD	03	100
				-

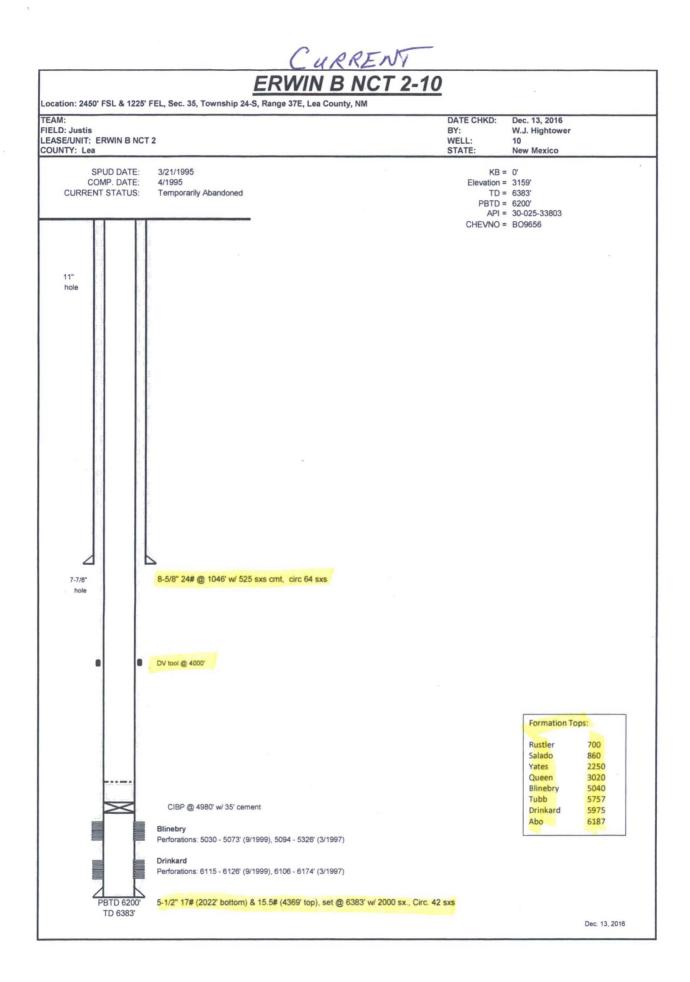

.

P+A ERWIN B NCT 2-10

1

Г

: : Justis E/UNIT: ERWIN B NC TY: Lea	Τ 2	DATE 1 BY: WELL: STATE		Dec. 13, 2016 W.J. Hightower 10 New Mexico
SPUD DATE: COMP. DATE: CURRENT STATUS:	3/21/1995 4/1995 Temporarily Abandoned		PBTD =	3159' 6383' 6200' 30-025-33803
11" hole 1.5 55 55				
7-7/8" hole	> 1305 8-5/8" 24# @ 1046' W/ 525 255X = 255X = 255X = 255X = 255X =	00- Sur FACE 0-2,100, - 2,870 050-3,850'		
MLF				Formation Tops: Rustler 700 Salado 860
	255X 4, 2 CIBP @ 4980' w/ 35' ceme Blinebry Perforations: 5030 - 5073' (9/1	4,745 TAG+TEST	-	Yates 2250 Queen 3020 Blinebry 5040 Tubb 5757 Drinkard 5975 Abo 6187
	Drinkard Perforations: 6115 - 6126' (9/1	74' (3/1997)		

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.