

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.

30-025-37790

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name
Century State

8. Well Number 1

9. OGRID Number
229137

10. Pool name or Wildcat
Leamex Paddock, North

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
COG Operating, LLC

3. Address of Operator
600 W. Illinois, Midland, TX 79701

4. Well Location

Unit Letter G : 2310 feet from the N line and 2310 feet from the E line
Section 3 Township 17S Range 33E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4180' GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT

REMEDIAL WORK
COMMENCE DRILLING OPNS.
CASING/CEMENT JOB

OTHER: ☐

INT TO PA Amx
P&A NR
P&A R

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Set 5 1/2 CIBP @ 6150'. Circulate hole w/ MLF. Pressure test csg. Spot 95 sx cmt @ 6150-5406' (T/Glor, DV TOOL). WOC & Tag.
2. Spot 55 sx cmt @ 4570-4160'. (T/SA, T/GRBG)
3. Spot 30 sx cmt @ 2967-2763'. WOC & Tag. (Shoe, Yates)
4. Cut & POH 5 1/2 csg @ +/- 1600'.
5. Spot 25 sx cmt @ 1660-1550'. WOC & Tag. (Stub)
6. Spot 40 sx cmt @ 400-300'. WOC & Tag (Shoe)
7. Spot 25 sx cmt @ 63'-surface.
8. Cut off well head, weld on Dry Hole Marker.

Verify cmt to surface
all strings

Spud Date:

Rig Release Date:

NOTIFY OCD 24 HOURS PRIOR TO
BEGINNING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Abigail Montgomery TITLE Agent DATE 3/1/14
Type or print name Abigail Montgomery E-mail address: abby@bemandassociates.com PHONE: 432-580-7161
For State Use Only

APPROVED BY: Mark Whitaker TITLE Petroleum Engr. Specialist DATE 03/07/2017
Conditions of Approval (if any):

COG Operating LLC

Lease & Well # Century State #1


API#: 30-025-37790

G-03-17S- 33E 2310FNL 2310 FEL

7/25/2006

Elevation - 4180'

KB -

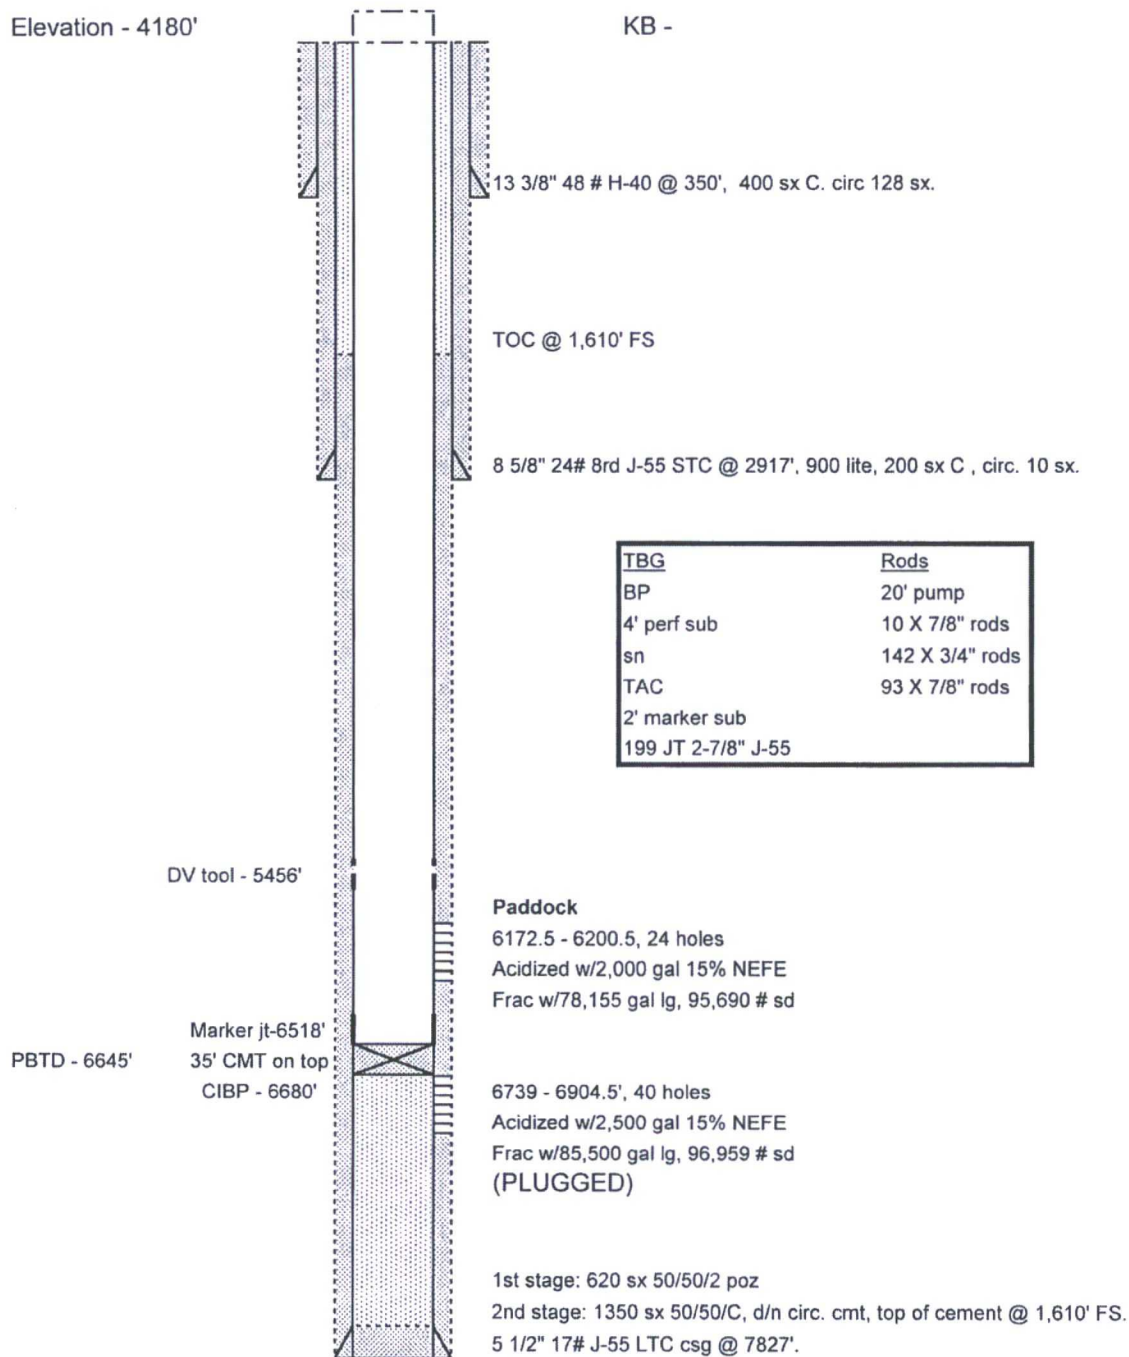

3/1/2017

Century St #1 Wellbore diagram

32.8647003
-103.6500778
SHodges

COG Operating LLC


Lease & Well # Century State #1

API#: 30-025-37790

G-03-17S-33E 2310FNL 2310 FEL

7/25/2006

Elevation - 4180'

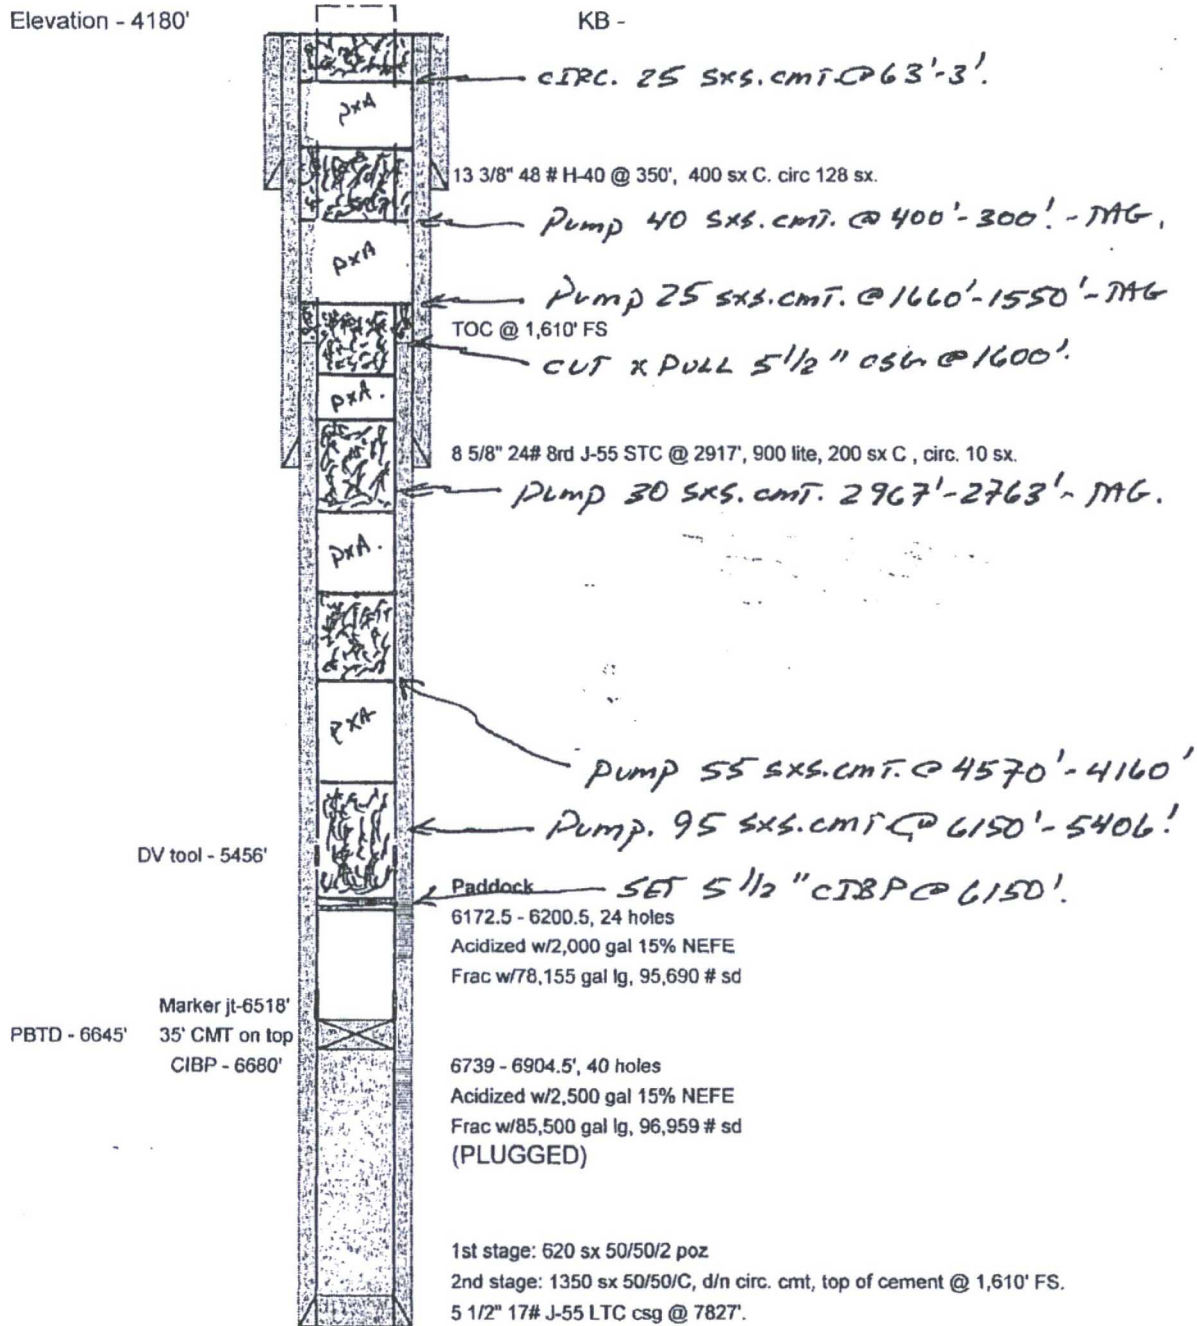

7/28/2014

Century State #1 Wellbore diagram

DAE 08/15/14 SHodges