(DO NOT USE THIS FORM FOR PROP	State of New Me Energy, Minerals and Natur OIL CONSERVATION 1220 South St. Fran Santa Fe, NM 87	TAI Resources DIVISION Icis Dr. 2505	Form C-103 Revised July 18, 2013 WELL API NO. 30-015-00944 5. Indicate Type of Lease STATE AFEE 6. State Oil & Gas Lease No. 7. Lease Name or Unit Agreement Name
PROPOSALS.)   1. Type of Well: Oil Well Gas Well Other INJECTION   2. Name of Operator   State of New Mexico formerly Canyon E&P Company   3. Address of Operator			Artesia Metex Unit 8. Well Number 8. OGRID Number 269864 10. Pool name or Wildcat
1625 N. French Drive Hobbs, NM 88249 Artesia QU-GB-SA   4. Well Location Unit Letter I : 2310 feet from the South line and 990 feet from the East line   Section 24 Township 18S Range 27E NMPM County Eddy   11. Elevation (Show whether DR, RKB, RT, GR, etc.) Interval			
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data   NOTICE OF INTENTION TO:   PERFORM REMEDIAL WORK PLUG AND ABANDON   TEMPORARILY ABANDON CHANGE PLANS   PULL OR ALTER CASING MULTIPLE COMPL   CLOSED-LOOP SYSTEM OTHER:   OTHER: OTHER:   13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion.			
SEE ATTACHMENTS			HOBBS OCD JUL 1 0 2018 RECEIVED
Spud Date:	Rig Release Da	te:	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.   SIGNATURE SIGNATURE   Mark Whitaker   E-mail address: PHONE: 575-393-6161   For State Use Only Mark Whitaker   APPROVED BY: Mark Whitaker   Conditions of Approval (if any): FITLE			


Canyon E&P Company Artesia Metex Unit No. 8 30-015-00944 2310' FSL & 990' FEL UL – I, Sec. 24, T18S, R27E

8 5/8" 28# csg at 480' w/ 50 sx cmt. 4 ½" 10.5# CSG at 2037' w/ 250 sx cmt. TOC 1315' by CBL Perfs 1896' – 2034' TD 2045'

- 1. MIRU plugging equipment. POOH w/ production equipment.
- 2. Run gauge ring. Set CIBP at 1800'. Circulate hole w/ mud laden fluid and pressure test casing to 500 psi.
- 3. Spot 50 sx cement.
- 4. Perforate at 530'. Pump sufficient cement to circulate to surface inside/outside of 5 ½" casing.
- 5. Cut off wellhead 3 feet below ground level.
- 6. Verify cement to surface on all strings.
- 7. Install upright P&A marker and cut off anchors.

NOTES: Mud laden fluid consists of 9.5 ppg with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to proceeding with P&A.

## **Canyon E P Company** Artesia Metex Unit No. 8

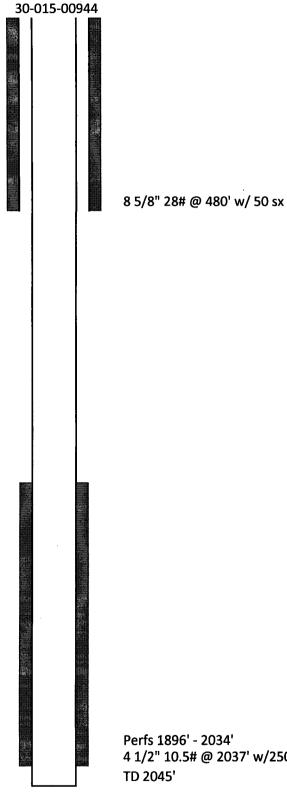

CURRENT

Perfs 1896' - 2034' 4 1/2" 10.5# @ 2037' w/250 sx TOC by CBL 1315' TD 2045'

NOTES:

PA'd 1969

250 Qts Nitro 1995' - 2040'

2 7/8" tbg @ 1789' AD-1 pkr 1" riser installed on surface csg

Re-entered 1975 & 4 1/2" csg run

## Canyon E P Company Artesia Metex Unit No. 8

## INSTALL P&A MARKER CUT OFF WELLHEAD 3' BELOW GL

CIRCULATE CEMENT TO SURFACE PERFORATE AT 530'.

8 5/8" 28# @ 480' w/ 50 sx



**PROPOSED** 30-015-00944

SPOT 50 SX CMT. \* CIRC MLF. PRESSURE TEST CSG. SET CIBP AT 1800'.

Perfs 1896' - 2034' 4 1/2" 10.5# @ 2037' w/ 250 sx TD 2045'

\* NO TAG NECESSARY IF CSG TESTS GOOD