Submit 1 Copy To Appropriate District OfficeState of New MexicoDistrict 1- (575) 393-61611625 N. French Dr., Hobbs, NM 88240Energy, Minerals and Natural ResourcesDistrict 11- (575) 748-1283811 S. First St., Artesia, NM 88210OIL CONSERVATION DIVISIONDistrict 111- (505) 334-61781000 Rio Brazos Rd., Aztec, NM 874101220 South St. Francis Dr.District IV- (505) 476-34601220 S. St. Francis Dr., Santa Fe, NM87505	Form C-103 Revised July 18, 2013 WELL API NO. 30-015-01940 5. Indicate Type of Lease STATE A FEE 6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: Oil Well X Gas Well Other 2. Name of Operator State of New Mexico formerly Canyon E&P Company 3. Address of Operator	 7. Lease Name or Unit Agreement Name Artesia Metex Unit 8. Well Number 11 9. OGRID Number 269864 10. Pool name or Wildcat
1625 N. French Drive Hobbs, NM 88249 Artesia QU-GB-SA 4. Well Location Unit Letter L : 1650 feet from the South line and 990 feet from the West line Section 19 Township 18S Range 28E NMPM County Eddy III. Elevation (Show whether DR, RKB, RT, GR, etc.) III. Elevation (Show whether DR, RKB, RT, GR, etc.) III. Elevation (Show whether DR, RKB, RT, GR, etc.) III. Elevation (Show whether DR, RKB, RT, GR, etc.)	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPL CLOSED-LOOP SYSTEM OTHER: OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion.	
SEE ATTACHMENTS	HOBBS OCD JUL 1 0 2018 RECEIVED
Spud Date: Rig Release Date:	
I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE SIGNATURE Mark Whitaker E-mail address: PHONE: 575-393-6161 For State Use Only PHONE: 575-393-6161 APPROVED BY: Mark Whitaker Conditions of Approval (if any): TITLE	


Canyon E&P Company Artesia Metex Unit No. 11 30-015-01940 1650' FSL & 990' FWL UL – L, Sec. 19, T18S, R28E

8 5/8" 24# csg at 431' w/ 100 sx cmt. 5 ½" 15# CSG at 2210' w/ 200 sx cmt. TOC 890' Perfs 1942' – 2020' TD 2215' PBTD 2072'

- 1. MIRU plugging equipment. POOH w/ production equipment.
- 2. Run gauge ring. Set CIBP at 1875'. Circulate hole w/ mud laden fluid and pressure test casing to 500 psi.
- 3. Spot 50 sx cement.
- 4. Perforate at 481'. Pump sufficient cement to circulate to surface inside/outside of 5 ½" casing.
- 5. Cut off wellhead 3 feet below ground level.
- 6. Verify cement to surface on all strings.
- 7. Install upright P&A marker and cut off anchors.

NOTES: Mud laden fluid consists of 9.5 ppg with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to proceeding with P&A.

Canyon E P Company Artesia Metex Unit No. 11

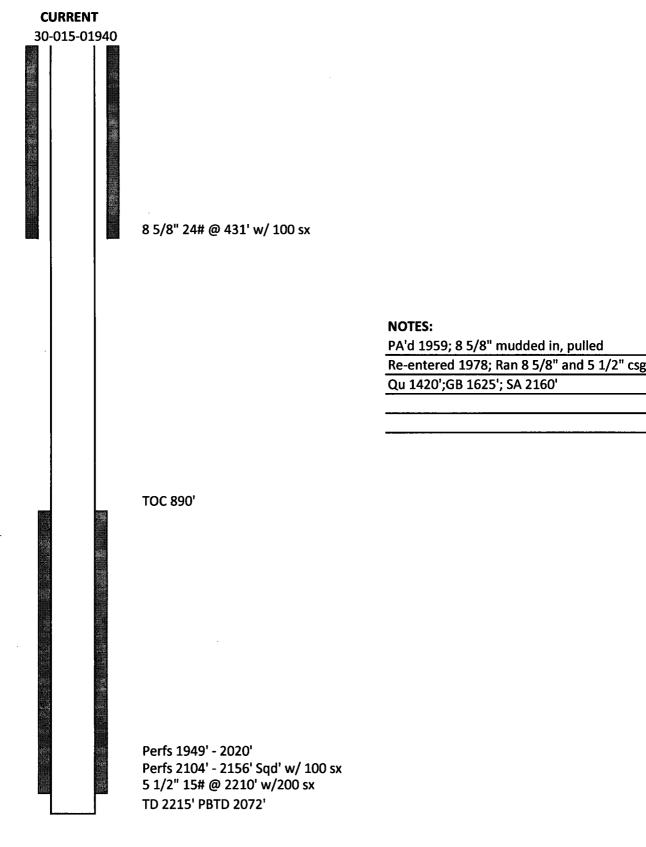

Canyon E P Company Artesia Metex Unit No. 11

INSTALL P&A MARKER CUT OFF WELLHEAD 3' BELOW GL

CIRCULATE CEMENT TO SURFACE PERFORATE AT 481'.


8 5/8" 24# @ 431' w/ 100 sx

TOC 890'


SPOT 50 SX CMT. * **CIRC MLF. PRESSURE TEST CSG.** SET CIBP AT 1875'.

Perfs 1949' - 2020' 5 1/2" 15# @ 2210' w/ 100 sx TD 2215' PBTD 2072'

* NO TAG NECESSARY IF CSG TESTS GOOD

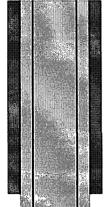



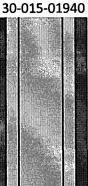

PROPOSED