ceinedaty Opp Po Applopriate bistrict 3 I	State of New M	Mexico		Form C-1831 0
Office <u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources		Revised July 18, 2013 WELL API NO.	
<u>District II</u> – (575) 748-1283	OIL CONSERVATION DIVISION			
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178	1220 South St. Fr		5. Indicate Type of Lease	
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM		STATE FEE 6. State Oil & Gas Lease No.	
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505		07505	o. State Off & Gas Lease No).
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH			7. Lease Name or Unit Agreement Name	
PROPOSALS.) 1. Type of Well: Oil Well	Gas Well Other		8. Well Number	
2. Name of Operator	Gas well Guiel		9. OGRID Number	
3. Address of Operator			10. Pool name or Wildcat	
4. Well Location Unit Letter :	feet from the	line and	feet from the	line
Section Section		Range	NMPM County	
Section	11. Elevation (Show whether D		<u> </u>	
	,	, , , ,	,	
	leted operations. (Clearly state al rk). SEE RULE 19.15.7.14 NM/ompletion.			
pud Date: hereby certify that the information a	-	best of my knowled		
Type or print name	E-mail addre	ess:	PHONE:	
APPROVED BY:	TITLE		DATE	
Conditions of Approval (if any):				

Apache

Liner Isolation Procedure


Date: September 2, 2021

Subject: NEDU 708W Liner Isolation


Procedure

- 1. RU WSU, ND WH and NU BOP.
- 2. POOH with existing injection string and LD TBG and PKR.
- 3. RU air-foam unit and MU bit and RIH to cleanout to PBTD (6,634'), POOH.
- 4. MU bit and scraper and clean casing out to PBTD, stand back workstring and prep for casing run.
- 5. RU casing crew and RIH with 4.5" flush joint liner and land casing at 6,634'.
- 6. RU cementers and pump primary liner cement job. RD cementers and WOC.
- 7. RIH w/bit and drill out cement to casing shoe, POOH WS.
- 8. RU WL and perforate 4.5" liner from 6,420'-6,634'.
- RIH w/WS and treatment packer and acidize perforations w/10,000 gals HCL and ball sealers.
 POOH LD WS.
- 10. RIH w/new 1505 IPC 2-3/8" J-55 TBG and injection packer and set at 6,375'.
- 11. RDMO WSU and turn well to injection.

Current WBD

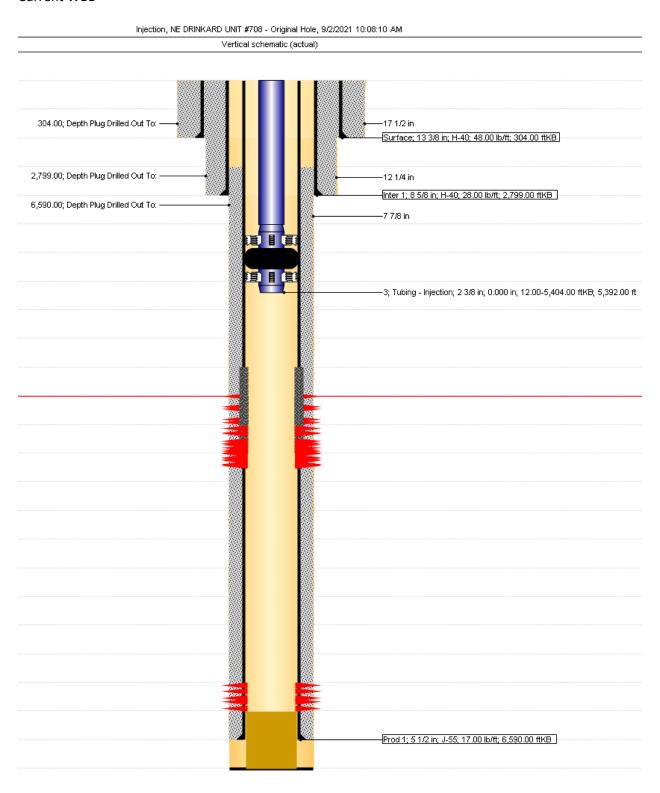

Proposed

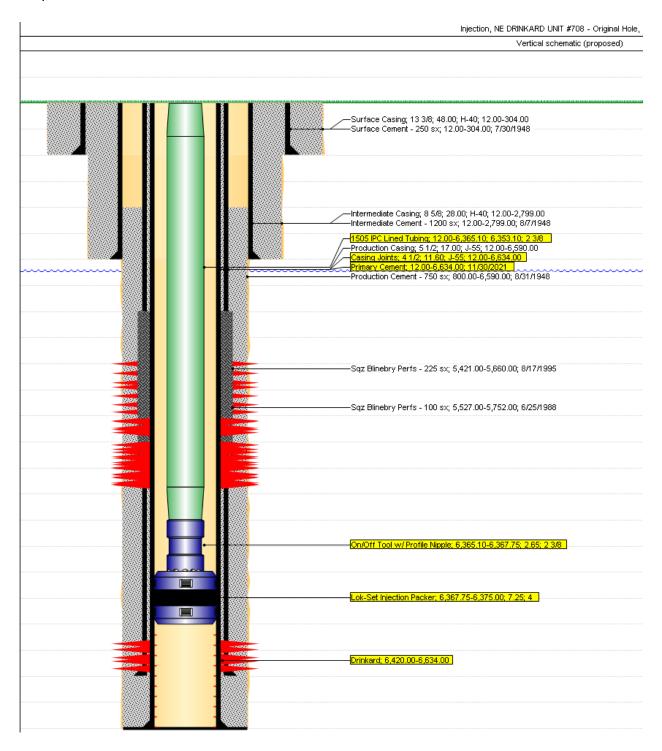

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 47430

CONDITIONS

Operator:	OGRID:
APACHE CORPORATION	873
303 Veterans Airpark Ln	Action Number:
Midland, TX 79705	47430
	Action Type:
	[C-103] NOI Workover (C-103G)

CONDITIONS

Created By	Condition	Condition Date
pkautz	None	9/14/2021