

U.S. Department of the Interior **BUREAU OF LAND MANAGEMENT**

Sundry Print Report

Well Name: NASH UNIT Well Location: T23S / R29E / SEC 12 / County or Parish/State: EDDY /

SWSE /

Well Number: 12 Allottee or Tribe Name: Type of Well: OIL WELL

Lease Number: NMNM17589 Unit or CA Name: NASH DRAW -**Unit or CA Number:**

DELAWARE

US Well Number: 3001527602 Well Status: Temporarily Abandoned **Operator:** XTO ENERGY

INCORPORATED

NMNM70992C

Accepted for record - NMOCD gc 8/25/2022

Notice of Intent

Sundry ID: 2688184

Type of Action: Plug and Abandonment Type of Submission: Notice of Intent

Date Sundry Submitted: 08/19/2022 Time Sundry Submitted: 06:59

Date proposed operation will begin: 10/03/2022

Procedure Description: XTO Energy Inc Respectfully submits NOI to PA Sundry for the well above. Attached below is the procedure and the current/proposed WBD for the well.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Nash_Unit_012_Proposed_WBD_20220819065908.pdf

Nash_Unit_012_Procedure_20220819065856.pdf

Nash_Unit_012_DHWP_20220819065842.pdf

eceived by OCD: 8/24/2022 10:49:08 AM

Well Location: T23S / R29E / SEC 12 /

SWSE /

County or Parish/State: EDD Page

NM

Zip:

Well Number: 12

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM17589

Unit or CA Name: NASH DRAW -

DELAWARE

Unit or CA Number:

NMNM70992C

US Well Number: 3001527602

Well Status: Temporarily Abandoned

Operator: XTO ENERGY

INCORPORATED

Conditions of Approval

Specialist Review

NASH_UNIT_12___2688184___COA_AND_PROCEDURE_20220824101338.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: CASSIE EVANS Signed on: AUG 19, 2022 06:59 AM

Name: XTO ENERGY INCORPORATED

Title: Regulatory Analyst

Street Address: 6401 Holiday Hill Road, Bldg 5

City: Midland State: TX

Phone: (432) 218-3671

Email address: CASSIE.EVANS@EXXONMOBIL.COM

Field

Representative Name:

Street Address:

City: State:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: KEITH P IMMATTY BLM POC Title: ENGINEER

BLM POC Phone: 5759884722 BLM POC Email Address: KIMMATTY@BLM.GOV

Disposition: Approved **Disposition Date:** 08/24/2022

Received by OCD: 8/24/2022 10:49:08 AM


Page 3 of 16



Downhole Well Profile - with Schematic

Well Name: NASH UNIT 012

SAP Cost Center ID Permit Number State/Province County 3001527602 1136551001 **New Mexico** Eddy Surface Location Ground Elevation (ft) Spud Date Original KB Elevation (ft) KB-Ground Distance (ft) Surface Casing Flange Elevation (ft) T23S-R29E-S12 8/21/1996 00:00 3,002.00 2,986.00 16.00

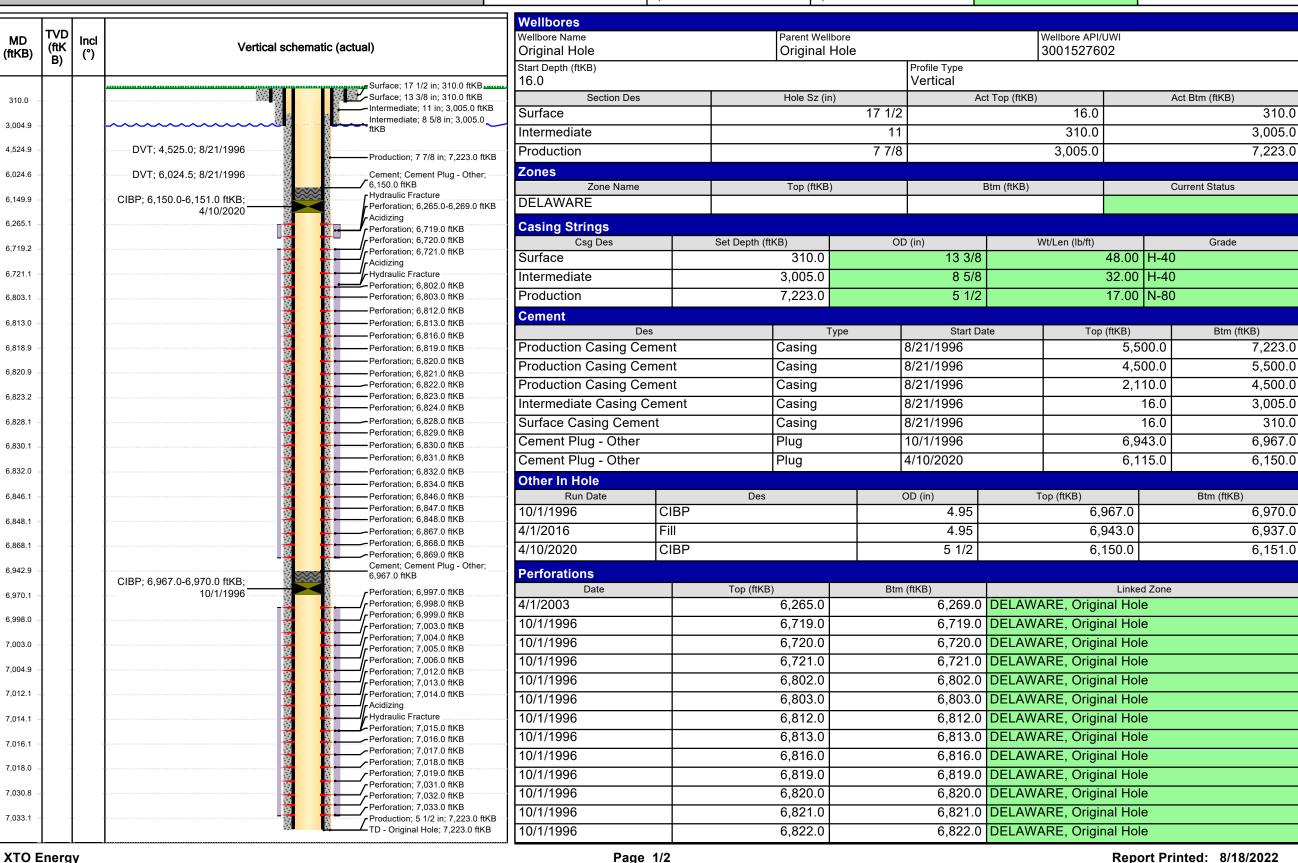

Page 4 of 16



Downhole Well Profile - with Schematic

Well Name: NASH UNIT 012

API/UWI 3001527602	SAP Cost Center ID 1136551001	Permit Number	State/Province New Mexico	County Eddy		
		Spud Date 8/21/1996 00:00	Ground Elevation (ft) 2,986.00	KB-Ground Distance (ft) 16.00	Surface Casing Flange Elevation (ft)	

MD (ftKB)	TVD (ftK B)	Incl (°)	Vertical schematic (actual)									
				Surface; 17 1/2 in; 310.0 ftKB								
310.0				Intermediate; 11 in; 3,005.0 ftKB								
3,004.9 -				Intermediate; 8 5/8 in; 3,005.0 ftKB								
4,524.9 –			DVT; 4,525.0; 8/21/1996	Production; 7 7/8 in; 7,223.0 ftKB								
6,024.6			DVT; 6,024.5; 8/21/1996	Cement; Cement Plug - Other;								
6,149.9 -			CIBP; 6,150.0-6,151.0 ftKB;	6,150.0 ftKB Hydraulic Fracture Perforation; 6,265.0-6,269.0 ftKB								
6,265.1 –			4/10/2020	Acidizing Perforation; 6,719.0 ftKB								
6,719.2 –				Perforation; 6,720.0 ftKB								
6,721.1 -			<u> </u>	Acidizing Hydraulic Fracture								
6,803.1				Perforation; 6,802.0 ftKB								
			in the second se	Perforation; 6,812.0 ftKB								
6,813.0 -				Perforation; 6,813.0 ftKB Perforation; 6,816.0 ftKB								
6,818.9 -			<u> </u>	Perforation; 6,819.0 ftKB Perforation; 6,820.0 ftKB								
6,820.9 –				Perforation; 6,821.0 ftKB								
6,823.2 -				Perforation; 6,823.0 ftKB								
6,828.1 –				Perforation; 6,828.0 ftKB								
6,830.1 –			<u> </u>	Perforation; 6,830.0 ftKB								
6,832.0				Perforation; 6,831.0 ftKB								
6,846.1				Perforation; 6,834.0 ftKB Perforation; 6,846.0 ftKB								
6,848.1 -			100 mg	Perforation; 6,847.0 ftKB Perforation; 6,848.0 ftKB								
6,868.1 –			<u>8</u>	Perforation; 6,867.0 ftKB Perforation; 6,868.0 ftKB								
6,942.9			<u></u>	Perforation; 6,869.0 ftKB Cement; Cement Plug - Other;								
			CIBP; 6,967.0-6,970.0 ftKB;	6,967.0 ftKB Perforation; 6,997.0 ftKB								
6,970.1 -			10/1/1996	Perforation; 6,998.0 ftKB Perforation; 6,999.0 ftKB								
6,998.0 –				Perforation; 7,003.0 ftKB								
7,003.0 –			186 186 186	Perforation; 7,005.0 ftKB								
7,004.9 -			135 135 135	Perforation; 7,006.0 ftKB Perforation; 7,012.0 ftKB Perforation; 7,013.0 ftKB								
7,012.1 –				Perforation; 7,014.0 ftKB								
7,014.1 -			100 100 100 100	Hydraulic Fracture Perforation; 7,015.0 ftKB								
7,016.1 -				Perforation; 7,015.0 ftKB Perforation; 7,016.0 ftKB Perforation; 7,017.0 ftKB								
7,018.0 –				Perforation; 7,017.0 ftKB Perforation; 7,019.0 ftKB Perforation; 7,019.0 ftKB								
7,030.8 -			<u> </u>	Perforation; 7,031.0 ftKB								
7,033.1 -			05 05 05	Perforation, 7,032.0 ftKB Perforation, 7,033.0 ftKB Production, 5 1/2 in; 7,223.0 ftKB								
			81	TD - Original Hole; 7,223.0 ftKB								

Perforations					
Date	Top (ftKB)	Btm (ftKB)		Linked Zone	е
10/1/1996	6,823.0			, Original Hole	
10/1/1996	6,824.0			, Original Hole	
10/1/1996	6,828.0			, Original Hole	
10/1/1996	6,829.0			, Original Hole	
10/1/1996	6,830.0			, Original Hole	
10/1/1996	6,831.0			, Original Hole	
10/1/1996	6,832.0			, Original Hole	
10/1/1996	6,834.0	,		, Original Hole	
10/1/1996	6,846.0			, Original Hole	
10/1/1996	6,847.0			, Original Hole	
10/1/1996	6,848.0			, Original Hole	
10/1/1996	6,867.0			, Original Hole	
10/1/1996	6,868.0			, Original Hole	
10/1/1996	6,869.0			, Original Hole	
10/1/1996	6,997.0			, Original Hole	
10/1/1996	6,998.0			, Original Hole	
10/1/1996	6,999.0			, Original Hole	
10/1/1996	7,003.0			, Original Hole	
10/1/1996	7,004.0			, Original Hole	
10/1/1996	7,005.0			, Original Hole	
10/1/1996	7,006.0			, Original Hole	
10/1/1996	7,012.0			, Original Hole	
10/1/1996	7,013.0			, Original Hole	
10/1/1996	7,014.0	7,014.0	DELAWARE	, Original Hole	
10/1/1996	7,015.0			, Original Hole	
10/1/1996	7,016.0	7,016.0	DELAWARE	, Original Hole	
10/1/1996	7,017.0	7,017.0	DELAWARE	, Original Hole	
10/1/1996	7,018.0	7,018.0	DELAWARE	, Original Hole	
10/1/1996	7,019.0	7,019.0	DELAWARE	, Original Hole	
10/1/1996	7,031.0	7,031.0	DELAWARE	, Original Hole	
10/1/1996	7,032.0	7,032.0	DELAWARE	, Original Hole	
10/1/1996	7,033.0	7,033.0	DELAWARE	, Original Hole	
Stimulation Intervals					
Interval Number	Top (ftKB) Bi	tm (ftKB) AIR (bbl/r	min)	MIR (bbl/min)	Proppant Total (lb)

Stimulation Intervals					
Interval Number	Top (ftKB)	Btm (ftKB)	AIR (bbl/min)	MIR (bbl/min)	Proppant Total (lb)
1	6,997.0	7,033.0	25		160,000.0
2	6,719.0	6,869.0	25		210,000.0
98	6,719.0	6,869.0	3		0.0
99	6,997.0	7,033.0	4		0.0
1	6,265.0	6,269.0	5		2,400.0
99	6,265.0	6,269.0	3		0.0

Page 2/2 Report Printed: 8/18/2022

Nash Unit 012 - Proposed WBD

13-3/8" shoe 310'

8-5/8" shoe 3,005'

T/Salt 350'

B/ Salt 1785'


5-1/2" TOC 2110'

T/Delaware 3135'

DV Tool 4525'

DV Tool 6024'

Top Production Perf 6265'

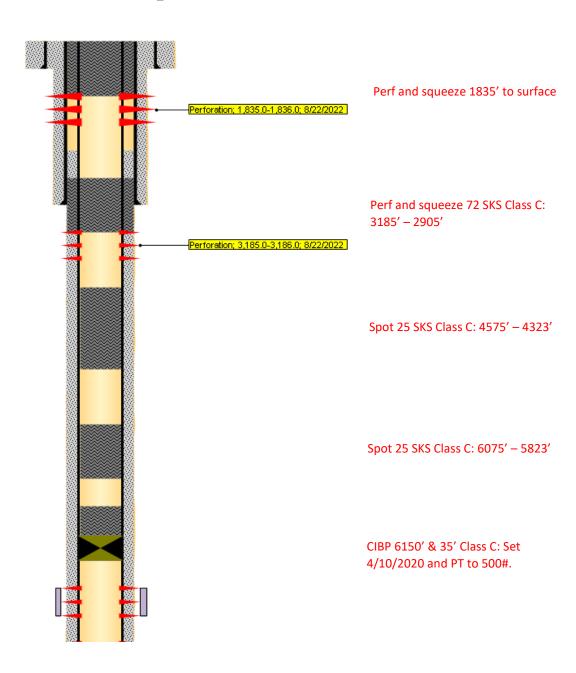

PLUG AND ABANDON WELLBORE NASH UNIT 012 EDDY COUNTY, NEW MEXICO Class I

MASIP	MAOP	MAWP	Surface Csg Yield
1,000 psi	1,000 psi	3,000 psi	1,730 psi

SUMMARY: Plug and abandon wellbore according to BLM regulations.


- 1) MIRU plugging company. Set open top steel pit for plugging.
- 2) ND WH and NU 3K manual BOP. Function test BOP.
- 3) RIH 4-3/4" bit on 2-7/8" tbg and tag TOC at approx. 6115'.
- 4) Spot 25 SXS Class C cement from 6075' to 5823' (DV Tool).
- 5) Spot 25 SXS Class C cement from 4575' to 4323' (DV Tool). POOH 2-7/8" tbg.
- 6) MIRU WLU. Perforate at 3185'.
- 7) RIH 2-7/8" tbg. Squeeze 72 SXS Class C cement from 3185' to 2905' (T/Del, 8-5/8" CSG shoe). Notify BLM. Tag and pressure test to 500 psig.
- 8) MIRU WLU. Perforate at 1835'.
- 9) Squeeze Class C cement until returns at surface. Est. 430 SKS. (13-3/8" CSG shoe, B/Salt, T/Salt).
- 10) ND BOP and cut off wellhead 5' below surface. RDMO PU, transport trucks, and pump truck.
- 11) Set P&A marker.
- 12) Pull fluid from steel tank and haul to disposal. Release steel tank.

KEITH

Digitally signed by KEITH IMMATTY

Date: 2022.08.24
10:12:38 -06'00'

Nash Unit 012 - Proposed WBD

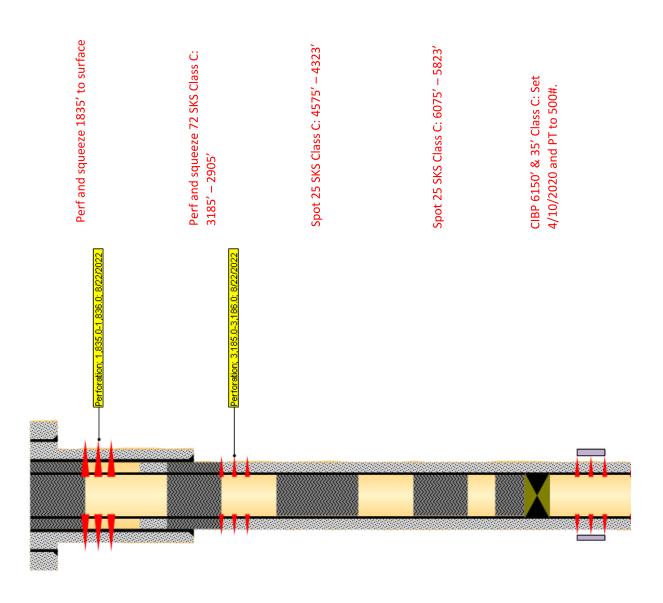

Top Production Perf 6265'

T/Delaware 3135'

DV Tool 4525'

DV Tool 6024'

5-1/2" TOC 2110'

B/ Salt 1785'

T/Salt 350'

8-5/8" shoe 3,005'

13-3/8" shoe 310'

Sundry ID 2688184

Suriary iD	2000 104					-
Plug Type	Тор	Bottom	Length	Tag	Sacks	Notes
Surface Plug	0.00	1835.00	1835.00	Verify	430.00	Perf and sqz. R111P plug BOS to surface
Shoe Plug	0.00	1835.00	1835.00	Verify	430.00	Perf and sqz. R111P plug BOS to surface
Top of Salt @ 350	0.00	1835.00	1835.00	Verify	430.00	Perf and sqz. R111P plug BOS to surface
Base of Salt @ 1785	0.00	1835.00	1835.00	Verify	430.00	Perf and sqz. R111P plug BOS to surface
Shoe Plug	2924.95	3055.00	130.05	Tag/Verify	25.00	Covered by delaware
Delaware @ 3135	3053.65	3185.00	131.35	If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio ns	25.00	
DV tool plug	4429.75			Tag/Verify	25.00	
DV tool plug	5913.76			Tag/Verify		

				If solid		
				base no		
				need to		
				Tag		
				(CIBP		
				present		
				and/or		
				Mechanic		
				al Integrity		
				Test), If		
				Perf &		
				Sqz then		
				Tag, Leak		
				Test all		
				CIBP if no		
				Open		
				Perforatio		Set and pressure
CIBP Plug	6115.00	6150.00	35.00	ns	25.00	tested already

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Critical, High Cave Karst: Cave Karst depth to surface

R111P: Solid plug in all annuli - 50' from bottom of salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	R111-P	50 Feet from Base of Salt to Surface	500.00
Shoe @	310.00		
Shoe @	3005.00		
Shoe @	7223.00		

DV Tool @ 4525.00 CIBP @ 6150.00 DV Tool @ 6024.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 137448

CONDITIONS

Operator:	OGRID:	
XTO ENERGY, INC	5380	
6401 Holiday Hill Road	Action Number:	
Midland, TX 79707	137448	
	Action Type:	
	[C-103] NOI Plug & Abandon (C-103F)	

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	8/25/2022