| Received by OCD: 8/23/2022 1:05:52 PM Submit 1 Copy To Appropriate District State of New Mexico | Page 1 of 6 Form C-103 |
|--|--|
| Office District I Energy, Minerals and Natural Resources | October 13, 2009 WELL API NO. |
| 1625 N. French Dr., Hobbs, NM 88240 District II | 30-025-23921 |
| District II 1301 W. Grand Ave., Artesia, NM 88210 District III 1220 South St. Francis Dr. | 5. Indicate Type of Lease |
| 1000 Rio Brazos Rd., Aztec, NM 87410 Santa Fa, NM 87505 | STATE FEE 6. State Oil & Gas Lease No. |
| District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505 | o. State Off & Gas Lease No. |
| SUNDRY NOTICES AND REPORTS ON WELLS | 7. Lease Name or Unit Agreement Name |
| (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH | Ralph Estate |
| PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other | 8. Well Number 3 |
| 2. Name of Operator Mewbourne Oil Company | 9. OGRID Number 14744 |
| 3. Address of Operator | 10. Pool name or Wildcat |
| PO Box 5270, Hobbs, NM 88241 | D-K Abo |
| 4. Well Location | |
| Unit Letter_H:2310 _feet from the _North line and _990' | |
| Section 30 Township 20S Range 39E 11. Elevation (Show whether DR, RKB, RT, GR, etc.) | NMPM Lea County |
| 3547' GL | |
| | |
| 12. Check Appropriate Box to Indicate Nature of Notice, | Report or Other Data |
| NOTICE OF INTENTION TO: | SEQUENT REPORT OF: |
| PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK | ☐ ALTERING CASING ☐ |
| TEMPORARILY ABANDON | |
| PULL OR ALTER CASING | JOR [] |
| DOWNTIOLE GOIVINITAGE | |
| OTHER: OTHER: | the second data in the discount and data |
| 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Con | give pertinent dates, including estimated date inletions: Attach wellbore diagram of |
| proposed completion or recompletion. | F |
| | |
| 8/23/22 Please see attached P&A procedure. Before & after wellbore schematics attached. | |
| <u></u> | SEE ATTACHED CONDITIONS |
| | OF APPROVAL |
| LPC Area Below ground marker send pics before backfilling hole | |
| | |
| | |
| I hereby certify that the information above is true and complete to the best of my knowledge | and belief. |
| ~ · · · · · · · · · · · · · · · · · · · | |
| SIGNATURE TITLE Hobbs Regulatory TITLE | |
| The state of the s | DATE08/23/2022 |
| | DATE08/23/2022 .com PHONE: 575-393-5905 |
| Type or print name _Jackie Lathan E-mail address: jlathan@mewbourne For State Use Only | |
| Type or print name _Jackie Lathan E-mail address: jlathan@mewbourne | |

INTERNITORIANE OXII CORRESPONDAN

PLUG & ABANDON PROCEDURE

Submitted By: Blake Shelton

Received by OCD: 8/23/2022 1:05:52 PM

Wellname: Ralph Estate #3

Location: 2310' FNL & 990' FEL

Sec 30, T20S, R39E


Lea Co., NM

API#: 30-025-23921

Procedure:


- 1. MIRU P&A well service company.
- 2. NU BOP.
- 3. PU 4 1/2" CIBP & 2 7/8" tbg. RIH w/tbg & set CIBP @ 6962' (Top perf @ 7012').
- 4. Test csg to 500# for 30 min.
- 5. Circ hole with 9#/gal plug mud (MLF).
- 6. Spot 25 sks Class H neat cmt (±250') on top of CIBP.
- 7. LD tbg to 6800' (Top of Tubbs @ 6635', Top of Cement @ 6600'). Spot 25 sks Class C cmt (±375'). WOC & tag @ or above 6450'.
- 8. LD tbg to 4530' (Top of San Andres @ 4347'). Spot 25 sks Class C cmt (±375'). WOC & tag plug @ 4170' or above.
- 9. LD tbg to 3630' (Top of Queen @ 3470'). Spot 25 sks Class C cmt (±375'). WOC & tag plug @ 3270' or above.
- 10.LD tbg to 3095' (Top of Yates @ 2915'). Spot 25 sks Class C cmt (±375'). WOC & tag plug @ 2735' or above.
- 11. POOH w/tbg & RU wireline.
- 12. RIH w/wireline @ perforate 4 ½" csg @ 1725' (8 5/8" csg shoe @ 1675' & Top of Salt @ 1697').
- 13. RIH w/tbg & attempt to squeeze formation to 500#.
- 14. Spot 25 sks class C cmt @ 1840'. WOC & tag plug @ 1410' or above.
- 15.LD tbg to 200'. Circ Class C cmt to surface (approx. 20 sks).
- 16. Cut off WH & verify cmt to surface.
- 17. Install dry hole marker.
- 18. Clear location.
- 19. RDMO P&A equipment.

Ralph Estate #3
API #: 30-025-23921
2310' FNL & 990' FEL, Sec 30, T20S, R39E, Lea Co., NM

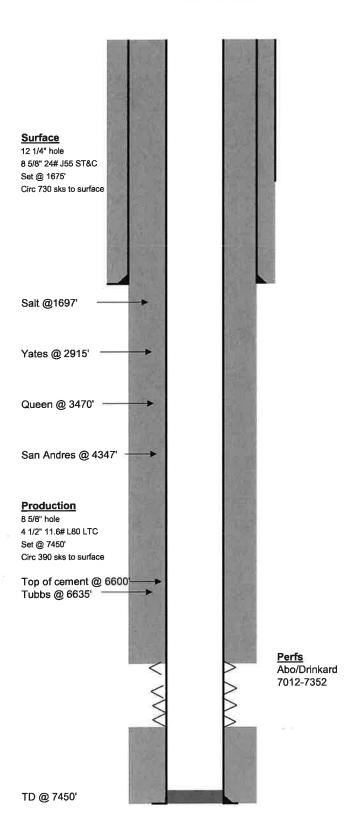

Ralph Estate #3
API #: 30-025-23921

2310' FNL & 990' FEL, Sec 30, T20S, R39E, Lea Co., NM

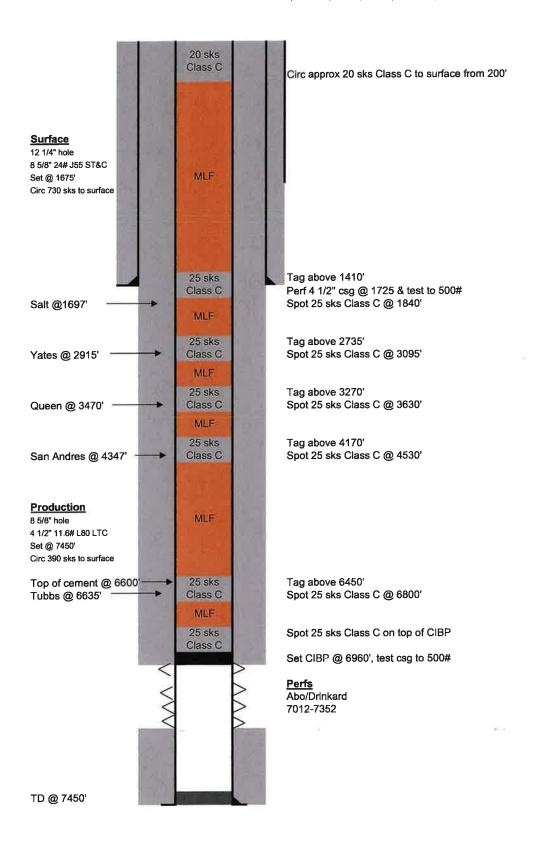

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 136992

COMMENTS

| Operator: | OGRID: |
|------------------|-------------------------------------|
| MEWBOURNE OIL CO | 14744 |
| P.O. Box 5270 | Action Number: |
| Hobbs, NM 88241 | 136992 |
| | Action Type: |
| | [C-103] NOI Plug & Abandon (C-103F) |

COMMENTS

| Created B | Comment | Comment Date |
|-----------|---------------|-----------------|
| plmartin | DATA ENTRY PM | 9/22/2022 |

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 136992

CONDITIONS

| Operator: | OGRID: |
|------------------|-------------------------------------|
| MEWBOURNE OIL CO | 14744 |
| P.O. Box 5270 | Action Number: |
| Hobbs, NM 88241 | 136992 |
| | Action Type: |
| | [C-103] NOI Plug & Abandon (C-103F) |

CONDITIONS

| Created By | | Condition Date |
|---------------|------------------|-------------------|
| kfortner | See attached COA | 9/22/2022 |