
ceived by Och Apply pride District 51 P	State of New Mexico	Form C-103 ¹ of
Office <u>District I</u> – (575) 393-6161	Energy, Minerals and Natural Resources	Revised July 18, 2013 WELL API NO.
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OIL CONSERVATION DIVISION	30-021-20540
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505	STATE FEE 6. State Oil & Gas Lease No.
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa 1 6, 1441 07303	6. State Off & Gas Lease No.
SUNDRY NOTICE	ES AND REPORTS ON WELLS LS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
	TION FOR PERMIT" (FORM C-101) FOR SUCH	WEST BRAVO DOME UNIT SWD
1. Type of Well: Oil Well Ga	as Well Other 🗸	8. Well Number #271
2. Name of Operator OXY USA INC.		9. OGRID Number 16696
3. Address of Operator		10. Pool name or Wildcat
5 GREENWAY PLAZA SUITE	110, HOUSTON, TX	WEST BRAVO DOME CO2 GAS
4. Well Location Unit Letter F: 169	50 feet from the NORTH line and	1650 feet from the WEST line
Section 27	Township 18N Range 30E	NMPM County HARDING
	11. Elevation (Show whether DR, RKB, RT, GR,	•
4.	333' GL	
12. Check Ap	propriate Box to Indicate Nature of Noti	ce, Report or Other Data
NOTICE OF INTE		UBSEQUENT REPORT OF:
	PLUG AND ABANDON ☐ REMEDIAL W	
 -	_	DRILLING OPNS. P AND A
PULL OR ALTER CASING	MULTIPLE COMPL CASING/CEM	IENT JOB
DOWNHOLE COMMINGLE		
CLOSED-LOOP SYSTEM OTHER:	☐ OTHER:	П
		, and give pertinent dates, including estimated date
of starting any proposed work) proposed completion or recom). SEE RULE 19.15.7.14 NMAC. For Multiple apletion.	Completions: Attach wellbore diagram of
MIRU PU.		
Check tbg and csg pressure – 1.81" plu	ug left in profile nipple. ND WH/NU BOP.	
Release from AS1 packer (On/Off tool) POOH with 2-7/8" Fiberglass Tubing. V	at ।,७७३ . /isually inspect for any issues. Replace failed joir	nt(s) with same.
RIH w/ 2-7/8" Fiberglass Tubing with fa		
Latch on to packer. Pressure test tubing to 2000 psi.		
Pull 1.81" plug from profile nipple.		
	psi for 30 minutes (get a chart for MIT).	
. ND BOP's, NU Wellhead. . RDMO Workover Rig.		
. Prep for step rate test.		
Spud Date:	Rig Release Date:	
hereby certify that the information abo	ove is true and complete to the best of my knowl	edge and belief.
SIGNATURE Leslie T. C	Reeves TITLE REGULATORY MAI	NAGER DATE 4/11/2023
		
Type or print name LESLIE REEVES For State Use Only	E-mail address: LESLIE_REI	EVES@OXY.COM PHONE: 713-497-2492
APPROVED BY:	TITLE	DATE
Conditions of Approval (if any):		

OXY USA Inc. - Current West Bravo Dome Unit SWD #271 API No. 30-021-20540

2 7/8" J-55 Tubing w/ TK-15XT IPC Arrowset Packer set @ +/- 1563'

Perfs @ 1600' - 1900'

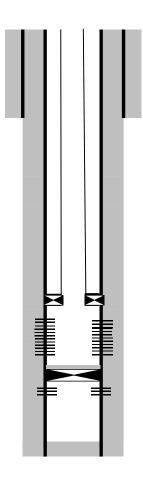

Spud 07/06/2012

12-1/4" hole @ 776' 8-5/8"24# csg @ 776' w/ 415sx-TOC-Surf-Circ.

7-7/8" hole @ 2221' MD 5-1/2" 15.5# csg @ 2221' w/ 332sx - TOC-Surf-Circ.

CIBP Set @ 1970' w/ 20' cement Perfs 2004' - 2115'

PBTD - 2221'

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 206376

CONDITIONS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	206376
	Action Type:
	[C-103] NOI Workover (C-103G)

CONDITIONS

Created By	Condition	Condition Date
jwrinkle	None	4/11/2023