

Submit 1 Copy To Appropriate District Office
District I – (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II – (575) 748-1283
811 S. First St., Artesia, NM 88210
District III – (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV – (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised July 18, 2013

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-21956
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Dwight A Tipton		6. State Oil & Gas Lease No.
3. Address of Operator PO Box 397 Lovington, NM 88260		7. Lease Name or Unit Agreement Name Suzanne State
4. Well Location Unit Letter <u>I</u> : <u>2310</u> feet from the <u>South</u> line and <u>660</u> feet from the <u>East</u> line Section <u>27</u> Township <u>10 South</u> Range <u>32 East</u> NMPM <u>Lea</u> County		8. Well Number. <u>01</u>
		9. OGRID Number 6550
		10. Pool name or Wildcat Mescalero; San Andres
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☒
CASING/CEMENT JOB ☐ PNR

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Plugging Procedure

See Attachment

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE President

DATE 04/01/23

Type or print name Zae Zimmerman

E-mail address: zimmoil@windstream.net

PHONE: (575) 396-7214

For State Use Only

APPROVED BY:

TITLE Compliance Officer A

DATE 4/26/23

Conditions of Approval (

Plugging Report
Dwight A. Tipton
Suzanne State #1
API 30-025-21956

3/27/2023 Move in. Level ground around the wellhead. Set large matting board and rig up. Unseated pump and laid down 164 3/4" rods, 1 sinker bar, and the pump. Dug out around the wellhead to access the surface head. Could not replace connections due to wellhead sitting on rock.

3/28/2023 Used hand-held jack hammer to make room to replace surface connections and plumb to pit. Installed BOP and POOH with tubing. 135 joints of 3 3/8" tubing. Made gauge ring run and set 5 1/2" CIBP at 4010'. RIH with tubing and tagged CIBP. Circulated MLF and tested casing. Good to 500#. Spot 25 sx Class C cement on top of CIBP. POOH and SION.

3/29/2023 Tagged cement at 3767'. POOH and perforated at 2150'. Well kicked and unloaded the casing to the steel pit. Blew down for an hour. Set packer and squeezed perfs with 40 sx cement. ISIP 1250#. No communication with surface. WOC and tagged at 2011'. Perforated casing at 1705'. Squeezed with 35 sx cement. No communication with surface. Left packer set at SION.


3/30/2023 Tagged cement at 1603'. Perforated casing at 435'. Pressured up to 500# and held. Bled off to the truck and repeated to 750#. Held with no drop in pressure. RIH with tubing to 493' and spot 25 sx cement with CaCl across the perforations. WOC and tagged at 296'. Perforated at 150'. Good communication with surface head. Pumped cement down the 5 1/2" casing to the perfs at 150' and up the annulus to surface. Took 45 sx to get good cement to the pit.

3/31/2023 Rig down. TBS brought out excavator with hammer to break out rock around the wellhead. Removed wellhead. Good cement to surface in both strings of casing. Installed standard marker, removed the anchors, cleaned the pit and moved out equipment.



Dwight A Tipton
Ogrid 6550
Suzanne State #1
API 30-025-21956
Lea County, New Mexico

AMENDED

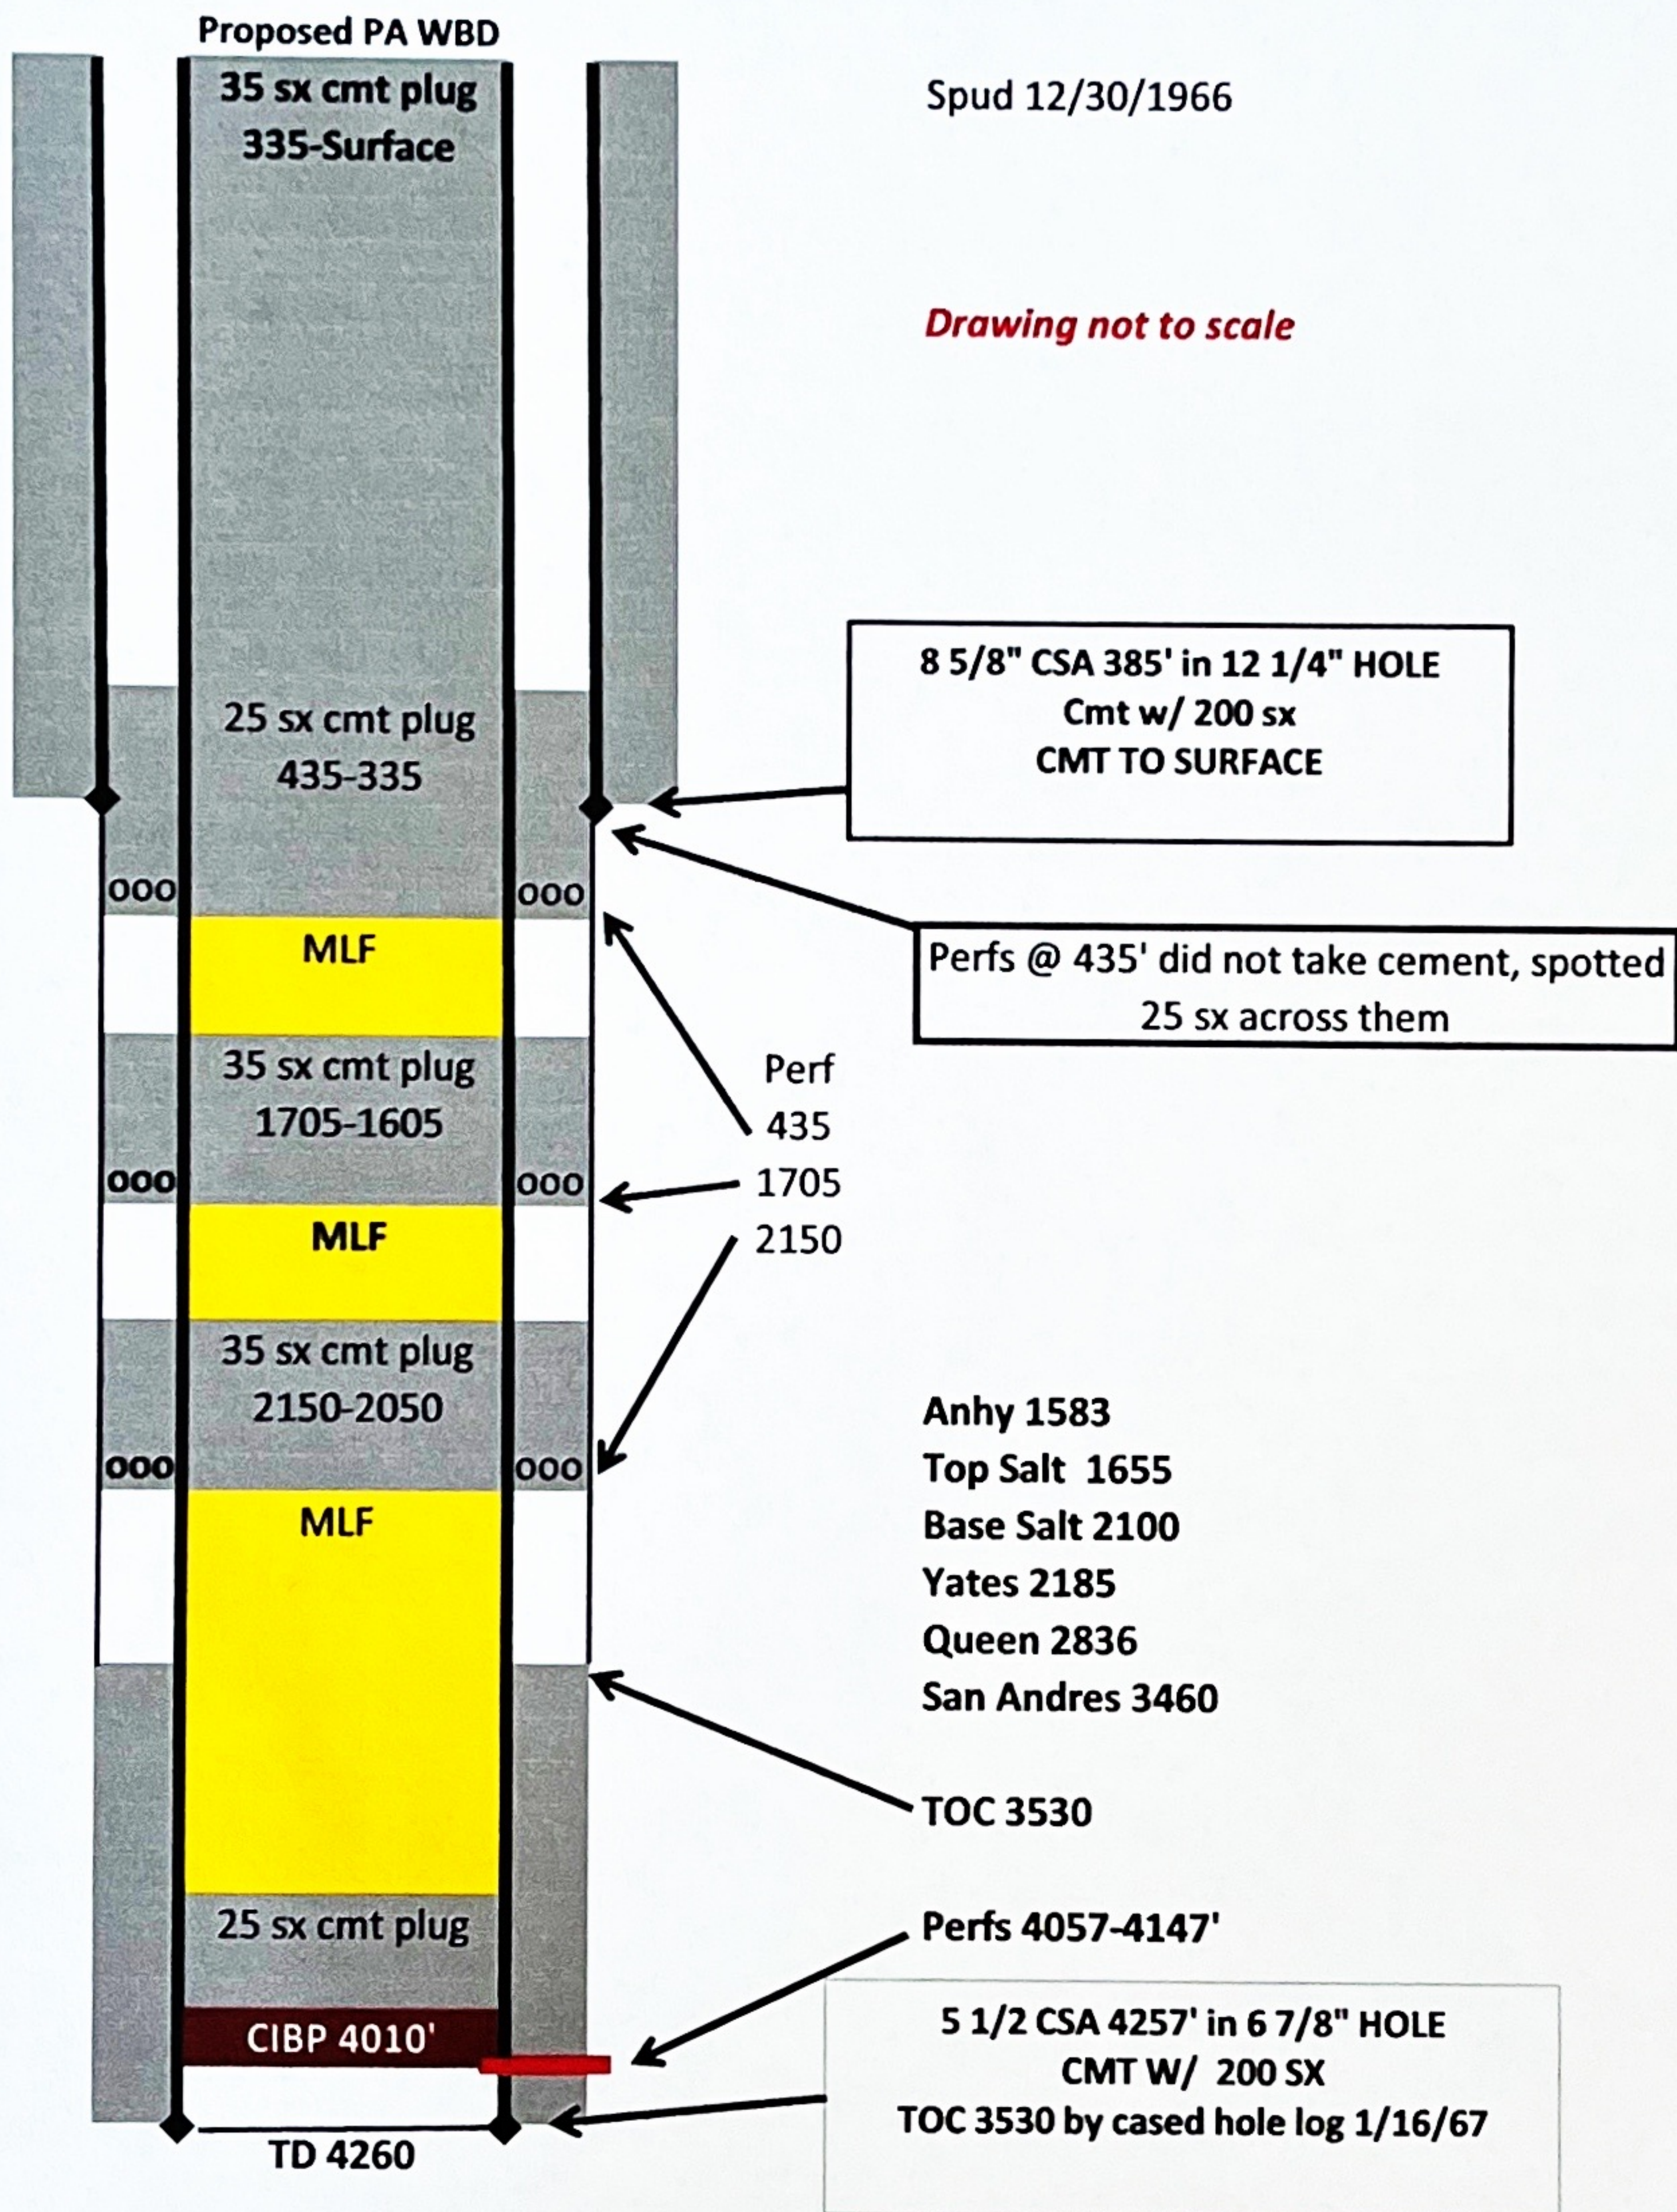

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

COMMENTS

Action 204059

COMMENTS

Operator: DWIGHT A TIPTON 2009 South Main Street Lovington, NM 88260	OGRID: 6550
	Action Number: 204059
	Action Type: [C-103] Sub. Plugging (C-103P)

COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	4/27/2023

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 204059

CONDITIONS

Operator: DWIGHT A TIPTON 2009 South Main Street Lovington, NM 88260	OGRID: 6550
	Action Number: 204059
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
kfortner	Need C103Q and marker photo to release	4/26/2023