

U.S. Department of the Interior  
BUREAU OF LAND MANAGEMENT

<b>Well Name:</b> NAVAJO 13	<b>Well Location:</b> T29N / R14W / SEC 13 / NENE / 36.730217 / -108.256611	<b>County or Parish/State:</b> SAN JUAN / NM
<b>Well Number:</b> 1	<b>Type of Well:</b> OTHER	<b>Allottee or Tribe Name:</b> SHIPROCK
<b>Lease Number:</b> 14206032198	<b>Unit or CA Name:</b> 1 NAVAJO 13 - FRCL	<b>Unit or CA Number:</b> NMNM108235
<b>US Well Number:</b> 3004530652	<b>Well Status:</b> Producing Gas Well	<b>Operator:</b> HILCORP ENERGY COMPANY

**Notice of Intent**

**Sundry ID:** 2736570

**Type of Submission:** Notice of Intent

**Type of Action:** Plug and Abandonment

**Date Sundry Submitted:** 06/19/2023

**Time Sundry Submitted:** 01:40

**Date proposed operation will begin:** 07/01/2023

**Procedure Description:** Hilcorp Energy Company requests permission to P&A the subject well per the attached procedures, current and proposed wellbore schematics. The Pre-Disturbance Site Visit was held on 6/7/2023 with Roger Herrera/BLM, Bertha Spencer/BIA, Belinda Chee/Navajo Nation, Johnnie Begay/Navajo Nation, and Valjean Uentillie/Navajo Nation. The Re-Vegetation Plan is attached. A closed loop system will be used.

**Surface Disturbance**

**Is any additional surface disturbance proposed?:** No

**NOI Attachments**

**Procedure Description**

Navajo\_13\_1\_PA\_reclamation\_20230619133849.pdf

Navajo\_13\_1\_PA\_NOI\_20230619133758.pdf

Well Name: NAVAJO 13

Well Location: T29N / R14W / SEC 13 / NENE / 36.730217 / -108.256611

County or Parish/State: SAN JUAN / NM

Well Number: 1

Type of Well: OTHER

Allottee or Tribe Name: SHIPROCK

Lease Number: 14206032198

Unit or CA Name: 1 NAVAJO 13 - FRCL

Unit or CA Number: NMNM108235

US Well Number: 3004530652

Well Status: Producing Gas Well

Operator: HILCORP ENERGY COMPANY

### Conditions of Approval

#### Additional

PxA\_29N14W13AKpc\_Navajo\_13\_001\_20230622160251.pdf

#### Authorized

2736570\_NOIA\_1\_3004530652\_KR\_06222023\_20230622160848.pdf

General\_Requirement\_PxA\_20230622160842.pdf

### Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: CHERYLENE WESTON

Signed on: JUN 19, 2023 01:38 PM

Name: HILCORP ENERGY COMPANY

Title: Operations/Regulatory Tech - Sr

Street Address: 1111 TRAVIS STREET

City: HOUSTON State: TX

Phone: (713) 289-2615

Email address: cweston@hilcorp.com

### Field

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

### BLM Point of Contact

BLM POC Name: KENNETH G RENNICK

BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647742

BLM POC Email Address: krennick@blm.gov

Disposition: Approved

Disposition Date: 06/22/2023

Signature: Kenneth Rennick



**HILCORP ENERGY COMPANY**  
**NAVAJO 13 1**  
**NOTICE OF INTENT TO PERMANENTLY ABANDON**


API #:	3004530652
--------	------------

JOB PROCEDURES	
<input checked="" type="checkbox"/>	NMOCD <b>Contact OCD and BLM/Navajo 24 hrs prior to MIRU. Comply with all NMOCD, BLM &amp; Navajo, and HEC safety and environmental regulations.</b>
<input checked="" type="checkbox"/>	BLM/Navajo
<ol style="list-style-type: none"> <li>1. MIRU service rig and associated equipment, LOTO pumping unit and remove HH and bridle. Record all casing pressures on well.</li> <li>2. Unseat rod insert pump, POOH w/ pump on rods, lay down.</li> <li>3. Load well, ND tree, NU BOPs and test.</li> <li>4. POOH w/ 2-3/8" production tbg, lay down.</li> <li>5. MU 4-1/2" 10.5# bit/scrapper, clear csg to 750', POOH. RIH w/ 4-1/2" 10.5# CICR on pipe and set @ 732' (FRD Top Perf 782').</li> <li>6. <b>Plug #1a   732' - 908' (PC Top @ 905'   FRD Top Perf 782')</b> Mix and pump 23sx (5.6 bbl) Class III Select cmt below CICR to cover FRD perms &amp; PC Top - volume includes 100% excess. Sting out, reverse circulate tubing clean.</li> <li>7. Pressure test 4-1/2" &amp; CICR to 560psi for 30min.</li> <li>8. <b>Plug #1b   490' - 732' (FRD Top 590')</b> Circulate in &amp; spot a 150' cmt plug [16sx (3.9 bbl) Class III Select] above the CICR to cover the FRD Top. PU, reverse circulate tubing clean.</li> <li>9. <b>Plug #2   Surface - 170' (Surface shoe: 120')</b> Circulate in 25sx (6.1 bbl) Class III Select cmt from 170' to surface to cover shoe.</li> <li>10. LD tubing. ND BOP and cut off wellhead below surface casing flange as per NMOCD. Top off cement at surface as needed. Weld new P&amp;A maker.</li> </ol> <p><b>Note</b> Class III "Select" cement: Neat, 1.37yld, 14.6ppg, 6.64gpsx mix wtr.</p>	



**HILCORP ENERGY COMPANY**  
**NAVAJO 13 1**  
**NOTICE OF INTENT TO PERMANENTLY ABANDON**


NAVAJO 13 1 - CURRENT WELLBORE SCHEMATIC

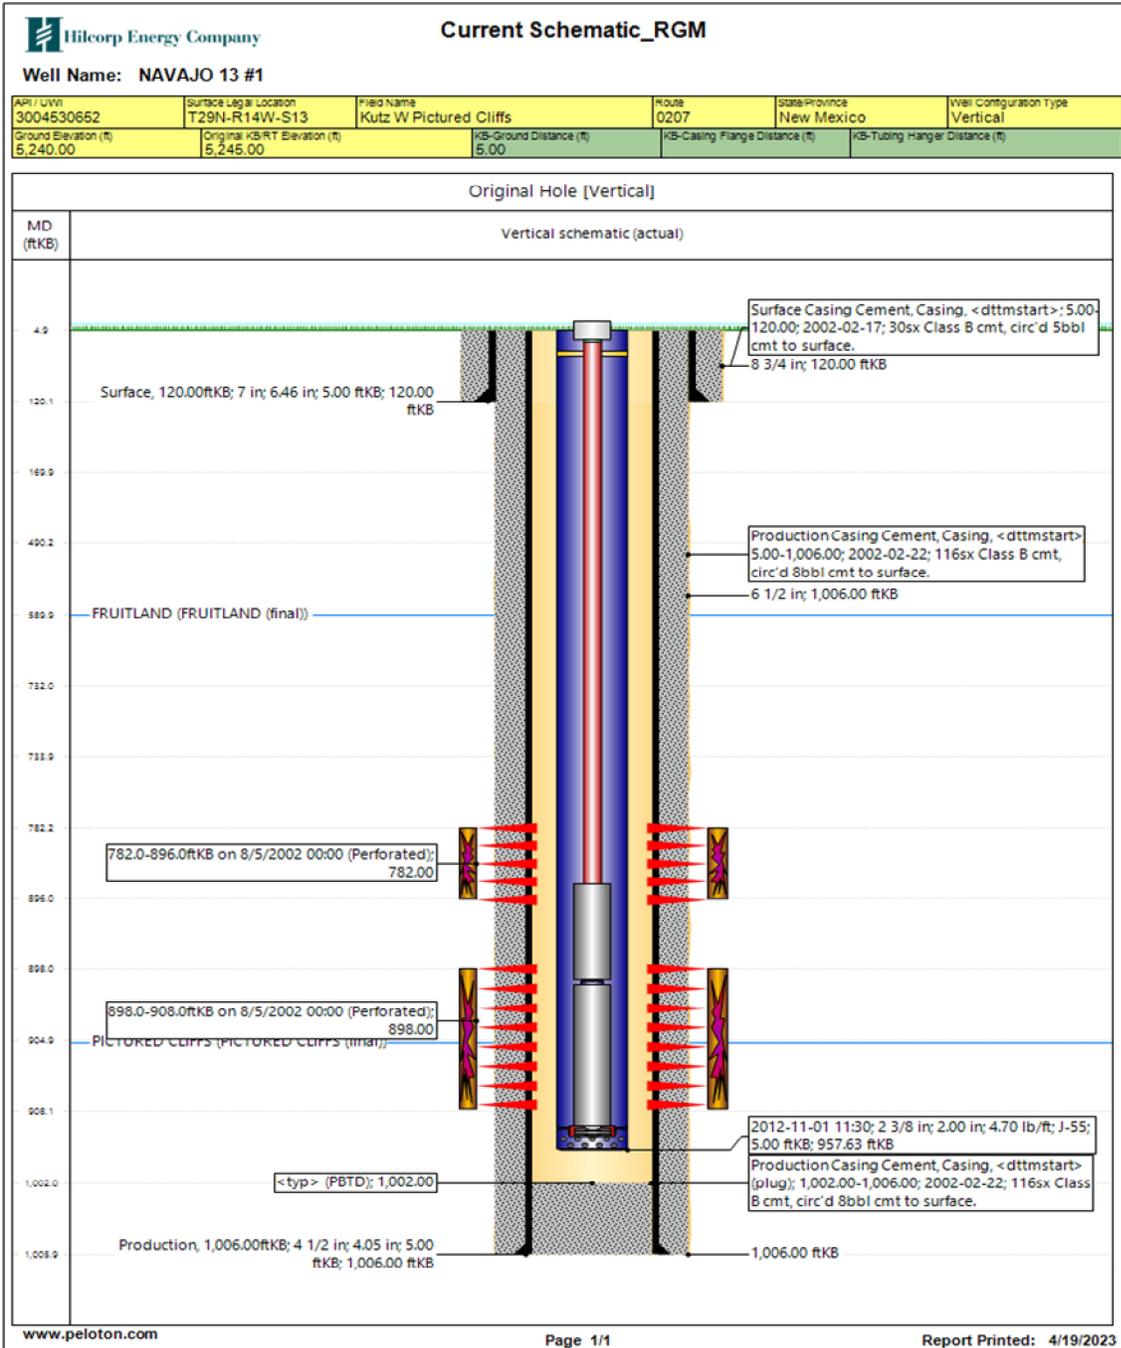



**HILCORP ENERGY COMPANY**  
**NAVAJO 13 1**  
**NOTICE OF INTENT TO PERMANENTLY ABANDON**

**NAVAJO 13 1 - PROPOSED P&A SCHEMATIC**

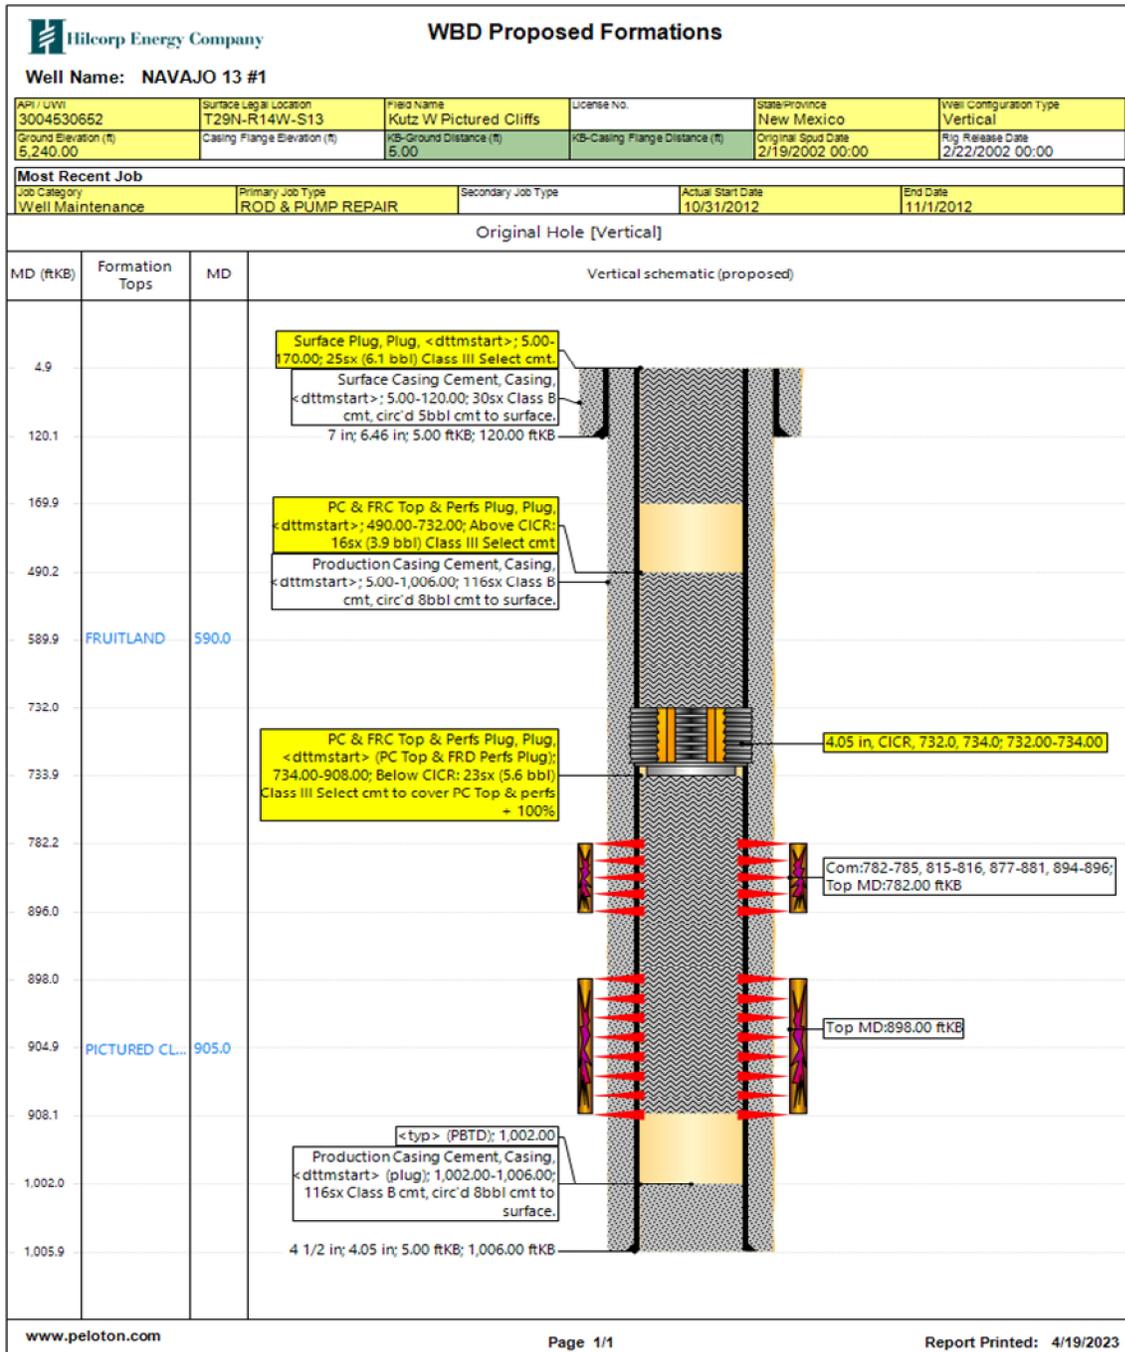

Hilcorp Energy  
P&A Final Reclamation Plan  
**Navajo 13 #1**  
API: 30-045-30652  
Sec.13-T029N-R014W-Unit A  
Lat: 36.730221, Long: -108.255966  
Footage: 1300' FNL & 1230' FEL  
San Juan County, NM

**1. PRE-RECLAMATION SITE INSPECTION**

1.1) A pre-reclamation site inspection was completed by Hilcorp Energy and representatives from multiple government agencies on Tuesday June 6, 2023:

- Roger Herrera with the BLM
- Bertha Spencer with the BIA
- Belinda Chee with the Navajo Nation
- Johnnie Begay with the Navajo Nation
- Valjean Uentillie with the Navajo Nation
- Chad Perkins with Hilcorp Energy

**2. LOCATION RECLAMATION PROCEDURE**

- 2.1) Final reclamation work will be completed after the well is Plugged.
- 2.2) Remove all production equipment, anchors, and flowlines.
- 2.3) The produced water and gas pipelines will be abandoned in place. The pipelines run approximately ~7 tenths of a mile from the well pad to the mainline. The pipelines will be capped ~4' below grade and 50' off the well pad disturbance. The pipelines will also be capped at mainline ~4 below grade. The mainline pipeline will be blind flanged or capped off from the abandoned pipelines.
- 2.4) All nonnative aggregate will be scraped up and buried in toe of the cut prior to re-contouring.
- 2.5) Push fill into cut slope and re-contour with shallow swales and or silt traps for major drainage to create a rolling terrain that matches natural topography drainage features to limit erosion.
- 2.6) Rip compacted soil and walk down disturbed portion of well pad.
- 2.7) All trash and debris will be removed within 50' buffer outside of the location disturbance during reclamation.

**3. ACCESS ROAD RECLAMATION PROCEDURE:**

- 3.1) The well pad sits off a main road that will not be reclaimed, there is no lease access to reclaim.
- 3.2) All trash and debris will be removed within 50' buffer outside of the road disturbance during reclamation.

**4. SEEDING PROCEDURE**

- 4.1) The Badlands seed mix will be used for all reclaimed and disturbed areas of the location and lease road.
- 4.2) Drill seeding will be done where applicable and all other disturbed areas will be broadcast seeded and harrowed, broadcast seeding will be applied at a double the rate of seed.


4.3) Timing of the seeding will take place when the ground is not frozen or saturated.

**5. WEED MANAGEMENT**

5.1) No action is required at this time for weed management, no noxious weeds were identified during the onsite.




Date: 6/15/2023  
Scale: 1:9,028  
0 0.07 0.13 0.2 0.26 mi

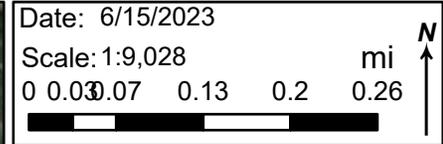

The produced water and gas pipelines will be abandoned in place. The pipelines run approximately ~7 tenths of a mile from the well pad to the mainline. The pipelines will be capped ~4' below grade and 50' off the well pad disturbance. The pipelines will also be capped at mainline ~4 below grade. The mainline pipeline will be blind flanged or capped off from the abandoned pipelines.

- Wells**
- Hilcorp Wells Surface Location**
- Gas Well
- Pipelines**
- Hilcorp Operated Pipeline
- Hilcorp Boundaries**
- Asset Teams
- Supervisor Areas, outline
- Roads and Highways**
- SJB Roads
- Road

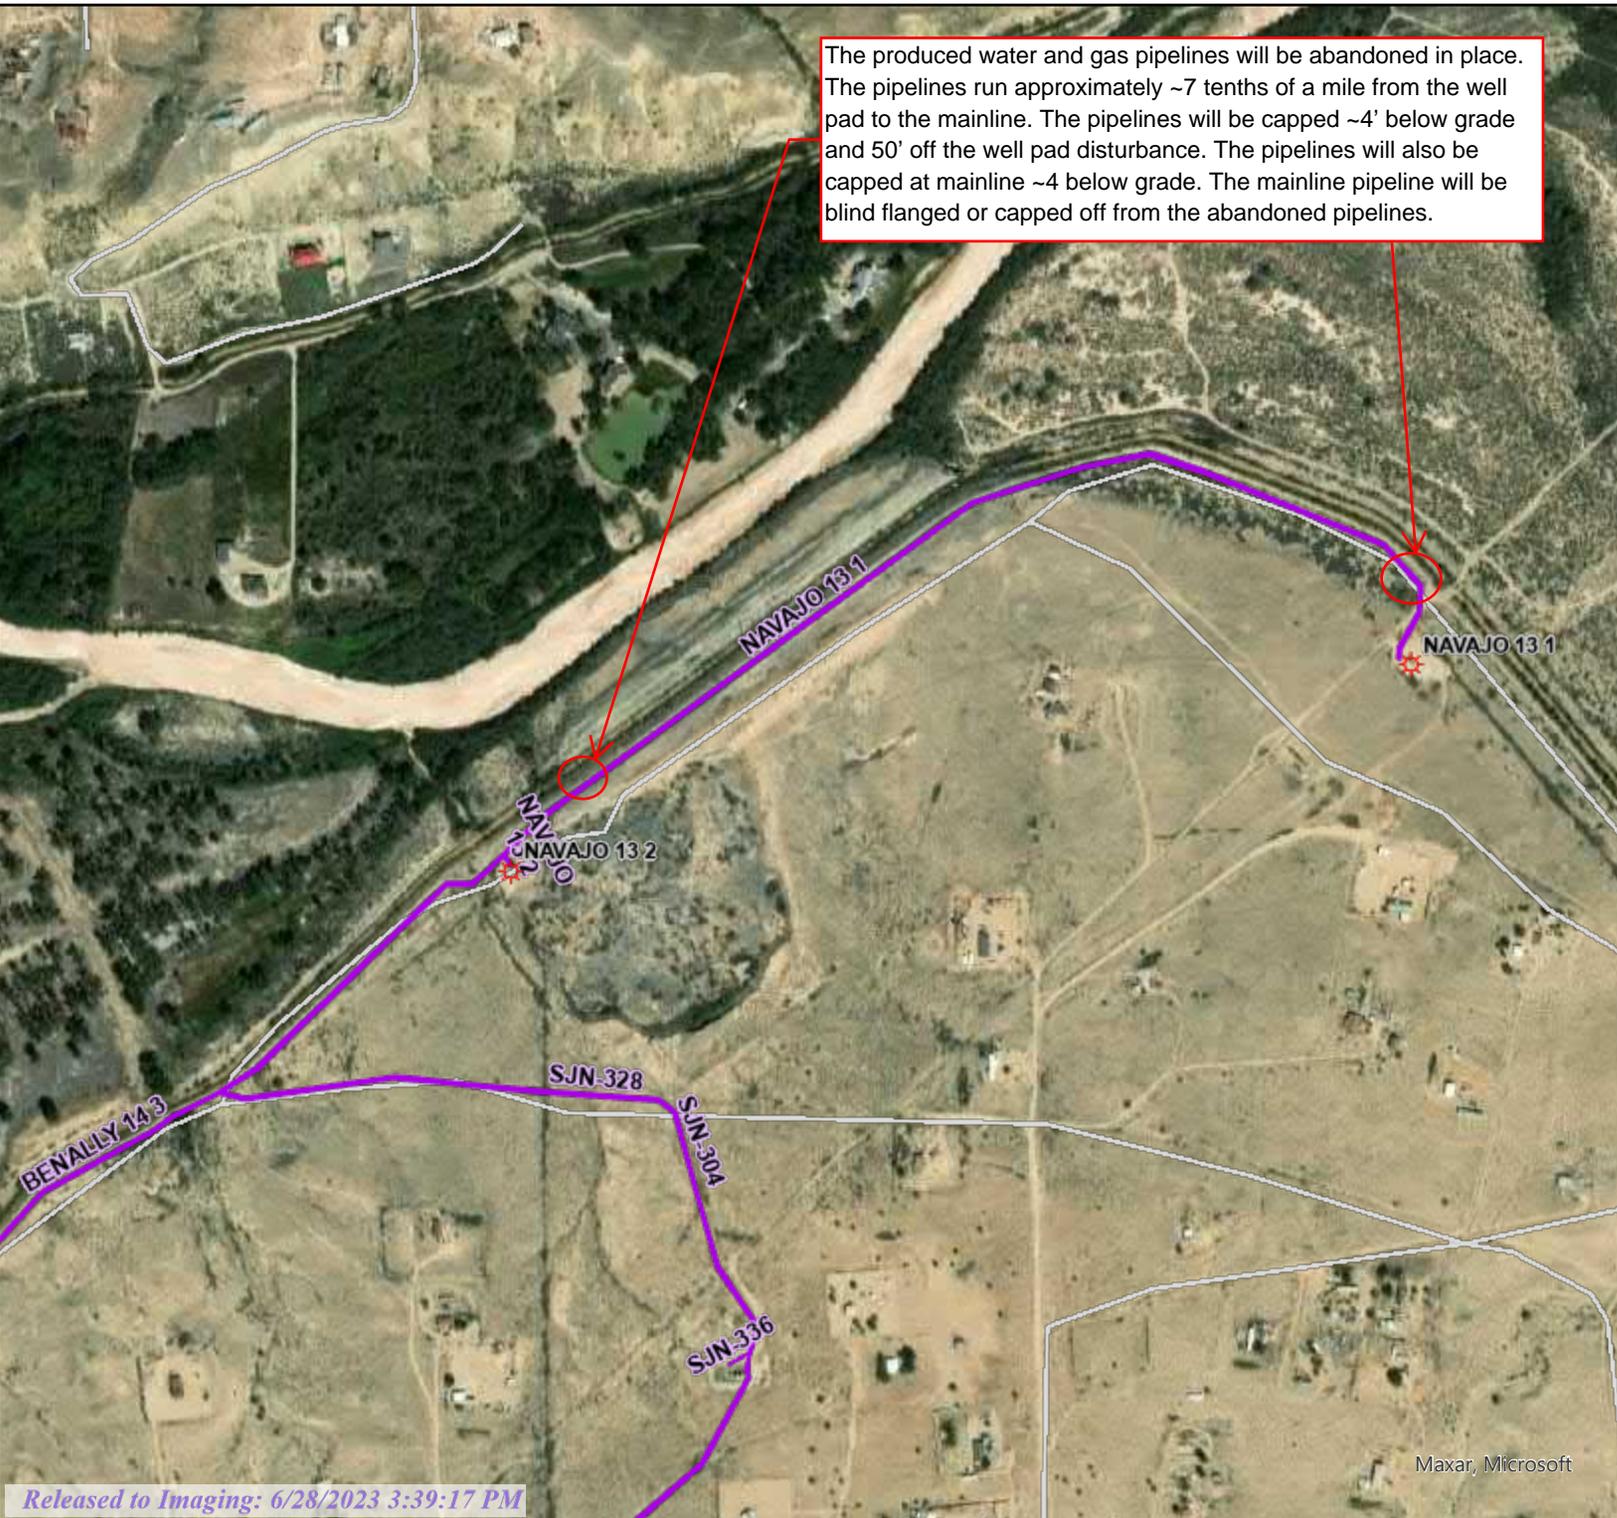

Maxar, Microsoft

# Navajo 13 #1

Reclamation Map

**Legend**

 36.730221, -108.255966

Push fill into cut slope and re-contour with shallow swales and or silt traps for major drainage to create a rolling terrain that matches natural topography drainage features to limit erosion.

All nonnative aggregate will be scraped up and buried in toe of the cut prior to re-contouring.

 36.730221, -108.255966



**UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
FARMINGTON DISTRICT OFFICE  
6251 COLLEGE BLVD.  
FARMINGTON, NEW MEXICO 87402**

AFMSS 2 Sundry ID 2736570

Attachment to notice of Intention to Abandon

Well: Navajo 13 1

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
2. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 06/22/2023

## BLM FFO Fluid Minerals P&A Geologic Report

AFMSS ID: 2736570

Date Completed: 6/22/2023

Well No.	Navajo 13 #001	SHL	1300	FNL	1230	FEL
API No.	3004530652			Sec. 13	T29N	R14W
Lease No.	14206032198	BHL	Same			
Operator	Hilcorp Energy Company					
Elev. (KB)	5245	County	San Juan		State	NM
Total Depth	1010	PBTD	1002			
		Formation	Pictured Cliffs/Fruitland coal			

Formation Top	TVD (ft KB)	Remarks
San Jose Fm.		
Nacimiento Fm.		
Ojo Alamo Ss		
Kirtland Fm.	Surface	Probable gas/water
Fruitland Fm.	590	Coal/gas/water
Pictured Cliffs Ss	897	Gas/water
Lewis Shale		
Chacra (upper)		
Cliff House Ss		
Menefee Fm.		
Point Lookout Fm.		
Mancos Shale		
Gallup		
Greenhorn Ls		
Graneros Shale		
Dakota Ss		
Morrison Fm.		

Remarks:

Reference Well:

- Pictured Cliffs perms 898' - 908'. Fruitland coal perms 782' - 896'.	<b>1) Formation Tops</b> Same
--	----------------------------------

Prepared by: Chris Wenman

**GENERAL REQUIREMENTS FOR  
PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES  
FARMINGTON FIELD OFFICE**

- 1.0 The approved plugging plans may contain variances from the following minimum general requirements.
- 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
- 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
- 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
- 4.1 The cement shall be as specified in the approved plugging plan.
- 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.3 Surface plugs may be no less than 50' in length.
- 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
- 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.**

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. **If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.**

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H<sub>2</sub>S.

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), through the Automated Fluid Minerals Support System (AFMSS) with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

**District I**  
 1625 N. French Dr., Hobbs, NM 88240  
 Phone:(575) 393-6161 Fax:(575) 393-0720

**District II**  
 811 S. First St., Artesia, NM 88210  
 Phone:(575) 748-1283 Fax:(575) 748-9720

**District III**  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 Phone:(505) 334-6178 Fax:(505) 334-6170

**District IV**  
 1220 S. St Francis Dr., Santa Fe, NM 87505  
 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS

Action 232027

**CONDITIONS**

Operator: HILCORP ENERGY COMPANY 1111 Travis Street Houston, TX 77002	OGRID: 372171
	Action Number: 232027
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

**CONDITIONS**

Created By	Condition	Condition Date
john.harrison	Accepted for record - NMOCD JRH 6/28/23.BLM approved P&A 6/22/23	6/28/2023