

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report

Well Name: LUCIA BROOKS Well Location: T18S / R30E / SEC 14 / County or Parish/State: EDDY /

NESW / 32.745596 / -103.9448016

Well Number: 2 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMLC050664 Unit or CA Name: Unit or CA Number:

US Well Number: 3001522773 Well Status: Producing Oil Well Operator: KNOX JACK D

### **Notice of Intent**

**Sundry ID: 2772067** 

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 01/26/2024 Time Sundry Submitted: 09:52

Date proposed operation will begin: 03/01/2024

**Procedure Description:** Requesting permission to plug and abandon. See attached plugging procedure, & current and proposed wellbore schematics.

### **Surface Disturbance**

Is any additional surface disturbance proposed?: No

# **NOI Attachments**

### **Procedure Description**

Proposed\_WBS\_20240126094949.pdf

Current\_WBS\_20240126094933.pdf

LUCIA\_BROOKES\_BTY\_2\_\_2\_PA\_PROCEDURE\_V2\_20240126094911.pdf

eived by OCD: 3/4/2024 7:19:56 AM Well Name: LUCIA BROOKS

Well Location: T18S / R30E / SEC 14 /

NESW / 32.745596 / -103.9448016

County or Parish/State: EDD 200

Well Number: 2

Type of Well: OIL WELL

**Allottee or Tribe Name:** 

Lease Number: NMLC050664

**Unit or CA Name:** 

**Unit or CA Number:** 

**US Well Number: 3001522773** 

Well Status: Producing Oil Well

Operator: KNOX JACK D

# **Conditions of Approval**

### **Specialist Review**

2772067\_\_\_Lucia\_Brooks\_2\_\_\_COA\_and\_Procedure\_20240302123206.pdf

# **Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

**Operator Electronic Signature: JACKIE LATHAN** Signed on: JAN 26, 2024 09:52 AM

Name: KNOX JACK D

Title: Regulatory

Street Address: PO Box 5270

City: Hobbs State: NM

Phone: (575) 393-5905

Email address: Jlathan@mewbourne.com

#### **Field**

**Representative Name:** 

**Street Address:** 

City: State:

Phone:

**Email address:** 

## **BLM Point of Contact**

Signature: Keith Immatty

**BLM POC Name: KEITH P IMMATTY BLM POC Title: ENGINEER** 

**BLM POC Phone:** 5759884722 BLM POC Email Address: KIMMATTY@BLM.GOV

Zip:

**Disposition:** Approved Disposition Date: 03/02/2024

# Merribourne Oil Comparis

# Plug and Abandon

Submitted By: K.Kirkes

Wellname: Lucia Brookes BTY 2 #2 Location: 1980' FSL & 1980' FWL; Sec 14, T18S, R30E; Eddy **Date:** 1/4/24 **Csg Set:** 3853' **Perfs**: 3536' – 3566' Csg Size: 5 ½" 14# Unknown Grade **Tbg:** 2 %" 4.7# J55

Tbg Set @: 3554'

Set @: 551'

Surf Csg: 8 %" 20# Unknown Grade


Procedure as follows:

- MIRU turnkey plugging crew.
- POOH w/rods & pump. LD. ND WH & NU BOP.
- 3.
- POOH w/tbg.
- 5. MIRU WL. Run CBL from 3500' to surface & ensure TOC @ surface.
  6. RIH w/2 %" tbg & CIBP test tbg to 6000# above slips. Set CIBP @ 3450'. Test csg to 500# for 30 mins.
- Circulate Class C neat cmt to surface (~350 sx)
- 8. POOH w/tbg.
- Top fill csg w/cmt.
- 10. Ensure csg remains full for 30 minutes.
- 11. Cut off WH & install dry hole marker.
- 12. Remove equipment & remediate location.

Procedure OK as proposed. R111P well requirements apply. See COA


# Lucia Brookes BTY 2 #2 Current WBS

1980' FSL & 1980' FWL, Sec. 14 –T18S – R30E - Eddy Co, NM API 30-015-22773

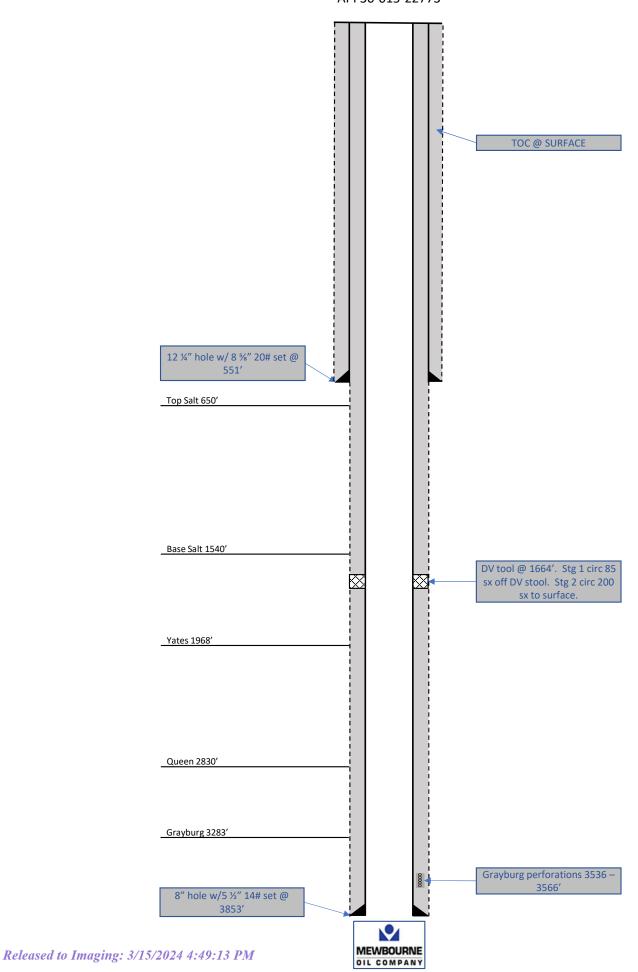

# Lucia Brookes BTY 2 #2 Proposed WBS

1980' FSL & 1980' FWL, Sec. 14 -T18S - R30E - Eddy Co, NM API 30-015-22773

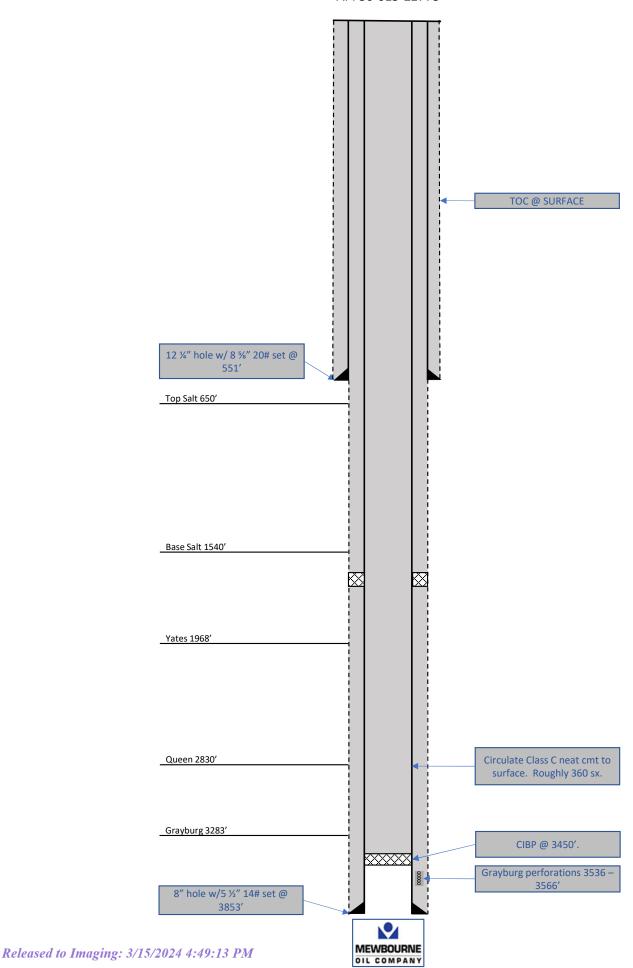

# BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

### Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.** 

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified BY PHONE (numbers listed under 2.Notification) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing. The following information shall be permanently inscribed on the plate: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

### **Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:**

From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 319599

### **CONDITIONS**

Operator:	OGRID:
MEWBOURNE OIL CO	14744
P.O. Box 5270	Action Number:
Hobbs, NM 88241	319599
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created E	y Condition	Condition Date
gcorde	A CBL must be run and submitted to OCD via OCD Permitting.	3/15/2024