

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Reports

Well Name: POKER LAKE UNIT CVX Well Location: T24S / R30E / SEC 28 / County or Parish/State: EDDY /

JV PC SESE / 32.182478 / -103.880324

Well Number: 3H Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMNM02862 Unit or CA Name: PLU PIERCE Unit or CA Number:

CANYON 28 FEDERAL1H NMNM71016K

LLC

# **Notice of Intent**

**Sundry ID**: 2794373

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 06/10/2024 Time Sundry Submitted: 08:50

Date proposed operation will begin: 07/10/2024

**Procedure Description:** XTO Permian Operating LLC., respectfully requests approval for plug and abandonment of the above mentioned well. Please see the attached P&A procedure, with current and proposed WBD's for your review.

# **Surface Disturbance**

Is any additional surface disturbance proposed?: No

# **NOI Attachments**

# **Procedure Description**

PLU\_CVX\_JV\_PC\_3H\_Procedure\_w\_Current\_and\_Proposed\_WBDs\_20240610084733.pdf

Page 1 of 2

eived by OCD: 73/2024 10:19:58 AM

JV PC

Well Location: T24S / R30E / SEC 28 / SESE / 32.182478 / -103.880324

County or Parish/State: Page 2 of

Well Number: 3H

Type of Well: OIL WELL

**Allottee or Tribe Name:** 

Lease Number: NMNM02862

Unit or CA Name: PLU PIERCE

**Unit or CA Number:** 

**CANYON 28 FEDERAL1H** 

NMNM71016K

**US Well Number: 300153683000S1** 

**Operator: XTO PERMIAN OPERATING** 

# **Conditions of Approval**

## **Specialist Review**

Poker\_Lake\_Unit\_CVX\_JV\_PC\_3H\_Sundry\_ID\_2794373\_P\_A\_20240701142454.pdf

# **Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

**Operator Electronic Signature: SHERRY MORROW** Signed on: JUN 10, 2024 08:48 AM

Name: XTO PERMIAN OPERATING LLC

Title: Regulatory Analyst

Street Address: 6401 HOLIDAY HILL ROAD BLDG 5

City: MIDLAND State: TX

Phone: (432) 218-3671

Email address: SHERRY.MORROW@EXXONMOBIL.COM

## **Field**

**Representative Name:** 

**Street Address:** 

City: State: Zip:

Phone:

**Email address:** 

# **BLM Point of Contact**

**BLM POC Name: LONG VO BLM POC Title:** Petroleum Engineer

**BLM POC Phone:** 5759885402 BLM POC Email Address: LVO@BLM.GOV

**Disposition:** Approved **Disposition Date:** 07/01/2024

Signature: Long Vo

Page 2 of 2

# PLUG AND ABANDON WELLBORE POKER LAKE UINT CVX JV PC 003H EDDY COUNTY, NEW MEXICO Class II

MASIP	MAOP	MAWP	Surface Csg Yield
1,000 psi	1,000 psi	3,000 psi	1730 PSI

**SUMMARY:** Plug and abandon wellbore according to BLM regulations.

- 1) MIRU plugging company. Set open top steel pit for plugging.
- 2) POOH LD rods and pump.
- 3) ND WH and NU 3K manual BOP. Function test BOP.
- 4) Unset the TAC at 7,380.9'. POOH LD 2-7/8" tbg.
- 5) MIRU WLU, RIH GR sized for 5-1/2 20# casing to 7,470'; RIH set CIBP at 7,450', pressure test to 500 PSI for 30 minutes; Notify BLM
- 6) Dump bail 35' **Class H** cement from 7,450' to 7,415'. WOC and tag to verify TOC. (T/Perfs, T/Bone Spring)
- 7) Run CBL from 7,415' to surface. (Estimated TOC at 4,400')
- 8) Spot 25 SKS **Class H** cement from 6,100' to 5,890'. WOC and tag to verify TOC. (T/Brushy Canyon)
- 9) Spot 30 SKS Class C cement from 4,900' to 4,600'. WOC and tag to verify TOC. (DV Tool, T/Cherry Canyon)
- 10) MIRU WLU, perforate at 3,900'.
- 11) Squeeze 80 SKS Class C cement from 3,900' to 3,635'. WOC and tag to verify TOC. (Intermediate Casing Shoe, T/Delaware, T/Bell Canyon, B/Salt)
- 12) MIRU WLU, perforate at 950'.
- 13) Circulate Class C cement from 950' to surface. (~290 SKS) (T/Salt, Surface Casing Plug)
- 14) ND BOP and cut off wellhead 5' below surface. RDMO PU, transport trucks, and pump truck.
- 15) Set P&A marker.

 $16)\,\mbox{Pull}$  fluid from steel tank and haul to disposal. Release steel tank.



# Downhole Well Profile - with Schematic Well Name: Poker Lake Unit CVX JV PC 003H

API/UWI SAP Cost Center ID Permit Number State/Province New Mexico Eddy

Surface Location Spud Date Original KB Elevation (ft) KB-Ground Distance (ft) Surface Casing Flange Elevation (ft) KB-Ground Distance (ft) Surface Casing Flange Elevation (ft) Surface Casing Flange

MD (ftKB)	₽₩ ₽₩	Incl (°)	Ver	tical schematic (actual)
18.0	18.0	0.1		Conductor; 24 in; 98.0 ftKB
98.1 -	98.1			Conductor; 20 in; 98.0 ftKB
- 100.1 - - 101.0 -	100.1	0.6		
549.9	549.7	1.7		Surface; 17 1/2 in; 865.0
750.0	749.8			
751.0	750.8	1.6		
817.6 - 818.9 -	817.3	1.4		
818.9 -	818.7	1.4	13 3/8" 48# H-40 DT&C Surf Csg; 865.0	Surface; 13 3/8 in; 865.0
865.2	864.9	1.3	Cmt tail 1002sx Class C,	ftKB Intermediate; 12 1/4 in;
3,529.9	3,529.3		circ 545 sx to pit; 865.1	3,820.0 ftKB
3,629.9	3,629.4	0.7	TOC by Cas V Imaging Log; 3,630.0	(a) ta
3,630.9	3,630.3			18 18 m
3,634.8 -	3,634.3	0.7		
3,757.9	3,758.3	0.4		10: II
3,818.9	3,818.3		9 5/8" 40# J-55 LT&C Inter	
3,819.9	3,819.3	0.3	Csg; 3,821.5 Cmt Lead w/975sx POZ C &	Intermediate; 9 5/8 in; 3,820.0 ftKB
3,821.5	3,821.0		tail w/350sx Class C, circ ···	0,020.0 1445
3,899.9	3,899.4	0.4	448sx to pit; 3,821.6	
- 4,499.0 - - 4,500.0 -	4,498.4	0.3	Marker Jt.; 4,498.9	3,020.0 IIIID
4,500.0	4,634.3	0.3		§
4,873.0	4,872.4	0.6	DV Tool; 4,873.1	
4,874.0	4,873.4			
4,899.9	4,899.3	0.6		
7,304.1	7,303.5		Marker Jr.; 7,304.4	Pilot; 8 3/4 in; 11,130.0 ftKB
7,304.5 - 7,305.1 -	7,303.8	0.8	Warker 31., 7,304.4	Production; 5 1/2 in; 12,394.0 ftKB
7,415.0	7,414.3	0.8	Plunger Lift Plunger;	PBTD Original Hole;
7,450.1	7,449.4		7,428.0-7,448.0 ftKB; — 8/27/2015	7,488.0 ftKB Cement; Cement Plug;
7,451.1	7,450.4	0.9	0/21/2013	7,800.0 ftKB
7,487.9	7,487.2		KOP @ 7515'; 7,515.0;	Sidetrack - Lateral; 7,488.0 ftKB
7,515.1 -	7,514.4	1.0	4/23/2009	
- 7,799.9 - - 8,183.1 -	8,182.3	1.0		
8,930.1	8,929.2			Cement; Cement Plug;
9,149.9	9,149.0	1.0	Markey II. 40 440 0	9,150.0 ftKB
10,140.1	10,139.0		Marker Jt; 10,140.0 Top Perf @ 8183 and	Cement; Cement Plug;
10,844.2	10,843.0	1.0	bottom perf @; 12,371.0 5 1/2" 20# HCL-80 LTC	11,130.0 ftKB TD - Original Hole; 11,130.0
- 11,129.9 - - 12,371.1 -	11,128.7	10	Prod Csg; 12,393.8	ftKB
- 12,371.1 - - 12.393.7 -	12,369.6	1.0	Cmt Lead w/800sx POZ H & tail w/1300 POZ H. 2nd	
12,394.0	12,392.6	1.0	Stage Lead w/ 400sx; 12,393.8	
	L		12,383.8	

	Original KB Elevation (ft) Ground Elevation			B-Ground	Distance (ft)	)	Surrace	Casing Flange Eleva		
Wellbores										
Wellbore Name Original Hole		1	arent Wo Prigina	ellbore Il Hole	Wellbore API/UWI					
Start Depth (ftKB)	Start Depth (ftKB)				Profile Type Vertical					
Section Des		Но	ole Sz (i	n)	Act	Top (ftKB)	)		Act E	3tm (ftKB)
Conductor				24			18.0			98.0
Surface				17 1/2			98.0			865.0
Intermediate				12 1/4			865.0			3,820.0
Pilot				8 3/4			3,820.0			11,130.0
Zones										
Zone Name		Top (ftKB)		3)	В	Btm (ftKB)		Current Status		ent Status
Bone Spring										
AVALON SHALE			8,183.0			12,371.0		PRODUCING		
Casing Strings										
Csg Des	S	et Depth (ftKE	,	OD	(in)	W	t/Len (lb/ft)			Grade
Conductor			98.0		20			0.00		
Surface		8	865.0		13 3/8		48	8.00	H-40	
Intermediate		3,8	320.0		9 5/8		40.00		J-55	
Cement										
Des				уре	Start Da	ate	Top (			Btm (ftKB)
Conductor Cemen					4/24/2009	2009			8.0	98.0
Surface Casing Ce			Casing		4/26/2009			18.0		865.0
Intermediate Casir	Casing Cement Casing			5/2/2009			1	8.0	3,820.0	
Cement Plug		PI	lug		5/23/2009		1	0,84	4.0	11,130.0
Cement Plug		PI	lug		5/24/2009			8,93	0.0	9,150.0
Cement Plug		PI	lug		5/24/2009			7,48	8.0	7,800.0

Page 1/1 Report Printed:

# PLU CVX JV PC 3H - Proposed WBD

847' T/Salt

865' Surface Casing Shoe

3782' B/Salt

3832' T/Delaware, Bell

Canyon

4400' Estimated TOC

4701' T/Cherry Canyon


4873' DV Tool

5982' T/Brushy Canyon

7488' Sidetrack

7631' T/Bone Spring

8183' T/Perfs

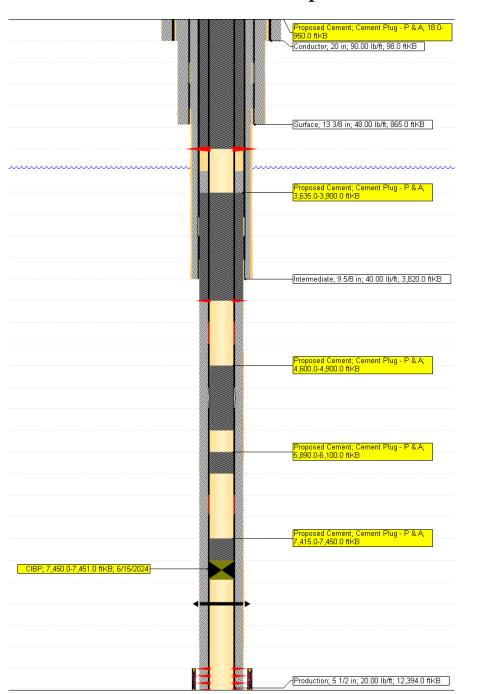

Perf and circulate from 950' to surface.

Squeeze 80 SKS Class C: 3,900' to 3,635'. WOC and Tag.

Spot 30 SKS Class C: 4,900' to 4,600'. WOC and Tag.

Spot 25 SKS **Class H**: 6,100' to 5,890'. WOC and Tag.

Dump bail 35' **Class H** atop CIBP: 7,450' to 7,415'. PT CIBP to 500 PSIG for 30 min. WOC and Tag.

**WAFMSS** 

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report

Well Name: POKER LAKE UNIT CVX

JV PC

Well Location: T24S / R30E / SEC 28 /

SESE / 32.182478 / -103.880324

County or Parish/State: EDDY /

NM

Well Number: 3H

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM02862

Unit or CA Name: PLU PIERCE

Unit or CA Number:

CANYON 28 FEDERAL1H

NMNM71016K

US Well Number: 300153683000S1

Operator: XTO PERMIAN OPERATING

LLC

LONG VO Digitally signed by LONG VO Date: 2024.07.01 15:07:13 -05'00'

#### **Notice of Intent**

Sundry ID: 2794373

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 06/10/2024

Time Sundry Submitted: 08:50

Date proposed operation will begin: 07/10/2024

Procedure Description: XTO Permian Operating LLC., respectfully requests approval for plug and abandonment of the above mentioned well. Please see the attached P&A procedure, with current and proposed WBD's for your review.

#### **Surface Disturbance**

Is any additional surface disturbance proposed?: No

#### **NOI Attachments**

**Procedure Description** 

PLU\_CVX\_JV\_PC\_3H\_Procedure\_w\_Current\_and\_Proposed\_WBDs\_20240610084733.pdf

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND SPECIAL STIPULATIONS ATTACHED Well Name: POKER LAKE UNIT CVX

JV PC

Well Location: T24S / R30E / SEC 28 / SESE / 32.182478 / -103.880324

/ SEC 28 / County or Parish/State: EDDY / 324 NM

Well Number: 3H

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM02862

Unit or CA Name: PLU PIERCE CANYON 28 FEDERAL1H

Unit or CA Number: NMNM71016K

US Well Number: 300153683000S1

Operator: XTO PERMIAN OPERATING

LLC

#### Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: SHERRY MORROW

Signed on: JUN 10, 2024 08:48 AM

Name: XTO PERMIAN OPERATING LLC

Title: Regulatory Analyst

Street Address: 6401 HOLIDAY HILL ROAD BLDG 5

City: MIDLAND

State: TX

Phone: (432) 218-3671

Email address: SHERRY.MORROW@EXXONMOBIL.COM

#### Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

Form 3160-5 (June 2019)

# **UNITED STATES** DEPARTMENT OF THE INTERIOR

FORM APPROVED OMB No. 1004-0137 Expires: October 31, 2021

5. Lease Serial No.	NMNM02862	
5. If Indian Allottee	or Tribe Name	

BUREAU OF LAND MANAGEMENT			5. Lease Serial	5. Lease Serial No.			
	IOTICES AND REPORTS ON			NWNWU2862			
Do not use this t	form for proposals to drill or t Use Form 3160-3 (APD) for su		6. If Indian, Allottee or Tribe Name				
SUBMIT IN	TRIPLICATE - Other instructions on pa		7. If Unit of CA/Agreement, Name and/or No.				
1. Type of Well				CANYON 28 FEDERAL1H/NMNM7			
Oil Well Gas Well Other  2. Name of Operator XTO PERMIAN OPERATING LLC  9				$^{ m nd~No.}$ POKER LAKE UNIT CVX JV $^{ m r}$	PC/3H		
			9. API Well No.				
3a. Address 6401 HOLIDAY HILL Re	OAD BLDG 5, MIDLAND, 3b. Phone No (432) 683-22	. (include area code) 277	1	ool or Exploratory Area			
4. Location of Well (Footage, Sec., T., R SEC 28/T24S/R30E/NMP			11. Country or I		***************************************		
			EDDY/NM				
12. CHE	CK THE APPROPRIATE BOX(ES) TO IN	DICATE NATURE	OF NOTICE, REPORT O	R OTHER DATA			
TYPE OF SUBMISSION		TYP	E OF ACTION				
✓ Notice of Intent	Acidize Dee	pen Iraulic Fracturing	Production (Start/Res	ume) Water Shut-Off Well Integrity	E-F		
Subsequent Report	- Command V	v Construction	Recomplete	Other			
subsequent report	process	g and Abandon	Temporarily Abandon	toronta de la constitución de la			
Final Abandonment Notice	Convert to Injection Plug peration: Clearly state all pertinent details,	g Back	Water Disposal				
XTO Permian Operating LLC.,	ices must be filed only after all requirement respectfully requests approval for plug and proposed WBD's for your review.				c site		
14. I hereby certify that the foregoing is SHERRY MORROW / Ph: (432) 21		Regulatory	Analyst				
(Electronic Submission)			06	/10/2024	***************************************		
	THE ADMAR FOR THE	Date		TOLOUT			
Approved by	THE SPACE FOR FED	EHAL OR STA	TE OFICE USE				
Approved by Long Vo	2.	Title Petro	leum Engineer	Date 7/1/2024			
Conditions of approval, if any, are attached that the applicant holds legal or ewhich would entitle the applicant to condition	ed. Approval of this notice does not warrar quitable title to those rights in the subject le luct operations thereon.	nt or	-0	1717 664			
Fitle 18 U.S.C Section 1001 and Title 43	U.S.C Section 1212, make it a crime for a	ny person knowingly	and willfully to make to a	any department or agency of the United	States		

(Instructions on page 2)

#### GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

#### SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

#### **NOTICES**

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

**BURDEN HOURS STATEMENT:** Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect offthis form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

# **Additional Information**

# Location of Well

0. SHL: SESE / 350 FSL / 850 FEL / TWSP: 24S / RANGE: 30E / SECTION: 28 / LAT: 32.182478 / LONG: -103.880324 ( TVD: 7963 feet, MD: 12335 feet ) BHL: NENE / 350 FNL / 850 FEL / TWSP: 24S / RANGE: 30E / SECTION: 28 / LAT: 0.0 / LONG: 0.0 ( TVD: 7963 feet, MD: 12335 feet )

# PLUG AND ABANDON WELLBORE POKER LAKE UINT CVX JV PC 003H EDDY COUNTY, NEW MEXICO Class II

MASIP	MAOP	MAWP	Surface Csq Yield
1,000 psi	1,000 psi	3,000 psi	1730 PSI

**SUMMARY:** Plug and abandon wellbore according to BLM regulations.

- 1) MIRU plugging company. Set open top steel pit for plugging.
- 2) POOH LD rods and pump.
- 3) ND WH and NU 3K manual BOP. Function test BOP.
- 4) Unset the TAC at 7,380.9'. POOH LD 2-7/8" tbg.
- 5) MIRU WLU, RIH GR sized for 5-1/2 20# casing to 7,470'; RIH set CIBP at 7,450', pressure test to 500 PSI for 30 minutes; Notify BLM

Spot 25 5x5 7389'

- 6) Dump bail 35' Class H cement from 7,450' to 7,415'. WOC and tag to verify TOC. (T/Perfs, T/Bone Spring)
- 7) Run CBL from 7,415' to surface. (Estimated TOC at 4,400')
- 8) Spot 25 SKS **Class H** cement from 6,100′ to 5,890′. WOC and tag to verify TOC. (T/Brushy Canyon)
- 9) Spot 30 SKS Class C cement from 4,900' to 4,600'. WOC and tag to verify TOC. (DV Tool, T/Cherry Canyon)


10) MIRU WLU, perforate at 3,900'. (If CBL indicate no coment otherwise spot coment instead)


11) Squeeze 80 SKS Class C cement from 3,900' to 3,635'. WOC and tag to verify TOC. (Intermediate Casing Shoe, T/Delaware, T/Bell Canyon, B/Salt) ur spit 25' 5x5 class C.

12) MIRU WLU, perforate at 956'. 1055'

- 13) Circulate Class C cement from 950' to surface. (~290 SKS) (T/Salt, Surface Casing Plug)
- 14) ND BOP and cut off wellhead 5' below surface. RDMO PU, transport trucks, and pump truck.
- 15) Set P&A marker.

16) Pull fluid from steel tank and haul to disposal. Release steel tank.

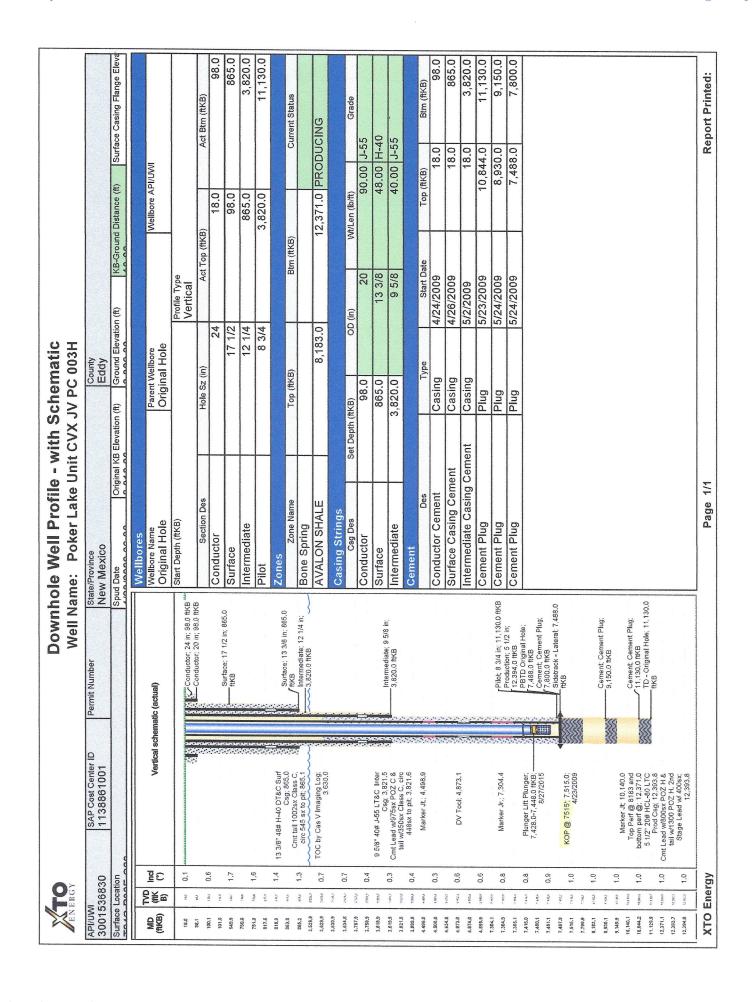

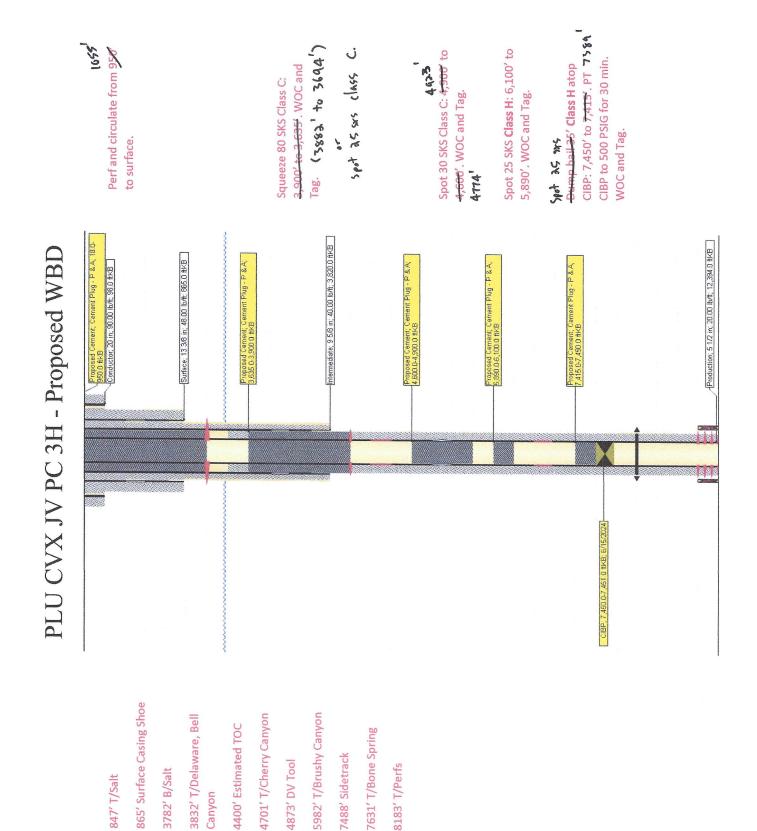

Canyon

# BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

# Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **fresh** water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified *BY PHONE* (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



# **United States Department of the Interior**

## BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

## **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or

concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos

Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Doris Lauger Martinez Environmental Protection Specialist 575-234-5926

Jaden Johnston Environmental Protection Asst. (Intern) 575-234-6252

Released to Imaging: 7/16/2024 3:35:52 PM

Sundry ID	2794373						
Plug Type	Тор	Bottom	Length	Tag	Sacks	Cement Class	Notes
i lug Type	ТОР	Bottom	Length	Tug	Oucks	Oluss	Notes
Surface Plug	0.00	100.00	100.00	Tag/Verify			
Fresh Water @ 800	742.00		108.00	If solid			
13.375 inch- Shoe Plug	806.35	915.00	108.65	Tag/Verify			
Top of Salt @ 1005	944.95			Tag/Verify	309.00	С	Perf and squeeze from 1055' to surface. (In 100 sxs/Out 209 sxs) Verify at surface.
Base of Salt @ 3782	3694.18	3832.00	137.82	Tag/Verify			
9.625 inch- Shoe Plug	3733.78	3872.00	138.22	Tag/Verify			
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio			Perf and squeeze from 3882' to 3694'. (In 18 sxs/Out 38 sxs) Otherwise if CBL indicate cement, spot 25 sxs
Delaware @ 3832	3743.68	3882.00	138.32	ns	56.00	С	instead. Spot cement from
							4923' to 4774'.
DV tool plug	4774.27			Tag/Verify	25.00	С	WOC and Tag.
5.5 inch- Shoe Plug	7389.85	7565.00	175.15	Tag/Verify			
CIBP Plug	7415.00	7450.00	35.00		25.00	Н	Set CIBP at 7450'. Spot cement from 7450' to 7389'. Leak test CIBP.
Bonesprings @ 7631	7504.69	7681.00	176 31	If solid base no			
Perforations Plug (If No CIBP)	8133.00	12421.00	4288.00	Tag/Verify		ļ	

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole. Class H >7500' Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

		Salt to surface	
Cave Karst/Potash Cement Requirement:	<u>Medium</u>		
13.375 inch- Shoe Plug @	865.00		
9.625 inch- Shoe Plug @	3822.00		
5.5 inch- Shoe Plug @	7515.00	TOC @	3200.00
Perforatons Top @	8183.00	Perforations	12371.00
DV Tool @	4873.00	CIBP @	7450.00

# State of New Mexico Energy, Minerals and Natural Resources Department

Michelle Lujan Grisham Governor

Sarah Cottrell Propst Cabinet Secretary

**Dylan M. Fuge**Deputy Secretary

**Dylan M. Fuge**, Division Director (Acting) **Oil Conservation Division** 



# NEW MEXICO PLUG AND ABANDON CONDITIONS OF APPROVAL

# Effective January 1, 2024

The New Mexico Oil Conservation Division ("OCD") is announcing the release of its updated Plugging and Abandoning Conditions of Approval ("COA"). These COAs will bring consistency throughout the state and formalize existing practice in the field that are already being required by OCD and performed by Operators. OCD staff reviewing plans are directed to implement these COA's are throughout the entire State of New Mexico, except when circumstances warrant modifications or additional requirements as dictated by specific plugging project conditions, which determines are left solely to OCD.

For the most part, these updates simply consolidate current practice to ensure it applied uniformly state-wide. The most significant changes from existing practice are as follows:

- Logs.
  - A Cement Bond Log is required to ensure isolation of producing formations, protection of water and correlative rights. A CBL must be run or be on file that can properly evaluate the cement behind the casing.

Note: Logs must be submitted to OCD via OCD permitting. A copy of the log may be emailed to the Compliance Officer Supervisor for faster review times, but email transmittal does not relieve the requirement for an operator to file through OCD permitting.

- Cement:
  - A table has been included which indicates the Class of cement and its allowed lower limits. This table is intended to align OCD requirements with applicable API standards and the Haliburton Redbook.
  - We are also standardizing practices with respect to cement waiting times:
    - 4 hours for accelerated (calcium chloride) cement.
    - 6 hours on regular cement.
- Formations:

1220 South St. Francis Drive • Santa Fe, New Mexico 87505 Phone (505) 476-3460 • Fax (505) 476-3462 • www.emnrd.nm.gov

• The COAs now include appendices for geological formation tops that shall be plugged.

The updated plugging COAs are attached to this notice. These COAs are effective for plugging operations for any NOI C-103F submitted on or after January 1, 2024, unless OCD determines that a modification or additional COAs are necessary based on specific plugging project conditions.

1220 South St. Francis Drive • Santa Fe, New Mexico 87505 Phone (505) 476-3460 • Fax (505) 476-3462 • www.emnrd.nm.gov

# State of New Mexico Energy, Minerals and Natural Resources Department Oil Conservation Division Standard Plugging Conditions



This document provides OCD's general plugging conditions of approval. It should be noted that the list below may not cover special plugging programs in unique and unusual cases, and OCD expressly reserves the right to impose additional requirements to the extent dictated by project conditions. The OCD also reserves the right to approve deviations from the below conditions if field conditions warrant a change. A C-103F NOI to P&A must be approved prior to plugging operations. Failure to comply with the conditions attached to a plugging approval may result in a violation of 19.15.5.11 NMAC, which may result in enforcement actions, including but not limited to penalties and a requirement that the well be re-plugged as necessary.

- 1. Notify OCD office at least 24 hours before beginning work and seek prior approval to implementing any changes to the C-103 NOI to PA.
  - North Contact, Monica Kuehling, 505-320-0243, monica.kuehling@emnrd.nm.gov
  - South Contact, Gilbert Cordero, 575-626-0830, gilbert.cordero@emnrd.nm.gov
- A Cement Bond Log is required to ensure strata isolation of producing formations, protection of
  water and correlative rights. A CBL must be run or be on file that can be used to properly
  evaluate the cement behind the casing.

Note: Logs must be submitted to OCD via OCD permitting. A copy of the log may be emailed to OCD inspector for faster review times, but emailing does not relieve the operators obligation to submit through OCD permitting.

- 3. Once Plugging operations have commenced, the rig must not rig down until the well is fully plugged without OCD approval. If gap in plugging operations exceeds 30 days, the Operator must file a subsequent sundry of work performed and revised NOI for approval on work remaining. At no time shall the rig be removed from location if it will result in waste or contamination of fresh water.
- 4. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 5. Fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
  - North, water or mud laden fluids
  - South, mud laden fluids
- 6. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to an OCD permitted disposal facility.
- 7. Class of cement shall be used in accordance with the below table for depth allowed.

Class	TVD Lower Limit (feet)
Class A/B	6,000
Class I/II	6,000
Class C or III	6,000
Class G and H	8,000
Class D	10,000

Class E	14,000
Class F	16,000

- 8. After cutting the well head any "top off cement jobs" must remain static for 30 minutes. Any gas bubbles or flow during this 30 minutes shall be reported to the OCD for approval of next steps.
- 9. Trucking companies being used to haul oilfield waste fluids (Commercial or Private) to a disposal facility shall have an approved OCD C-133 permit.
  - A copy of this permit shall be available in each truck used to haul waste products.
  - It is the responsibility of the Operator and Contractor to verify that this permit is in place prior to performing work.
  - Drivers shall be able to produce a copy upon request of an OCD Compliance Officer.
- 10. Filing a [C-103] Sub. Plugging (C-103P) will serve as notification that the well has been plugged.
- 11. A [C-103] Sub. Release After P&A (C-103Q) shall be filed no later than a year after plugging and a site inspection by OCD Compliance officer to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to meet OCD standards before bonding can be released.
- 12. Produced water or brine-based fluids may not be used during any part of plugging operations without prior OCD approval.

#### 13. Cementing;

- All cement plugs will be neat cement and a minimum of 100' in length. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- If cement does not exist between or behind the casing strings at recommended formation depths, the casing perforations will be shot at 50' below the formation top and the cement retainer shall be set no more than 50' from the perforations.
- WOC (Wait on Cement) time will be:
  - o 4 hours for accelerated (calcium chloride) cement.
  - o 6 hours on regular cement.
- Operator must tag all cement plugs unless it meets the below condition.
  - The operator has a passing pressure test for the casing annulus and the plug is only an inside plug.
- If perforations are made operator must tag all plugs using the work string to tag unless given approval to tag with wireline by the correct contact from COA #1 of this document.
  - This includes plugs pumped underneath a cement retainer to ensure retainer seats properly after cement is pumped.
- Cement can only be bull-headed with specific prior approval.
- Squeeze pressures are not to exceed the exposed formations frac gradient or the burst pressure of the casing.
- 14. A cement plug is required to be set from 50' below to 50' above (straddling) formation tops, casing shoes, casing stubs, any attempted casing cut offs, anywhere the casing is perforated, DV tools.
  - Perforation/Formation top plug. (When there is less than 100ft between the top perforation to the formation top.) These plugs are required to be started no greater than

50ft from the top perforation. However, the plug should be set below the formation top or as close to the formation top as possible for the maximum isolation between the formations. The plug is required to be a 100ft cement plug plus excess.

- Perforation Plug when a formation top is not included. These plugs are required to be started within 50ft of the top perforation. The plug is required to be a 100ft cement plug plus excess.
- Cement caps on top of bridge plugs or cement retainers for perforation plugs, that are
  not straddling a formation top, may be set using a bailer with a minimum of 35' of
  cement in lieu of the 100' plug. The bridge plug or retainer must be set within 50ft of the
  perforations.
- Perforations are required below the surface casing shoe if cement does not exist behind
  the casing, a 30-minute minimum wait time will be required immediately after
  perforating to determine if gas and/or water flows are present. If flow is present, the
  well will be shut-in for a minimum of one hour and the pressure recorded. If gas is
  detected contact the OCD office for directions.
- 15. No more than 3000 feet is allowed between cement plugs in cased hole and no more than 2000 feet is allowed in open hole.
- 16. Formation Tops to be isolated with cement plugs, but not limited to are:
  - Northwest See Figure A
  - South (Artesia) See Figure B
  - Potash See Figure C
    - o In the R-111-P (Or as subsequently revised) Area a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
  - South (Hobbs) See Figure D1 and D2
  - Areas not provided above will need to be reviewed with the OCD on a case by case basis.

## 17. Markers

• Dry hole marker requirements 19.15.25.10.

The operator shall mark the exact location of plugged and abandoned wells with a steel marker not less than four inches in diameter set in cement and extending at least four feet above mean ground level. The marker must include the below information:

- 1. Operator name
- 2. Lease name and well number
- 3. API number
- 4. Unit letter
- 5. Section, Township and Range
- AGRICULTURE (Below grade markers)

In Agricultural areas a request can be made for a below ground marker. For a below ground marker the operator must file their request on a C-103 notice of intent, and it must include the following;

- A) Aerial photo showing the agricultural area
- B) Request from the landowner for the below ground marker.

C) Subsequent plugging report for a well using a below ground marker must have an updated C-102 signed by a certified surveyor for SHL.

Note: A below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to OCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to OCD. OCD requires a current survey to verify the location of the below ground marker, however OCD will accept a GPS coordinate that were taken with a GPS that has an accuracy of within 15 feet.

18. If work has not commenced within 1 year of the approval of this procedure, the approval is automatically expired. After 1 year a new [C-103] NOI Plugging (C-103F) must be submitted and approved prior to work.

Figure A

# North Formations to be isolated with cement plugs are:

- San Jose
- Nacimiento
- Ojo Alamo
- Kirtland
- Fruitland
- Picture Cliffs
- Chacra (if below the Chacra Line)
- Mesa Verde Group
- Mancos
- Gallup
- Basin Dakota (plugged at the top of the Graneros)
- Deeper formations will be reviewed on a case-by-case basis

Figure B

# South (Artesia) Formations to be isolated with cement plugs are:

- Fusselman
- Montoya
- Devonian
- Morrow
- Strawn
- Atoka
- Permo-Penn
- Wolfcamp
- Bone Springs
- Delaware, in certain areas where the Delaware is subdivided into;
  - 1. Bell Canyon
  - 2. Cherry Canyon
  - 3. Brushy Canyon
- Any salt sections
- Abo
- Yeso
- Glorieta
- San Andres
- Greyburg
- Queen
- Yates

## Figure C

#### Potash Area R-111-P

T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All

except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23.

Sec 24. Sec 25 Unit D. Sec 26 Unit A- F. Sec 27 Unit A,B,C,F,G,H.

T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P.

Sec 7 – Sec

10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec

24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32

Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec

23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit

A-H. Sec 36 Unit B-G.

T 20S – R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P.

Sec 19 Unit A,B,G,H,I,J,O,P. Sec 20 – 29. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P.

Sec 10 Unit A,B,G-P. Sec 11 - Sec 36.

T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec

23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S - R 30E

Sec 1 - Sec 36

T 21S - R 31E

Sec 1 – Sec 36

T 22S - R 28E

Sec 36 Unit A,H,I,P.

T 22S - R 29E

Sec 1. Sec 2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit

A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S - R 30E

Sec 1 – Sec 36

T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25

Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S - R 28E

Sec 1 Unit A

T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit

A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33

Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit

A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec

33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit

I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec

34. Sec 35 Unit C,D,E.

T 24S - R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S - R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11

Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.

T 24S – R 31E Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S – R 31E Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

Figure D1 and D2

South (Hobbs) Formations to be isolated with cement plugs are:

The plugging requirements in the Hobbs Area are based on the well location within specific areas of the Area (See Figure D1). The Formations in the Hobbs Area to be isolated with cement plugs are (see Figure D2)

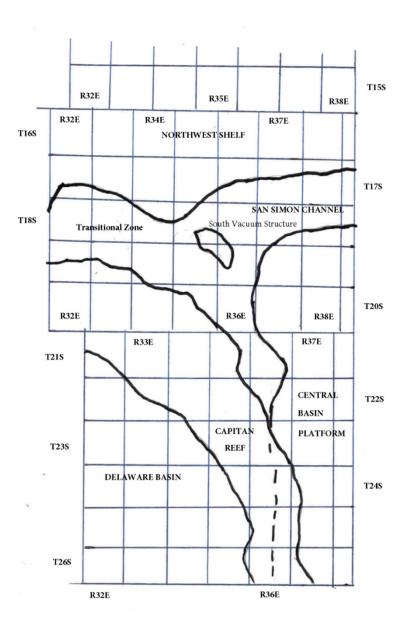


Figure D1 Map

# Figure D2 Formation Table

	100'	Plug to isolate upper ar	nd lower fresh water	zones (typically 250' to	350')	
Northwest Shelf	Captan Reef Area	Transition Zone	San Simon Channel	South Vacuum Structure	Delaware Basin	Central Basin Platform
Granit Wash (Detrital basement material and fractured pre-Cambrian basement rock)	Siluro-Devonian	Morrow	Siluro-Devonian	Ellenburger	Siluro-Devonian	Granit Wash (Detrital basement material, fractured pre-Cambrian basement rock and fractur Mafic Volcanic intrusives)
Montoya	Mississippian	Atoka	Morrow	Mckee	Morrow	Ellenburger
Fusselman	Morrow	Strawn	Wolfcamp	Siluro-Devonian	Atoka	Connell
Woodford	Atoka	Cisco	Abo Reef	Woodford	Strawn	Waddell
Siluro-Devonian	Strawn	Pennsylvanian	Bone Spring	Mississippian	Pennsylvanian	Mckee
Chester	Pennsylvanian	Wolfcamp	Delaware	Barnett Shale	Lower Wolfcamp	Simpson Group
Austin	Wolfcamp	Bone Spring	San Andres	Morrow	Upper Wolfcamp	Montoya
Mississippian	Abo Reef, if present	Delaware	Queen	Atoka	Wolfcamp	Fusselman
Morrow	Abo, if present	San Andres	Yates	Strawn	Third Bone Spring Sand (Top of Wolfbone)	Silurian
Atoka	Queen, if present	Grayburg-San Andres	Base of Salt	Canyon	First Bone Spring Sand (Top of Lower Bone Spring)	Devonian
Lower Pennsylvanian	Bone Spring	Queen	Rustler	Pennsylvanian	Bone Spring	Strawn
Cisco-Canyon	Delaware	Seven Rivers		Blinebry	Brushy Canyon	Pennsylvanian
Pennsylvanian	Base Capitan Reef	Yates		Bone Spring	Delaware (Base of Salt)	Wolfcamp
Bough	Seven Rivers	Base of Salt		San Andres	Rustler	Abo
Wolfcamp	Yates	Rustler		Queen		Abo Reef
Abo	Top Capitan Reef			Base of Salt		Drinkard
Abo Reef, if present	Base of Salt			Rustler		ТиЬЬ
Yeso (Township 15 South to Township 17 South)	Rustler					Blinebry
Drinkard or Lower Yeso (Township 15 South to Township 17 South)						Paddock
Tubb (Township 15 South to Township 17 South)						Glorieta
Blinebry (Township 15 South to Township 17 South)						San Andres
Paddock (Township 15 South to Township 17 South)						Grayburg
Glorieta						Grayburg-San Andres
San Andres						Queen
Queen (Township 15 South to Township 17 South)						Seven Rivers
Seven Rivers (Township 15 South to Township 17 South)						Yates
'ates (Township 15 South to Township 17 South)						Base of Salt
Base of Salt						Rustler
Rustler		<del>                                     </del>				

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

# **State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 360902

## **CONDITIONS**

Operator:	OGRID:
XTO ENERGY, INC	5380
6401 Holiday Hill Road	Action Number:
Midland, TX 79707	360902
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify NMOCD 24 hours prior to beginning P&A operations.	7/16/2024
loren.diede	Submit CBL to NMOCD via Electronic Permitting.	7/16/2024
loren.diede	NMOCD determines that this well is not in the LPCH restricted area.	7/16/2024
loren.diede	NMOCD concurs with BLM modifications and COAs.	7/16/2024