

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Reported

Well Name: FEDERAL CR 8 Well Location: T24S / R35E / SEC 8 / County or Parish/State: LEA /

NWSE / 32.2302355 / -103.3873908 NM

Well Number: 01 Type of Well: CONVENTIONAL GAS Allottee or Tribe Name:

WELL

Lease Number: NMNM01228 Unit or CA Name: FEDERAL CR 8 Unit or CA Number:

NMNM72184

**US Well Number:** 3002527351 **Operator:** OXY USA INCORPORATED

# **Notice of Intent**

**Sundry ID:** 2815838

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 10/08/2024 Time Sundry Submitted: 06:56

Date proposed operation will begin: 11/08/2024

**Procedure Description:** OXY PROPOSES TO PA THE SUBJECT WELL. A PA PREP RIG PROCEDURE IS ATTACHED AND MIGHT BE EXECUTED BEFORE THE PA RIG PLUGS OUT THE WELLBORE. THE CURRENT WELLBORE, PROPOSED WELLBORE, AND PA PROCEDURE ARE ATTACHED.

# **Surface Disturbance**

Is any additional surface disturbance proposed?: No

# **NOI Attachments**

**Procedure Description** 

FEDERAL\_CR\_8\_001\_PA\_NOI\_SUB\_10.8.2024\_20241008065627.pdf

eceived by OCD: 11/12/2024 6:57:45 AM
Well Name: FEDERAL CR 8

Well Location: T24S / R35E / SEC 8 /

NWSE / 32.2302355 / -103.3873908

County or Parish/State: LEA/

NM

Well Number: 01

Type of Well: CONVENTIONAL GAS

WELL

**Allottee or Tribe Name:** 

Lease Number: NMNM01228

Unit or CA Name: FEDERAL CR 8

Unit or CA Number: NMNM72184

TAIVITAIVIT Z 10-

US Well Number: 3002527351 Operator: OXY USA INCORPORATED

# **Conditions of Approval**

# **Specialist Review**

Federal\_CR\_8\_1\_Sundry\_ID\_2815838\_P\_A\_20241105113815.pdf

# **Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: STEPHEN JANACEK Signed on: OCT 08, 2024 06:56 AM

Name: OXY USA INCORPORATED

Title: Regulatory Engineer

Street Address: 5 Greenway Plaza, Suite 110

City: Houston State: TX

Phone: (713) 497-2417

Email address: stephen\_janacek@oxy.com

# **Field**

**Representative Name:** 

**Street Address:** 

City: State: Zip:

Phone:

**Email address:** 

# **BLM Point of Contact**

Signature: Long Vo

BLM POC Name: LONG VO BLM POC Title: Petroleum Engineer

BLM POC Phone: 5759885402 BLM POC Email Address: LVO@BLM.GOV

**Disposition:** Approved **Disposition Date:** 11/05/2024

Disposition: Approved Disposition Date: 17/03/2024

Page 2 of 2

Form 3160-5 (June 2019)

# **UNITED STATES** DEPARTMENT OF THE INTERIOR

FORM APPROVED
OMB No. 1004-0137
Expires: October 31, 202

BUREAU OF LAND MANAGEMENT  SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.				5. Lease Serial No.			
				6. If Indian, Allottee or Tribe Name			
SUBMIT IN T	TRIPLICATE - Other instruct	ions on page 2		7. If Unit of CA/Agreement, N	ame a	nd/or No.	
1. Type of Well  Oil Well  Gas W	/ell Other			8. Well Name and No.			
2. Name of Operator				9. API Well No.			
3a. Address	38	o. Phone No. (include	de area code)	10. Field and Pool or Explorate	ory Ar	ea	
4. Location of Well (Footage, Sec., T.,R	.,M., or Survey Description)			11. Country or Parish, State			
12. CHE	CK THE APPROPRIATE BOX	X(ES) TO INDICAT	E NATURE O	F NOTICE, REPORT OR OTH	IER D	ATA	
TYPE OF SUBMISSION			ТҮРЕ	OF ACTION			
Notice of Intent	Acidize	Deepen		Production (Start/Resume)		Water Shut-Off	
	Alter Casing	Hydraulic F	_	Reclamation	Ļ	Well Integrity	
Subsequent Report	Casing Repair	New Constr		Recomplete		Other	
	Change Plans	Plug and Al	oandon _	Temporarily Abandon			
Final Abandonment Notice  13. Describe Proposed or Completed O	Convert to Injection	Plug Back	L	Water Disposal			
completed. Final Abandonment Not is ready for final inspection.)			iding reclamati	on, have been completed and ti	ne ope	rator has detennined that the site	
14. I hereby certify that the foregoing is	true and correct. Name (Printe	,					
		Title					
Signature		Date					
	THE SPACE F	OR FEDERA	L OR STAT	E OFICE USE			
Approved by							
			Title	I	Date		
Conditions of approval, if any, are attacl certify that the applicant holds legal or ewhich would entitle the applicant to con	equitable title to those rights in		Office				
Title 18 U.S.C Section 1001 and Title 43	3 U.S.C Section 1212, make it a	a crime for any pers	on knowingly a	and willfully to make to any de	partme	ent or agency of the United States	

any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

### **GENERAL INSTRUCTIONS**

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

### SPECIFIC INSTRUCTIONS

*Item 4* - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

### **NOTICES**

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

**BURDEN HOURS STATEMENT:** Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

(Form 3160-5, page 2)

# **Additional Information**

# **Location of Well**

 $0. \ SHL: \ NWSE \ / \ 1980 \ FEL \ / \ TWSP: 24S \ / \ RANGE: 35E \ / \ SECTION: 8 \ / \ LAT: 32.2302355 \ / \ LONG: -103.3873908 \ ( \ TVD: 0 \ feet, \ MD: 0 \ feet ) \\ BHL: \ NWSE \ / \ 1980 \ FSL \ / \ 1980 \ FEL \ / \ TWSP: 24S \ / \ SECTION: \ / \ LAT: 0.0 \ / \ LONG: 0.0 \ ( \ TVD: 0 \ feet, \ MD: 0 \ feet ) \\$ 

# PA PREP WORK PROCEDURE

The subject well might be pre-plugged prior to PA rig operations. The plugging rig will come in within 90 days of equipment removal to begin plugging this well.

## Prep rig steps

- 1. Notify BLM or OCD prior to rig up.
- 2. MIRU prep rig. Prep equipment to pull pump/rods in the hole (if well has rods).
- 3. LD rods and pump, switchover to pull tbg.
- 4. ND wellhead & NU BOP.
- 5. POOH and LD tbg & BHA.
- 6. RU WL unit. Run and set CIBP.
- 7. If required, run CBL from top of plug to surface and submit to OCD
- 8. RD wireline unit.
- 9. Dump bail cmt as needed on top of CIBP.
- 10. Tag TOC & ensure well control steps followed below prior to rig off.

# Well control precautions

- 1. Run official MIT test to ensure pressure holds after CIBP is set.
- 2. Ensure well control prior to rig off by tagging TOC on top of CIBP.
- 3. NU WH flange and ensure all valves are closed when moving prep rig off location, no WS tubing left in hole.

OXY USA INC.

FEDERAL CR 8 001

30-025-27351

NOI TO PERMANENTLY ABANDON THIS WELL VIA CEMENT PLUGGING.

# PROPOSED PLUGGING PROCEDURE

- 1. POOH WITH CURRENT 2 3/8" TBG STRING WITH PACKER SET AT 13945'
- 2. RIH WITH WORKSTRING AND CIBP, SET AT 13950'. PRESSURE TEST AT 500 PSI FOR 30 MINUTES
- 3. SPOT 30 SX OF CL H CMT FROM 13950' TO 13590'. WOC AND TAG.
- 4. SPOT 25 SX OF CL H CMT FROM 12750' TO 12450'. WOC AND TAG.
- 5. SPOT 51 SX OF CL H CMT FROM 12078' TO 11600'. WOC AND TAG.
- 6. SPOT 191 SX OF CL H CMT FROM 9100' TO 8000'. WOC AND TAG.
- 7. SPOT 54 SX OF CL C CMT FROM 5600' TO 5290'. WOC AND TAG.
- 8. SPOT 25 SX OF CL C CMT FROM 2850' TO 2700'. WOC AND TAG.
- 9. SPOT 35 SX OF CL C CMT FROM 1000' TO 800'. WOC AND TAG.
- 10. PERF AND CIRC 367 SX OF CL C CMT FROM 800' TO SURFACE. VERIFY CMT TO SURFACE.

### **FORMATION TOPS**

INITIAL POTENTIAL  ZND PT CK 7.5/64 2ND PT TEST IN 45 MINS 4TH PT CK 11.5/64  NATURAL  TYPE FORMATION LTH TOP DEPTH/SUB BSE DEPTH/SUB  LOG DELWR SD 5340 -1922 LOG BONE SPG 9050 -5632 LOG WOLFCAMP 12028 -8610 LOG STRAWN 12552 -9134 LOG ATOKA 12682 -9264 LOG MORROW 13740 -10322  37. SUMMARY OF POROLS ZONES: SHOW ALL INDUSTRAY ZONES OF POROSITY AND CONTENTS THERROF; CORED INTERVALS; AND ALL DRILL-ATEM TO PORT OF THE TOOL OF EN, PLOWING AND BHILT-IN PRESSURES, AND RECOVERIES  STRAWN 12552 12682 Atoka 12682 13740 MORROW 13740 14552 Sandstone & Shale  Morrow 13740 14552 Sandstone & Shale  Sandstone & Shale  Sandstone & Shale					
2ND PT CK 7.5/64 2ND PT TEST IN 45 MINS 4TH PT CK 11.5/64 NATURAL  TYPE FORMATION LTH TOP DEPTH/SUB BSE DEPTH/SUB  LOG DELWR SD 5340 -1922 LOG BONE SPG 9050 -5632 LOG WOLFCAMP 12028 -8610 LOG STRAWN 12552 -9134 LOG ATOKA 12682 -9264 LOG MORROW 13740 -10322  37. SUMMARY OF POROLS ZONES: SHOW ALL IMPORTANT ZONES OF POROSITY AND CONTENTS THEREOF: CORED INTERVALS; AND ALL DRILL-STEM TO FORMATION TOP BOTTOM DESCRIPTION, CONTENTS, ETC.  Strawn 12552 12682 Limestone and shale Atoka 12682 13740 Shale, Limestone and sanders	i	FEDERAL	"CR-8"	D	DG
TYPE FORMATION LTH TOP DEPTH/SUB BSE DEPTH/SUB  LOG DELWR SD 5340 -1922 LOG BONE SPG 9050 -5632 LOG WOLFCAMP 12028 -8610 LOG STRAWN 12552 -9134 LOG ATOKA 12682 -9264 LOG MORROW 13740 -10322  37. SUMMARY OF PORGUS ZONES: SHOW ALL IMPORTANT ZONES OF PORGSITY AED CONTENTS THEREOF: CORED INTERVALS; AND ALL DRILL-STEM TO DEFETH INTERVAL TESTED, CHISHION LINED, TIME TOOL OVEN, PLOWING AND SHUT-IN PRESSURES, AND RECOVERER STEWN 12552 12682  Strawn 12552 12682 Limestone and shale Morrow 13740 Shale, Limestone and sanders.	2ND PT TEST IN	64 1 45 MINS	TIAL POTEN	TIAL	
LOG DELWR SD 5340 -1922 LOG BONE SPG 9050 -5632 LOG WOLFCAMP 12028 -8610 LOG STRAWN 12552 -9134 LOG ATOKA 12682 -9264 LOG MORROW 13740 -10322  37. SUMMARY OF POROUS ZONES: SHOW ALL IMPORTANT ZONES OF FOROSITY AND CONTENTS THEREOF: CORED INTERVALS; AND ALL DRILL-STEM TO DETECT IN FLEXYL. TENSED, CORNING INSECURITIES TO DESCRIPTION, CONTENTS, ETC.  Strawn 12552 12682 Limestone and shale Morrow 13740 Shale, Limestone and sandates.	NATURAL		DEPTH/SUB	BSE DEPTH/SUR	
37. SUMMARY OF POROLS ZONES: SHOW ALL IMPORTANT ZONES OF POROSITY AND CONTENTS THEREOF: CORED INTERVALS; AND ALL DRILL-STEM TO DESCRIPTION TOP BOTTOM DESCRIPTION, CONTENTS, ETC.  Strawn 12552 12682 Limestone and shale Atoka 12682 13740 Shale, Limestone and sanders.	LOG DELWR SD LOG BONE SPG LOG WOLFCAMP LOG STRAWN LOG ATOKA	5340 9050 12028 12552 12682	-1922 -5632 -8610 -9134 -9264		
Strawn	37. SUMMARY OF PO SHOW ALL IMPR DEETH INTERVA	ROUS ZONES:	DROSITY AND CONTE	NTS THEREOF; CORED INTE	PVALO
Strawn	FORMATION	ТОР	HOTTOM		
	Strawn Atoka	12552 12682	12682 13740	Limestone ar	nd shale


# **CURRENT WELLBORE**

API#: 3002527351 Lease Name: FEDERAL CR 8

Well No: 1



**Current Wellbore** 

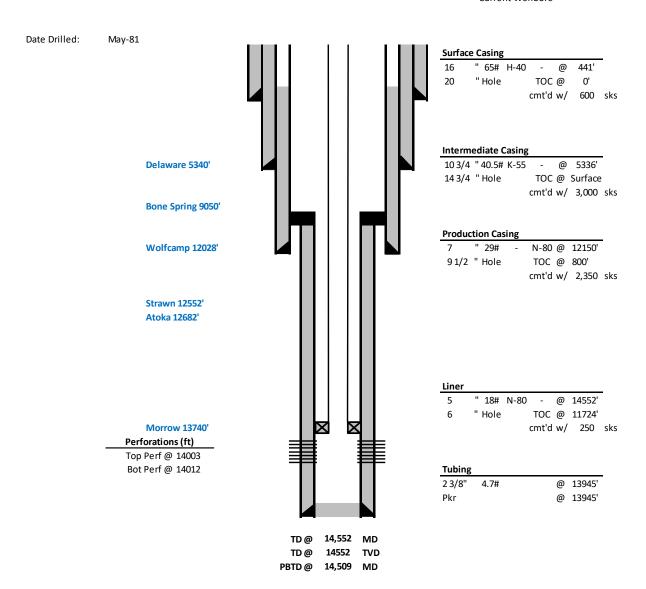


### PROPOSED WELLBORE

API#: 3002527351 Lease Name: FEDERAL CR 8

Well No: 1



Current Wellbore

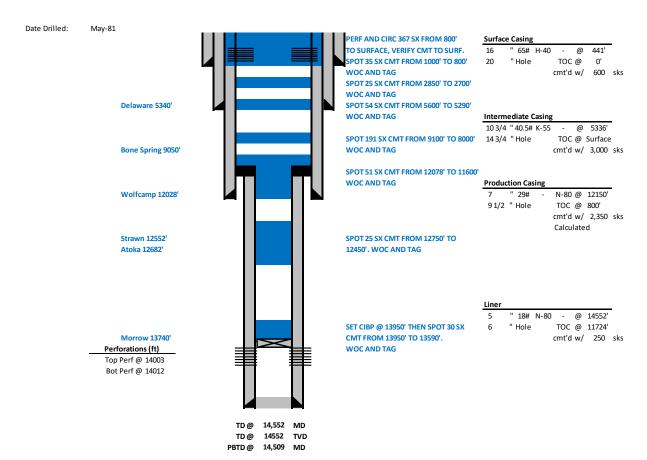

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report

Well Name: FEDERAL CR 8

Well Location: T24S / R35E / SEC 8 /

NWSE / 32.2302355 / -103.3873908

County or Parish/State: LEA /

NM

Well Number: 01

Type of Well: CONVENTIONAL GAS

WELL

Allottee or Tribe Name:

Unit or CA Name: FEDERAL CR 8

Unit or CA Number:

NMNM72184

US Well Number: 3002527351

Lease Number: NMNM01228

Operator: OXY USA INCORPORATED

### **Notice of Intent**

Sundry ID: 2815838

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 10/08/2024

Time Sundry Submitted: 06:56

Date proposed operation will begin: 11/08/2024

Procedure Description: OXY PROPOSES TO PA THE SUBJECT WELL. A PA PREP RIG PROCEDURE IS ATTACHED AND MIGHT BE EXECUTED BEFORE THE PA RIG PLUGS OUT THE WELLBORE. THE CURRENT WELLBORE, PROPOSED WELLBORE, AND PA PROCEDURE ARE ATTACHED.

# **Surface Disturbance**

Is any additional surface disturbance proposed?: No

# **NOI Attachments**

**Procedure Description** 

FEDERAL\_CR\_8\_001\_PA\_NOI\_SUB\_10.8.2024\_20241008065627.pdf

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND SPECIAL STIPULATIONS ATTACHED Well Name: FEDERAL CR 8 Well Location: T24S / R35E / SEC 8 /

NWSE / 32.2302355 / -103.3873908

County or Parish/State: LEA / NM

Well Number: 01

Type of Well: CONVENTIONAL GAS

WELL

Unit or CA Name: FEDERAL CR 8

Allottee or Tribe Name:

Unit or CA Number:

NMNM72184

US Well Number: 3002527351

Lease Number: NMNM01228

Operator: OXY USA INCORPORATED

# Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: STEPHEN JANACEK Signed on: OCT 08, 2024 06:56 AM

Name: OXY USA INCORPORATED

Title: Regulatory Engineer

Street Address: 5 Greenway Plaza, Suite 110
City: Houston State: TX

Phone: (713) 497-2417

Email address: stephen\_janacek@oxy.com

### Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

# UNITED STATES

Form 3160-5 (June 2019)  UNITED STATES  DEPARTMENT OF THE INTERIOR  BUREAU OF LAND MANAGEMENT				,	5 1 00	se Serial No.	FORM APPROVED OMB No. 1004-0137 Expires: October 31, 2021			
SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter a  abandoned well. Use Form 3160-3 (APD) for such proposa					6. If I	NMNM01228  6. If Indian, Allottee or Tribe Name				
avaire		TRIPLICATE - Other instr				Jnit of CA/Agreemer	nt Name and/or No			
1. Type of Well	JODINIT IN	I RIPLICATE - Other Instr	uctions on pag	ge 2		RAL CR 8/NMNM72184	a, Name aldroi ivo.			
Oil We	Invested .				FEDER	II Name and No. ALCR 8/01				
2. Name of Operator	OXY USA INCC	RPORATED			9. API	Well No. 3002527	351			
3a. Address P.O. BOX 1002, TUPMAN, CA 93276-1002 3b. Phone No. (661) 763-60					code) 10. Fi	eld and Pool or Explo				
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) SEC 8/T24S/R35E/NMP						ountry or Parish, State				
	12. CHE	CK THE APPROPRIATE B	OX(ES) TO IN	DICATE NAT	TURE OF NOT	TCE, REPORT OR (	OTHER DATA			
TYPE OF SUB	MISSION				TYPE OF AC	TION				
✓ Notice of Inten	t	Acidize Alter Casing	Deep	en raulic Fractur	Pro	duction (Start/Resum	processed			
Subsequent Re	port	Casing Repair		Construction		omplete	Well Integrity Other			
Subsequent Re	port	Change Plans	processes	and Abandon	- Contracting	porarily Abandon	Ouler			
Final Abandon	ment Notice	Convert to Injection	Entertained.	Back	-	er Disposal				
is ready for final in OXY PROPOS THE PA RIG P ATTACHED.	RES TO PA THE	SUBJECT WELL. A PA I	all requirement	s, including r	eclamation, hav	ve been completed an  D AND MIGHT BE	a 3160-4 must be filed once testing has been all the operator has detennined that the site EXECUTED BEFORE PROCEDURE ARE			
STEPHEN JANACE		true and correct. Name (Printer) Name (Printer) Name (Printer)	nted Typed)	Regul Title	atory Engine	er				
Signature (Electi	ronic Submissio	n)		Date		10/08	7/2024			
		THE SPACE	FOR FEDI	ERAL OR	STATE OF	ICE USE				
Conditions of approval	V <sub>o</sub>	ed. Approval of this notice d	loes not warrant	Title	Petroleum	, Engineer	Date 11/4/2014			
which would entitle the	at holds legal or ea applicant to conc	quitable title to those rights i luct operations thereon.	n the subject lea	ose Office	CFO					
Fitle 18 U.S.C Section my false, fictitious or fi	1001 and Title 43 raudulent stateme	U.S.C Section 1212, make ints or representations as to a	it a crime for an my matter withi	y person kno n its jurisdict	wingly and will on.	Ifully to make to any	department or agency of the United States			

(Instructions on page 2)

# **GENERAL INSTRUCTIONS**

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

# SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

### **NOTICES**

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

# **Additional Information**

# **Location of Well**

 $0. \ SHL: \ NWSE \ / \ 1980 \ FSL \ / \ 1980 \ FEL \ / \ TWSP: \ 24S \ / \ RANGE: \ 35E \ / \ SECTION: \ 8 \ / \ LAT: \ 32.2302355 \ / \ LONG: \ -103.3873908 \ (\ TVD: \ 0 \ feet, \ MD: \ MD$ 

# PA PREP WORK PROCEDURE

The subject well might be pre-plugged prior to PA rig operations. The plugging rig will come in within 90 days of equipment removal to begin plugging this well.

### Prep rig steps

- 1. Notify BLM or OCD prior to rig up.
- 2. MIRU prep rig. Prep equipment to pull pump/rods in the hole (if well has rods).
- 3. LD rods and pump, switchover to pull tbg.
- 4. ND wellhead & NU BOP.
- 5. POOH and LD tbg & BHA.
- 6. RU WL unit. Run and set CIBP.
- 7. If required, run CBL from top of plug to surface and submit to OCD
- 8. RD wireline unit.
- 9. Dump bail cmt as needed on top of CIBP.
- 10. Tag TOC & ensure well control steps followed below prior to rig off.

# Well control precautions

- 1. Run official MIT test to ensure pressure holds after CIBP is set.
- 2. Ensure well control prior to rig off by tagging TOC on top of CIBP.
- 3. NU WH flange and ensure all valves are closed when moving prep rig off location, no WS tubing left in hole.

OXY USA INC.

FEDERAL CR 8 001

30-025-27351

NOI TO PERMANENTLY ABANDON THIS WELL VIA CEMENT PLUGGING.

# PROPOSED PLUGGING PROCEDURE

- 1. POOH WITH CURRENT 2 3/8" TBG STRING WITH PACKER SET AT 13945'
- 2. RIH WITH WORKSTRING AND CIBP, SET AT 13950'. PRESSURE TEST AT 500 PSI FOR 30 MINUTES
- 3. SPOT 30 SX OF CL H CMT FROM 13950' TO 13590'. WOC AND TAG. 38 5x5 (13 450' to 13552)
- 4. SPOT 25 SX OF CL H CMT FROM 12750' TO 12450'. WOC AND TAG. 130 5X5 (12732' to 11556')
- 5. SPOT 51 SX OF CLH CMT FROM 12078' TO 11600'. WOC AND TAG.
- 6. SPOT 191 SX OF CL H CMT FROM 9100' TO 8000'. WOC AND TAG. 2.17 55
- 7. SPOT 54 SX OF CL C CMT FROM 5600' TO 5290'. WOC AND TAG. (53 86' +6 5232')
- 8. SPOT 25 SX OF CL C CMT FROM 2850' TO 2700'. WOC AND TAG.
- 9. SPOT 35 SX OF CL C CMT FROM 1000' TO 800'. WOC AND TAG.
- 10. PERF AND CIRC 367 SX OF CL C CMT FROM 800' TO SURFACE. VERIFY CMT TO SURFACE.

Spot 25 sxs class C from 4886' to 4737'. WOC &TAGE.

# **FORMATION TOPS**

INITIAL POTENTIAL

2ND PT CK 7.5/64
2ND PT TEST IN 45 MINS
4TH PT CK 11.5/64
NATURAL

TYPE FORMATION LTH TOP DEPTH/SUB BSE DEPTH/SUB
LOG DELWR SD 5340 -1922
LOG BONE SPG 9050 -5632
LOG WOLFCAMP 12028 -8610
LOG STRAWN 12552 -9134
LOG ATOKA 12682 -9264
LOG MORROW 13740 -10322

ST. SUMMARY OF 1 SHOW ALL IS DESTRIBUTED FORMATION  Strawn	YAL TESTED, COSHIOS	Chosity And Continue to the first to the fir	PTS THEREOF; CORED INTERVALS; AND ALL DEBLI-STEM TEXTS, I THEN, FLOWING AND SHIET-IN PRESSURES, AND RECOVERIES DESCRIPTION, CONTONTS, STC.
Atoka Morrow	12552 12682 13740	12682 13740 14552	Limestone and shale Shale, Limestone and sandstone Sandstone & shale

# **CURRENT WELLBORE**

API#: Lease Name:


3002527351 FEDERAL CR 8

Well No:

1



Current Wellbore

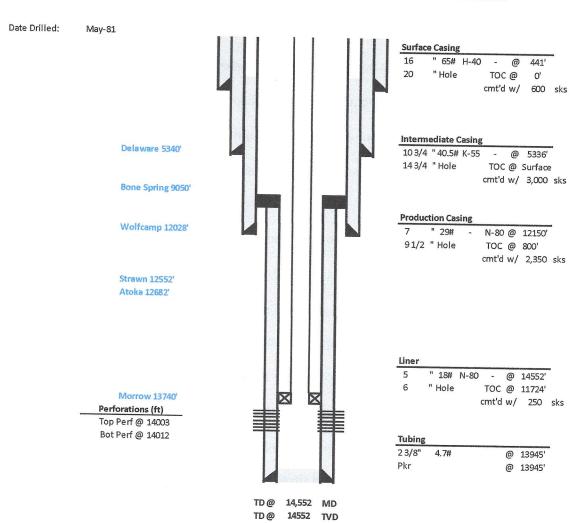


PBTD@ 14,509 MD

# **PROPOSED WELLBORE**

API#: Lease Name: 3002527351 FEDERALCR 8

Well No:

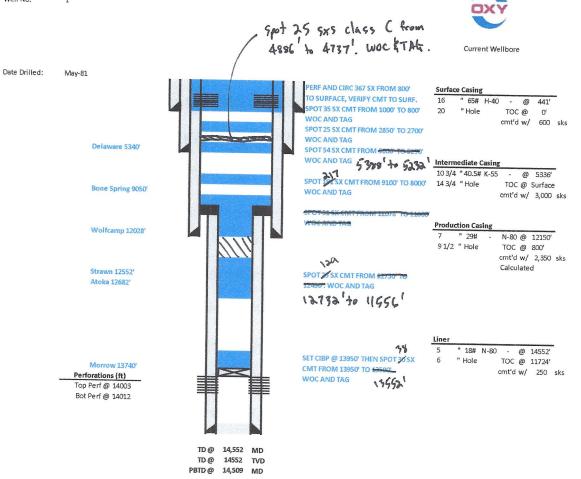

# BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

# Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a

bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified BY PHONE (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing. The following information shall be permanently inscribed on the plate: well name and number, name of operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

# Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



# **United States Department of the Interior**

### BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

### **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well abandonment.
- The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry

Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos

Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Doris Lauger Martinez Environmental Protection Specialist 575-234-5926

Jaden Johnston Environmental Protection Asst. (Intern) 575-234-6252

Sundry ID	2815838						
Plug Type	Тор	Bottom	Length	Tag	Sacks	Cement Class	Notes
Surface Plug	0.00	100.00	100.00	Tag/Verify			
Surface Flug	0.00	100.00	100.00	rag/verily			Perf and squeeze
							from 800' to surface.
							(In 127 sxs/Out 172
16 inch- Shoe Plug Top of Salt @ 1393	386.59 1329.07	491.00 1443.00	104.41	Tag/Verify Tag/Verify	299.00	С	sxs)
Top of Sait @ 1393	1329.07	1443.00	113.93	rag/verily			
				If solid			
				base no need to			
				Tag			
				(CIBP			
				present			
				and/or Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak Test all			
				CIBP if no			
				Open			
Smanar Blum @ 2000	2722.00	2050.00		Perforatio	25.00	0	Spot cement from
Spacer Plug @ 2800	2722.00	2850.00	128.00	ns	25.00	C	2850' to 2722'. Spot cement from
							4886' to 4737'.
Base of Salt @ 4836	4737.64	4886.00	148.36	Tag/Verify	25.00	С	WOC and Tag.
							0
							Spot cement from 5388' to 5232'.
10.75 inch- Shoe Plug	5232.64	5386.00	153.36	Tag/Verify	25.00	С	WOC and Tag.

	<del>                                     </del>					1	1
				If solid			
				base no			
				need to			
				Tag			
				(CIBP			
				present			
				and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak			
				Test all			
				CIBP if no			
				Open			
				Perforatio			Spot cement from
Delaware @ 5338	5234.62	5388.00	153.38	ns	217.00	Н	9100' to 8000'.
Bonesprings @ 8846	8000.00		1100.00			-	
Liner Top @ 11724	11556.76		217.24				
Wolfcamp @ 11855	11686.45	11905.00	218.55				
7 inch- Shoe Plug	11978.50	12200.00	221.50	Tag/Verify			
				base no			
				need to			
Strawn @ 12552	12376.48	12602.00	225.52				
0.1.4.11 @ 1.2002	12070.10	12002.00	220.02	9			
				If solid			
				base no			
				need to			
				Tag			
				(CIBP			
				present			
				and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak			
				Test all			
				CIBP if no			
				Open			Spot cement from
				Perforatio			12732' to 11556'.
Atoka @ 12682	12505.18	12732.00	226.82	ns	129.00	Н	WOC and Tag.
Morrow @ 13740	13552.60		237.40				Ĭ
Perforations Plug (If No CIBP)	13821.88	14062.00		Tag/Verify			
i chichane i hag (ii the chizi )	10021100		2.02				
				If solid			
				base no			
				need to			
				Tag			
				(CIBP			
				present			
				and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak			
				Tag, Leak Test all			
							C-+ OIDD -+ 100501
				CIBP if no			Set CIBP at 13950'.
				Open			Spot cement from
				Perforatio			13950' to 13552'.
CIBP Plug	13915.00		35.00	ns	38.00	Н	Leak test CIBP.
5 inch- Shoe Plug	14356.48	14602.00	245.52	Tag/Verify			

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole. Class H >7500' Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement Requirement:	<u>Low</u>		
16 inch- Shoe Plug @ 10.75 inch- Shoe Plug @ 7 inch- Shoe Plug @ 5 inch- Shoe Plug @	441.00 5336.00 12150.00 14552.00	тос @ тос @	800.00 11724.00
Perforatons Top @	14003.00	Perforations	14012.00

CIBP @ 13950.00

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

# State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 401429

### **CONDITIONS**

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	401429
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

### CONDITIONS

Created By	Condition	Condition Date
gcordero	Run CBL from 13950' to surface	11/19/2024
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	11/19/2024
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	11/19/2024