

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Well Number: 601H

Sundry Print Repor

Well Name: BASEBALL CAP Well Location: T24S / R34E / SEC 25 / County or Parish/State: LEA /

FEDERAL COM SESE / 32.182232 / -103.418678

Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMNM123530 Unit or CA Name: BASEBALL CAP FED **Unit or CA Number:** 

COM #601H

NMNM140180

**US Well Number: 3002545783 Operator: COG OPERATING LLC** 

# **Notice of Intent**

**Sundry ID: 2820845** 

Type of Submission: Notice of Intent Type of Action: Plug and Abandonment

Date Sundry Submitted: 11/05/2024 Time Sundry Submitted: 10:22

Date proposed operation will begin: 12/05/2024

Procedure Description: 1. Hold Pre job meeting, comply with all NMOCD, BLM and environmental regulations. 2. MIRU P&A rig and equipment. 3. Check and record casing and bradenhead pressures. 4. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum. 5. ND WH, NU BOP, function test BOP. 6. RIH & tag TOF @ 1569'. POH. 7. Set 5 1/2" CIBP and set at 1568'. POH. 8. MIRU logging truck. Run CBL from 1568' to surface. Hold 600 psi on casing if possible. NOTE: Results of CBL may change the following plugs. Electronic copy of CBL to be sent to BLM Representative. 9. RIH with tubing work string. Drop ball valve down tubing and pressure test to 1000#. Pressure test casing to 500#. If casing does not test, then discuss with Regulatory for procedure change. 10. Plug 1: CIBP and B/Salt, 13 3/8" Shoe, & T/Salt formations: With CIBP @ 1568' mix and pump 75 sxs Class C cement from 1568' to 858'. WOC & Tag. If cement is 858' or above, continue to next step. If cement is lower than 858', contact BLM for procedure change. 11. Plug #2: Surface plug: Mix & pump 25 sx Class C cement plug from 200' and circulate good cement out casing. 14. RD cementing equipment. Cut off wellhead, fill any exposed annulus with cement, as necessary. Install DHM. 15. Record GPS coordinates for P&A marker and the Final P&A Report. Photograph the P&A marker and attach to the report. 16. Top off casings and cellar with cement as required. 17. RD and MO all rig and cement equipment. Assure that location is free of trash before moving off. 18. Send all reports and attachments to be uploaded to NMOCD website within 30 days of completion.

Page 1 of 3

FEDERAL COM

Well Location: T24S / R34E / SEC 25 / SESE / 32.182232 / -103.418678

County or Parish/State: LEA/ 2 of

Well Number: 601H

Type of Well: OIL WELL

**Allottee or Tribe Name:** 

Lease Number: NMNM123530

Unit or CA Name: BASEBALL CAP FED Unit or CA Number:

COM #601H

NMNM140180

**US Well Number: 3002545783** 

**Operator: COG OPERATING LLC** 

# **Surface Disturbance**

Is any additional surface disturbance proposed?: No

## **NOI Attachments**

#### **Procedure Description**

Baseball\_Cap\_Federal\_Com\_601H\_Proposed\_NOI\_20241105101905.pdf

# **Conditions of Approval**

### **Specialist Review**

2820845\_\_\_BASEBALL\_CAP\_FED\_COM\_601H\_Procedures\_and\_COAs\_20241217111344.pdf

# **Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

**Operator Electronic Signature: RUTH SHOCKENCY** Signed on: NOV 05, 2024 10:20 AM

Name: COG OPERATING LLC

Title: Regulatory Analyst

Street Address: 600 W. ILLINOIS AVE.

City: MIDLAND State: TX

Phone: (575) 703-8321

Email address: RUTH.SHOCKENCY@CONOCOPHILLIPS.COM

### **Field**

**Representative Name:** 

**Street Address:** 

State: City: Zip:

Phone:

**Email address:** 

Page 2 of 3

eived by OCD: 12/17/2024 1:57:39 PM Well Name: BASEBALL CAP

FEDERAL COM

Well Location: T24S / R34E / SEC 25 / SESE / 32.182232 / -103.418678

County or Parish/State: LEA

Well Number: 601H

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM123530

Unit or CA Name: BASEBALL CAP FED Unit or CA Number:

COM #601H

NMNM140180

**US Well Number: 3002545783** 

**Operator: COG OPERATING LLC** 

# **BLM Point of Contact**

**BLM POC Name: JULIO A SANCHEZ BLM POC Title: ENGINEER** 

**BLM POC Phone:** 5752342240 BLM POC Email Address: JULIOSANCHEZ@BLM.GOV

Disposition Date: 12/17/2024

Signature: Julio Sanchez

**Disposition:** Approved

Form 3160-5 (June 2019)

# UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED
OMB No. 1004-0137
Expires: October 31, 202

BURE	EAU OF LAND MANAGEMENT		5. Lease Serial No.		
SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.			6. If Indian, Allottee or Tribe Name		
	RIPLICATE - Other instructions on pag	7. If Unit of CA/Agreement, 1	7. If Unit of CA/Agreement, Name and/or No.		
1. Type of Well  Oil Well  Gas W	ell Other		8. Well Name and No.		
2. Name of Operator			9. API Well No.		
3a. Address	3b. Phone No.	(include area code)	10. Field and Pool or Explora	tory Area	
4. Location of Well (Footage, Sec., T.,R.	,M., or Survey Description)		11. Country or Parish, State		
12. CHEC	CK THE APPROPRIATE BOX(ES) TO INI	DICATE NATURE (	OF NOTICE, REPORT OR OT	HER DATA	
TYPE OF SUBMISSION		TYPI	E OF ACTION		
Notice of Intent	Acidize Deep Alter Casing Hydr	en aulic Fracturing	Production (Start/Resume)  Reclamation	Water Shut-Off Well Integrity	
Subsequent Report		Construction	Recomplete	Other	
		and Abandon	Temporarily Abandon		
Final Abandonment Notice	Convert to Injection Plug peration: Clearly state all pertinent details, i	<u>.</u>	Water Disposal		
is ready for final inspection.)					
4. I hereby certify that the foregoing is	true and correct. Name (Printed/Typed)	T. 4			
		Title			
Signature		Date			
	THE SPACE FOR FEDI	ERAL OR STA	TE OFICE USE		
Approved by					
		Title		Date	
	ed. Approval of this notice does not warran quitable title to those rights in the subject leduct operations thereon.				
Title 18 U.S.C Section 1001 and Title 43	U.S.C Section 1212, make it a crime for ar	y person knowingly	and willfully to make to any d	epartment or agency of the United States	

any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

#### **GENERAL INSTRUCTIONS**

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

#### SPECIFIC INSTRUCTIONS

*Item 4* - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

#### **NOTICES**

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

**BURDEN HOURS STATEMENT:** Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

(Form 3160-5, page 2)

#### **Additional Information**

#### **Additional Remarks**

10. Plug 1: CIBP and B/Salt, 13 3/8 Shoe, & T/Salt formations: With CIBP @ 1568 mix and pump 75 sxs Class C cement from 1568 to 858. WOC & Tag. If cement is 858 or above, continue to next step. If cement is lower than 858, contact BLM for procedure change.

- 11. Plug #2: Surface plug: Mix & pump 25 sx Class C cement plug from 200 and circulate good cement out casing.
- 14. RD cementing equipment. Cut off wellhead, fill any exposed annulus with cement, as necessary. Install DHM.
- 15. Record GPS coordinates for P&A marker and the Final P&A Report. Photograph the P&A marker and attach to the report,
- 16. Top off casings and cellar with cement as required.
- 17. RD and MO all rig and cement equipment. Assure that location is free of trash before moving off.
- 18. Send all reports and attachments to be uploaded to NMOCD website within 30 days of completion.

#### **Location of Well**

0. SHL: SESE / 430 FSL / 1080 FEL / TWSP: 24S / RANGE: 34E / SECTION: 25 / LAT: 32.182232 / LONG: -103.418678 ( TVD: 0 feet, MD: 0 feet ) PPP: SESE / 0 FSL / 760 FEL / TWSP: 24S / RANGE: 34E / SECTION: 24 / LAT: 32.195747 / LONG: -103.417633 ( TVD: 12525 feet, MD: 17600 feet ) PPP: SESE / 330 FSL / 760 FEL / TWSP: 24S / RANGE: 34E / SECTION: 25 / LAT: 32.18186 / LONG: -103.417646 ( TVD: 12642 feet, MD: 13000 feet ) BHL: NENE / 200 FNL / 760 FEL / TWSP: 24S / RANGE: 34E / SECTION: 24 / LAT: 32.209718 / LONG: -103.41762 ( TVD: 12642 feet, MD: 22656 feet )

(June 2015)

## **UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB No. 1004-0137

I	Expires: January 31, 20
5. Lease Serial No.	NMNM123530

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an

INIVII	NW 123530
6. If Indian, Allottee or T	ribe Name

abandoned well. (	Use Form 3160-3 (A	PD) for such p	roposals.		
SUBMITIN	TRIPLICATE - Other instru	7. If Unit of CA/Agree	ment, Name and/or No.		
1. Type of Well  ✓ Oil Well  Gas V	Vell Other		8. Well Name and No.  Baseball Cap Federal Com #601H		
2. Name of Operator COG Operating	, LLC			9. API Well No. 30-02	5-45783
3a. Address 600 W Illinois Midland T		3b. Phone No. <i>(inclu</i> ) (432) 683-7443	de area code)	10. Field and Pool or E	
4. Location of Well (Footage, Sec., T.,F 430 FSL & 1080 FEL Se	R.,M., or Survey Description) ac 25-24S-34E	11. Country or Parish, S Lea County, NM	State		
12. CHE	CK THE APPROPRIATE B	OX(ES) TO INDICA	ΓE NATURE OF N	OTICE, REPORT OR OTH	ER DATA
TYPE OF SUBMISSION			TYPE OF	ACTION	
TYPE OF SUBMISSION  Acidize Deepen Production (Start/Resume) Mater Shut-Off Alter Casing Hydraulic Fracturing Reclamation Well Integrity Casing Repair Change Plans Plug and Abandon Temporarily Abandon Tempo					
4. I hereby certify that the foregoing is	true and correct. Name (Pri	inted/Typed) Title	:		
Signature Date					
	THE SPACE	FOR FEDERA	L OR STATE	OFICE USE	
Approved by			Title	D	ate
Conditions of approval, if any, are attace certify that the applicant holds legal or which would entitle the applicant to cor	equitable title to those rights		Office		
Fitle 18 U.S.C Section 1001 and Title 4 any false, fictitious or fraudulent statement				willfully to make to any dep	partment or agency of the United States

(Instructions on page 2)


# Proposed P&A NOI ConocoPhillips/COG Operating Baseball Cap Federal Com #601H 30-025-45783

Note: All cement is to be Class C mixed at 14.8 ppg, yield 1.32 cu ft / sx. Cement volumes are based on inside capacities + 50' excess and outside capacities + 100% excess.

- 1. Hold Pre job meeting, comply with all NMOCD, BLM and environmental regulations.
- 2. MIRU P&A rig and equipment.
- 3. Check and record casing and bradenhead pressures.
- 4. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.
- 5. ND WH, NU BOP, function test BOP.
- 6. RIH & tag TOF @ 1569'. POH.
- 7. Set 5 1/2" CIBP and set at 1568'. POH.
- 8. MIRU logging truck. Run CBL from 1568' to surface. Hold 600 psi on casing if possible. NOTE: Results of CBL may change the following plugs. Electronic copy of CBL to be sent to BLM Representative.
- 9. RIH with tubing work string. Drop ball valve down tubing and pressure test to 1000#. Pressure test casing to 500#. If casing does not test, then discuss with Regulatory for procedure change.
- 10. Plug 1: CIBP and B/Salt, 13 3/8" Shoe, & T/Salt formations: With CIBP @ 1568' mix and pump 75 sxs Class C cement from 1568' to 858'. WOC & Tag. If cement is 858' or above, continue to next step. If cement is lower than 858', contact BLM for procedure change.
- 11. Plug #2: Surface plug: Mix & pump 25 sx Class C cement plug from 200' and circulate good cement out casing.
- 14. RD cementing equipment. Cut off wellhead, fill any exposed annulus with cement, as necessary. Install DHM.
- 15. Record GPS coordinates for P&A marker and the Final P&A Report. Photograph the P&A marker and attach to the report.
- 16. Top off casings and cellar with cement as required.
- 17. RD and MO all rig and cement equipment. Assure that location is free of trash before moving off.
- 18. Send all reports and attachments to be uploaded to NMOCD website within 30 days of completion.


ConocoPhi	llips	PROPOSED		
Author:	Abby @ JMR			
Well Name	Baseball Cap Fed Com	Well No.	601H	
Field/Zone	Wildcat/Bone Spring	API#:	30-025-45783	
County	Lea	Location	430' FSL &1080' FEL	
State	NM		Sec 25, T24S R34E	
Spud Date	6/28/2019	GL/KB:	3,377/3,407	
			•	

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx circ	TOC
Surface Csg	13.325	K55	54.5	1,297	17 1/2	241	Surf
Inter Csg	9.625	L80/P110	47	11,840	12 1/4	564	Surf
Prod Csg	5.5	P110	23	22,651	8 1/2	570	Surf

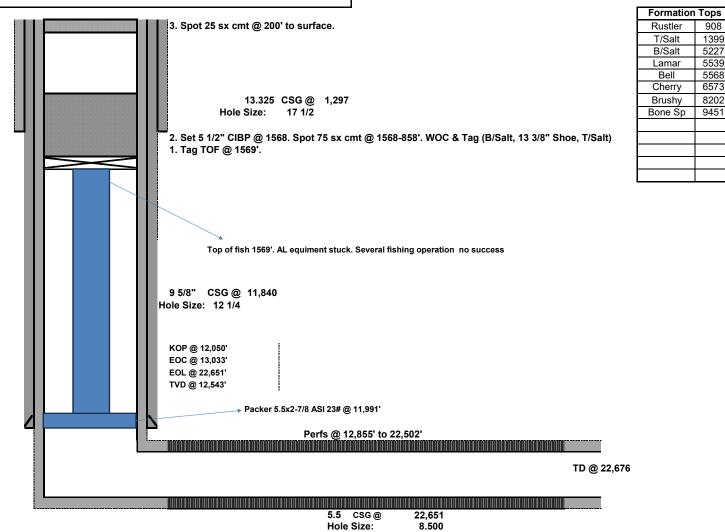

lips	CURRENT		
JJC			
Baseball Cap Fed Com	Well No.	601H	
Wildcat/Bone Spring	API #:	30-025-45783	
Lea	Location	430' FSL &1080' FEL	
NM		Sec 25, T24S R34E	
6/28/2019	GL/KB:	3,377/3,407	
	JJC Baseball Cap Fed Com Wildcat/Bone Spring Lea NM	Baseball Cap Fed Com Wildcat/Bone Spring Lea NM Well No. API #: Location	

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx circ	TOC
Surface Csg	13.325	K55	54.5	1,297	17 1/2	241	Surf
Inter Csg	9.625	L80/P110	47	11,840	12 1/4	564	Surf
Prod Csg	5.5	P110	23	22,651	8 1/2	570	Surf

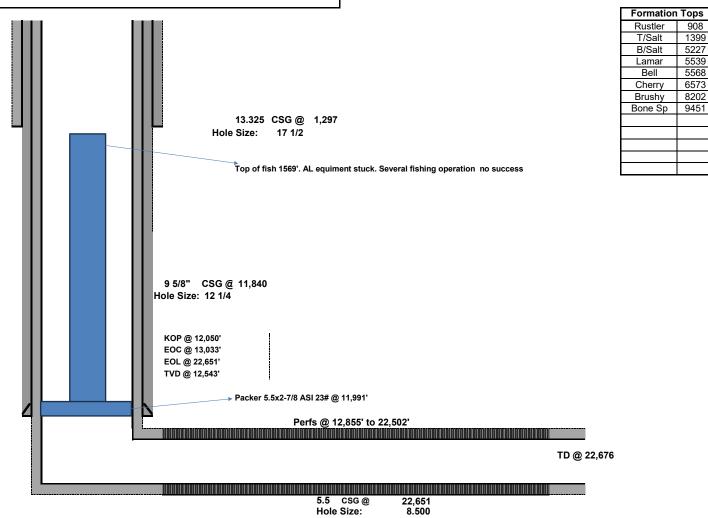

Received by OCD: 12/17/2024 1:57:39 PM Form 3160-5 UNITE

(June 2015)

# **UNITED STATES**

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT Expires: January 31, 2018

ORM APPROVED MB No. 1004-0137	Page 11 of 21
111111111111111111111111111111111111111	

# SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.	NMNM123530	
6. If Indian, Allottee	or Tribe Name	

	, . c. c. c. p	opocu.c.		
SUBMIT IN TRIPLICATE - Other instruction	7. If Unit of CA/Agreement	ent, Name and/or No.		
1. Type of Well  ✓ Oil Well Gas Well Other	8. Well Name and No. Baseball Cap Federal Com #601H			
2. Name of Operator COG Operating, LLC			9. API Well No. 30-025-	45783
3a. Address 600 W Illinois Midland TX 79701	. Phone No. <i>(include</i> 32) 683-7443		10. Field and Pool or Exp	
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description)			11. Country or Parish, Sta	ate
430 FSL & 1080 FEL Sec 25-24S-34E			Lea County, NM	
12. CHECK THE APPROPRIATE BOX	(ES) TO INDICATE	E NATURE OF NOTIO	CE, REPORT OR OTHER	R DATA
TYPE OF SUBMISSION		TYPE OF ACT	TION	
Notice of Intent Acidize Alter Casing	Deepen Hydraulic Fi		uction (Start/Resume)	Water Shut-Off Well Integrity
Subsequent Report Casing Repair	New Constru	_	mplete	Other
Final Abandonment Notice Convert to Injection	✓ Plug and Ab ☐ Plug Back	=	oorarily Abandon r Disposal	
	e see attached fo	r the proposed P&	·	operator has detennined that the site
14. I hereby certify that the foregoing is true and correct. Name (Printed	d/Typed)			
Signature				
THE SPACE F	OR FEDERAL	OR STATE OF	ICE USE	
Approved by	,	Title	Dat	e
Conditions of approval, if any, are attached. Approval of this notice doe certify that the applicant holds legal or equitable title to those rights in twhich would entitle the applicant to conduct operations thereon.	Office			
Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a any false, fictitious or fraudulent statements or representations as to any			fully to make to any depar	rtment or agency of the United States

(Instructions on page 2)


# Proposed P&A NOI ConocoPhillips/COG Operating Baseball Cap Federal Com #601H 30-025-45783

Note: Operator must attempt to get to bottom of hole to plug well properly. Cement volumes are based on inside capacities + 50' excess and outside capacities + 100% excess.

- 1. Hold Pre job meeting, comply with all NMOCD, BLM and environmental regulations.
- 2. MIRU P&A rig and equipment.
- 3. Check and record casing and bradenhead pressures.
- 4. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.
- 5. ND WH, NU BOP, function test BOP.
- 6. Set 5 1/2" CIBP and set at 12050'. 500psi 30min leak test POH.
- 7. MIRU logging truck. Run CBL from 12050' to surface. Hold 600 psi on casing if possible. NOTE: Results of CBL may change the following plugs. Electronic copy of CBL to be sent to BLM Representative.
- 8. RIH with tubing work string. Drop ball valve down tubing and pressure test to 1000#. Pressure test casing to 500#. If casing does not test, then discuss with Regulatory for procedure change.
- 9. Plug 1: CIBP and 9.625 shoe plug: With CIBP @ 12050' mix and pump Class H cement from 12050' to 11671'. WOC & Tag. If cement is 11671' or above, continue to next step. If cement is lower than 11671', contact BLM for procedure change.
- 10. Plug #2: Bone Springs Plug: Mix & pump Class H cement plug from 9501' to 9306' Balanced Plug
- 11. Plug #3: Spacer Plug: Mix & Pump Class C cement plug from 7497' to 7322' Balanced Plug
- 12. Plug #4: B/Salt, DV Tool, Delaware Plug: Mix & Plug Class C cement plug from 5589' to 5124' Balanced Plug
- 13. Plug #5: Spacer Plug: Mix & Pump Class C cement plug from 3336' to 3203' Balanced Plug
- 14. Plug #6: Top/Salt and 13.375 shoe plug: Mix & Pump Class C cement plug from 1449' to 1234' Balanced Plug
- 15. Plug #7: Surface plug: Mix & Perf and squeeze Class C cement plug from 100' to 0, Verify circulated to surface
- 16. RD cementing equipment. Cut off wellhead, fill any exposed annulus with cement, as necessary. Install DHM.
- 17. Record GPS coordinates for P&A marker and the Final P&A Report. Photograph the P&A marker and attach to the report.
- 18. Top off casings and cellar with cement as required.
- 19. RD and MO all rig and cement equipment. Assure that location is free of trash before moving off.
- 20. Send all reports and attachments to be uploaded to NMOCD website within 30 days of completion.


lips		CURRENT
JJC		
Baseball Cap Fed Com	Well No.	601H
Wildcat/Bone Spring	API #:	30-025-45783
Lea	Location	430' FSL &1080' FEL
NM		Sec 25, T24S R34E
6/28/2019	GL/KB:	3,377/3,407
	JJC Baseball Cap Fed Com Wildcat/Bone Spring Lea NM	Baseball Cap Fed Com Wildcat/Bone Spring Lea NM Well No. API #: Location

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx circ	TOC
Surface Csg	13.325	K55	54.5	1,297	17 1/2	241	Surf
Inter Csg	9.625	L80/P110	47	11,840	12 1/4	564	Surf
Prod Csg	5.5	P110	23	22,651	8 1/2	570	Surf

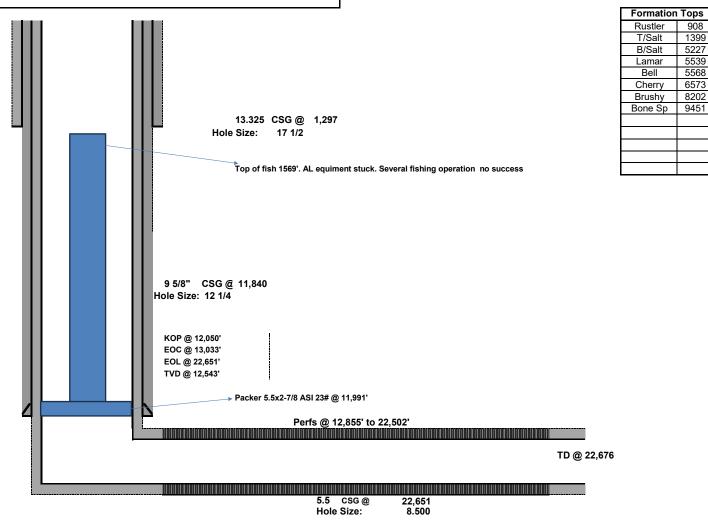

ConocoPhi	llips		PROPOSED
Author:	Abby @ JMR		
Well Name	Baseball Cap Fed Com	Well No.	601H
Field/Zone	Wildcat/Bone Spring	API#:	30-025-45783
County	Lea	Location	430' FSL &1080' FEL
State	NM		Sec 25, T24S R34E
Spud Date	6/28/2019	GL/KB:	3,377/3,407
			-

Description	O.D.	Grade	Weight	Depth	Hole Cmt Sx circ		TOC
Surface Csg	13.325	K55	54.5	1,297	17 1/2	241	Surf
Inter Csg	9.625	L80/P110	47	11,840	12 1/4	564	Surf
Prod Csg	5.5	P110	23	22,651	8 1/2	570	Surf

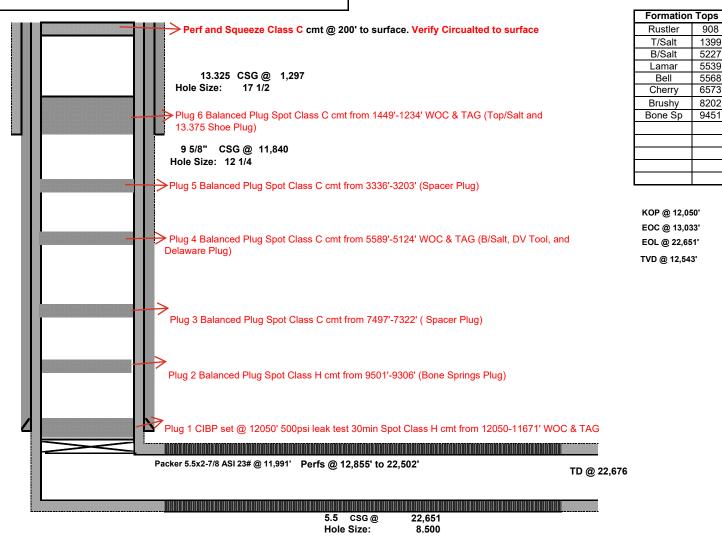

Sundry ID	2820845	

Juliu. y 12						
Diug Type	Ton	Bottom	Longth	Tog	Cement Class	Notes
Plug Type	Тор	BOLLOIII	Length	Tag	Class	Mores
				Verify		
				Circualted to	Class C	Perf and Squeeze
Surface Plug	0.00	200.00	200.00	surface		
13.375 inch- Shoe Plug	1234.00	1449.00	215.00	WOC & TAG	Close C	Polonged Dlug
Top of Salt @ 1399	1234.00	1449.00	215.00	WOCATAG	Class C	Balanced Plug
Spacer @ 3286	3203.14	3336.00	132.86	WOC & TAG	Class C	Balanced Plug
Base of Salt @ 5227	5124.00	5589.00	465.00			
DV tool plug	5124.00	5589.00	465.00	WOC & TAG	Class C	Balanced Plug
Delaware @ 5539	5124.00	5589.00	465.00			
Spacer @ 7447	7322.53	7497.00	174.47	WOC & TAG	Class C	Balanced Plug
Bonesprings @ 9451	9306.49	9501.00	194.51	WOC & TAG	Class H	Balanced Plug
9.625 inch- Shoe Plug	11671.00	12050.00	379.00	WOC & TAG	Class H	500psi leak test
CIBP Plug	11671.00	12050.00	379.00	WOCATAG	Ciass II	30min

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole. Class H > 7500' Class C < 7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement Requirement:	<u>Low</u>
13.375 inch- Shoe Plug @	1297.00
9.625 inch- Shoe Plug @	11840.00
5.5 inch- Shoe Plug @	22651.00

DV Tool @ 5514.00 CIBP @ 12050.00

# BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

# Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified *BY PHONE* (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



# **United States Department of the Interior**

#### BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

#### **Reclamation Objectives and Procedures**

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or

concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos

Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Doris Lauger Martinez
Environmental Protection Specialist
575-234-5926

Jaden Johnston Environmental Protection Asst. (Intern) 575-234-6252

Released to Tmaging: 12/17/2024 3:03:38 PM

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

# State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 413039

#### **CONDITIONS**

Operator:	OGRID:
COG OPERATING LLC	229137
600 W Illinois Ave	Action Number:
Midland, TX 79701	413039
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By	Condition	Condition Date
kfortner	Adhere to current Plug & Abandon (P&A) Conditions Of Approvals (COA).	12/17/2024
kfortner	Federal well follow BLM guidelines and changes to procedure	12/17/2024