Sundry Print Report

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Well Name: WHITE STAR FED Well Location: T17S / R29E / SEC 29 / County or Parish/State: EDDY /

NWNE / 32.8100891 / -104.0937593

Well Number: 9 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMNM14840 Unit or CA Name: Unit or CA Number:

LLC

#### **Notice of Intent**

**Sundry ID: 2823838** 

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 11/21/2024 Time Sundry Submitted: 11:30

Date proposed operation will begin: 01/25/2024

**Procedure Description:** Please find proposed P&A procedure, current wellbore diagram and plugged diagram for your review.

#### **Surface Disturbance**

Is any additional surface disturbance proposed?: No

## **NOI Attachments**

#### **Procedure Description**

 $White\_Star\_Fed\_9\_P\_A\_Procedure\_20241121113018.pdf$ 

 $White\_Star\_Fed\_9\_Post\_\_P\_A\_WBD\_20241121113018.pdf$ 

 $White\_Star\_Fed\_9\_Pre\_\_P\_A\_WBD\_20241121113018.pdf$ 

eceived by OCD: 12/16/2024 2:43:44 PM
Well Name: WHITE STAR FED

Well Location: T17S / R29E / SEC 29 /

NWNE / 32.8100891 / -104.0937593

County or Parish/State: EDDY? of

Zip:

Well Number: 9

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM14840

**Unit or CA Name:** 

**Unit or CA Number:** 

**US Well Number: 3001530694** 

**Operator: SPUR ENERGY PARTNERS** 

# **Conditions of Approval**

#### **Specialist Review**

White\_Star\_Fed\_9\_Sundry\_ID\_2823838\_P\_A\_20241216143309.pdf

# **Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

**Operator Electronic Signature: SARAH CHAPMAN** Signed on: NOV 21, 2024 11:30 AM

Name: SPUR ENERGY PARTNERS LLC

Title: Regulatory Director

Street Address: 9655 KATY FREEWAY SUITE 500

City: HOUSTON State: TX

Phone: (281) 642-5503

Email address: SCHAPMAN@SPURENERGY.COM

#### **Field**

**Representative Name:** 

**Street Address:** 

City: State:

Phone:

**Email address:** 

### **BLM Point of Contact**

Signature: Long Vo

**BLM POC Name: LONG VO BLM POC Title:** Petroleum Engineer

**BLM POC Phone:** 5759885402 BLM POC Email Address: LVO@BLM.GOV

**Disposition:** Approved Disposition Date: 12/16/2024

Page 2 of 2

Form 3160-5 (June 2019)

# UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED
OMB No. 1004-0137
Expires: October 31, 2021

BUREAU OF LAND MANAGEMENT			5. Lease Serial No.			
Do not use this t	NOTICES AND REPOR form for proposals to Use Form 3160-3 (API	drill or to re-	enter an	6. If Indian, Allottee or Tribe	Name	
SUBMIT IN	TRIPLICATE - Other instruct	ions on page 2		7. If Unit of CA/Agreement,	Name and/or No.	
1. Type of Well  Oil Well  Gas V	Vell Other			8. Well Name and No.		
2. Name of Operator				9. API Well No.		
3a. Address	36	. Phone No. (inclu	ıde area code)	10. Field and Pool or Explora	atory Area	
4. Location of Well (Footage, Sec., T.,F	R.,M., or Survey Description)			11. Country or Parish, State		
12. CHE	CK THE APPROPRIATE BOX	(ES) TO INDICA	TE NATURE (	 OF NOTICE, REPORT OR OT	THER DATA	
TYPE OF SUBMISSION			TYP	E OF ACTION		
Notice of Intent	Acidize Alter Casing		Fracturing	Production (Start/Resume) Reclamation	Well Integrity	
Subsequent Report  Final Abandonment Notice	Casing Repair Change Plans Convert to Injection	New Cons Plug and A Plug Back	Abandon	Recomplete Temporarily Abandon Water Disposal	Other	
completed. Final Abandonment No is ready for final inspection.)	tices must be filed only after all	requirements, incl			3160-4 must be filed once testing has been the operator has detennined that the site	
14. I hereby certify that the foregoing is	true and correct. Name (Printe	ed/Typed) Title	;			
Signature		Date	e			
	THE SPACE F	OR FEDERA	L OR STA	ATE OFICE USE		
Approved by			Title		Date	
Conditions of approval, if any, are attac certify that the applicant holds legal or of which would entitle the applicant to cor	equitable title to those rights in t		Office			
Title 18 U.S.C. Section 1001 and Title 4	3 U.S.C Section 1212, make it a	crime for any per	son knowingly	v and willfully to make to any o	department or agency of the United States	

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United State any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

#### **GENERAL INSTRUCTIONS**

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

#### SPECIFIC INSTRUCTIONS

*Item 4* - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

#### **NOTICES**

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

**BURDEN HOURS STATEMENT:** Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

(Form 3160-5, page 2)

#### **Additional Information**

#### **Location of Well**


 $0. \ SHL: \ NWNE \ / \ 990 \ FNL \ / \ 1650 \ FEL \ / \ TWSP: \ 17S \ / \ RANGE: \ 29E \ / \ SECTION: \ 29 \ / \ LAT: \ 32.8100891 \ / \ LONG: \ -104.0937593 \ (\ TVD: \ 0 \ feet, \ MD: \ 0 \ feet \ )$   $BHL: \ NWNE \ / \ 990 \ FNL \ / \ 1650 \ FEL \ / \ TWSP: \ 17S \ / \ SECTION: \ / \ LAT: \ 0.0 \ / \ LONG: \ 0.0 \ (\ TVD: \ 0 \ feet, \ MD: \ 0 \ feet \ )$ 

White Star Fed #9 Eddy County, NM API: 30-015-30694

# White Star Fed 9 P&A Procedure

- 1. POOH with all tubing and rods in the hole.
- 2. Set 5-1/2" CIBP at 3900'. Pressure test casing to 500psi for 30mins. Run CBL from 3900' to surface. Spot 29 sxs of Class C Cmt from 3900'-3611'. WOC and Tag. (Yeso, Glorieta, DV Tool)
- 3. Plug 2: Spot 54 sxs Class C Cmt from 2486'-1941'. WOC and tag. (San Andres, Grayberg)
- 4. Plug 3: Spot 25 sxs Class C Cmt from 1798'-1546'. WOC and tag. (Queen)
- 5. Plug 4: Spot 100 sxs Class C Cmt from 1013'-Surface. WOC and tag. (Yates, Salt Base, Salt Top- Surface)
- 6. Ensure all annuli are cemented to surface. Cut-off wellhead. Weld on dryhole marker.

SPUD DATE: 11/02/1999 ELEV: 3,602' GL, 15' KB

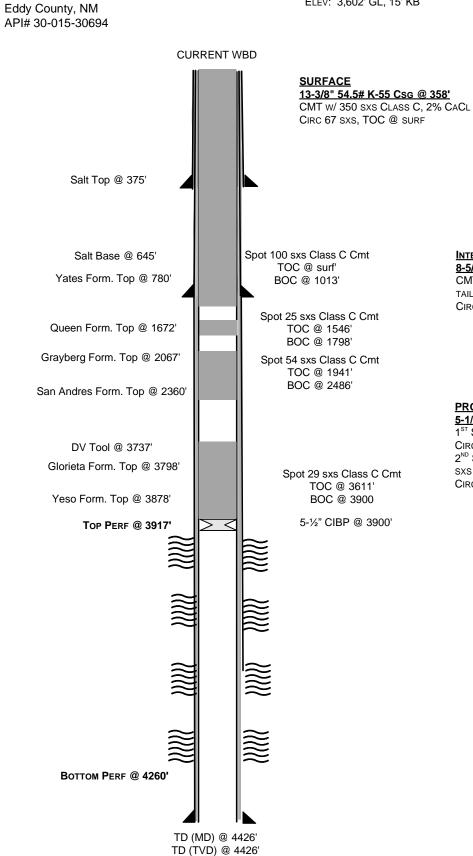

INTERMEDIATE

8-5/8" 24# J-55 Csg @ 887' CMT w/200 sxs 35/65 Lite 1/4# CF 3# SALT, TAIL WITH 250 SXS CLASS C 2% CACL CIRC 20 SXS, TOC @ SURF

**PRODUCTION** 

5-1/2" 17# J-55 Csg @ 4424' 1<sup>ST</sup> STAGE: 150 SXS 50-50-2 .5% FL-25 5# SALT CIRC 58 SXS 2<sup>ND</sup> STAGE: 450 SXS 35-65-6 ¼# CF 3# SALT AND 250 SXS 50-50-2 .5% FL-25 5# SALT CIRC 81 SXS, TOC @ SURF

API# 30-015-30694

SPUD DATE: 11/02/1999 ELEV: 3,602' GL, 15' KB Page 8 of 23

CURRENT WBD Salt Top @ 375' Salt Base @ 645' Yates Form. Top @ 780' Queen Form. Top @ 1672' Grayberg Form. Top @ 2067' San Andres Form. Top @ 2360' DV Tool @ 3737' Glorieta Form. Top @ 3798' Yeso Form. Top @ 3878' TOP PERF @ 3917' **BOTTOM PERF @ 4260'** TD (MD) @ 4426' TD (TVD) @ 4426'

SURFACE 13-3/8" 54.5# K-55 Csg @ 358' CMT W/ 350 SXS CLASS C, 2% CACL CIRC 67 SXS, TOC @ SURF

INTERMEDIATE 8-5/8" 24# J-55 Csg @ 887' CMT w/200 sxs 35/65 Lite 1/4 CF 3# salt, TAIL WITH 250 sxs Class C 2% CaCL CIRC 20 SXS, TOC @ SURF

#### **PRODUCTION**

5-1/2" 17# J-55 Csg @ 4424' 1<sup>ST</sup> STAGE: 150 SXS 50-50-2 .5% FL-25 5# SALT CIRC 58 SXS 2<sup>ND</sup> STAGE: 450 SXS 35-65-6 1/4# CF 3# SALT AND 250 SXS 50-50-2 .5% FL-25 5# SALT CIRC 81 SXS, TOC @ SURF

Rod String and Pump Landed @

2-7/8" 6.5# J-55 Bare Tubing EOT @ 4400'

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report

Well Name: WHITE STAR FED

Well Location: T17S / R29E / SEC 29 /

NWNE / 32.8100891 / -104.0937593

County or Parish/State: EDDY /

NM

Well Number: 9

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM14840

Unit or CA Name:

Unit or CA Number:

US Well Number: 3001530694

Operator: SPUR ENERGY PARTNERS

LLC

#### **Notice of Intent**

Sundry ID: 2823838

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 11/21/2024

Time Sundry Submitted: 11:30

Date proposed operation will begin: 01/25/2024

Procedure Description: Please find proposed P&A procedure, current wellbore diagram and plugged diagram for your review.

#### **Surface Disturbance**

Is any additional surface disturbance proposed?: No

#### **NOI Attachments**

#### **Procedure Description**

White\_Star\_Fed\_9\_P\_A\_Procedure\_20241121113018.pdf

White\_Star\_Fed\_9\_Post\_\_P\_A\_WBD\_20241121113018.pdf

White\_Star\_Fed\_9\_Pre\_\_P\_A\_WBD\_20241121113018.pdf

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND SPECIAL STIPULATIONS ATTACHED Well Name: WHITE STAR FED

Well Location: T17S / R29E / SEC 29 / NWNE / 32.8100891 / -104.0937593

County or Parish/State: EDDY /

NM

Well Number: 9

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM14840

Unit or CA Name:

Unit or CA Number:

US Well Number: 3001530694

Operator: SPUR ENERGY PARTNERS

LLC

#### Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: SARAH CHAPMAN

Signed on: NOV 21, 2024 11:30 AM

Name: SPUR ENERGY PARTNERS LLC

Title: Regulatory Director

Street Address: 9655 KATY FREEWAY SUITE 500

City: HOUSTON

State: TX

Phone: (281) 642-5503

Email address: SCHAPMAN@SPURENERGY.COM

#### Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

Form 3160-5 (Jun

# **UNITED STATES**

FORM APPROVED

(June 2019)		PARTMENT OF THE I		Expir	res: October 31, 2021
	BUR	EAU OF LAND MAN.	AGEMENT	5. Lease Serial No.	/NM14840
D ab	o not use this i	NOTICES AND REPO form for proposals t Use Form 3160-3 (A	ORTS ON WELLS o drill or to re-enter an PD) for such proposals.	6. If Indian, Allottee or Tribe Na	ame
	SUBMIT IN	TRIPLICATE - Other instru	octions on page 2	7. If Unit of CA/Agreement, Na	ame and/or No.
termont	ril Well Gas V	Instantal		8. Well Name and No. white STAR FED/9	-
2. Name of Opera	ator SPUR ENERGY	PARTNERS LLC		9. API Well No. 3001530694	
3a. Address 965	55 KATY FREEWAY	SUITE 500, HOUSTON,	3b. Phone No. <i>(include area code)</i> <b>(832) 930-8548</b>	10. Field and Pool or Explorato  E EMPIRE/E EMPIRE	ry Area
4. Location of We SEC 29/T17S		R.,M., or Survey Description)		11. Country or Parish, State EDDY/NM	
***	12. CHE	CK THE APPROPRIATE BO	OX(ES) TO INDICATE NATURE C	F NOTICE, REPORT OR OTH	ER DATA
TYPE OF	SUBMISSION		TYPE	OF ACTION	
✓ Notice of	Intent	Acidize Alter Casing	Deepen Hydraulie Fracturing	Production (Start/Resume) Reclamation	Water Shut-Off Well Integrity
Subsequer	nt Report	Casing Repair Change Plans	New Construction  ✓ Plug and Abandon	Recomplete Temporarily Abandon	Other
Final Abar	ndonment Notice	Convert to Injection	Plug Back	Water Disposal	
12 Dagariba Dray	magad on Completed C	Name 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	(*		

Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be perfouned or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that the site is ready for final inspection.)

Please find proposed P&A procedure, current wellbore diagram and plugged diagram for your review.

Regulatory Directo	or	
ate	11/21	/2024
RAL OR STATE O	FICE USE	
Title Petroleum	Engineer	Date 12/16/2034
Office CF0		
	Title Petroleum	RAL OR STATE OFICE USE  Title Petroleum Engineer

(Instructions on page 2)

#### **GENERAL INSTRUCTIONS**

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

#### SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

#### **NOTICES**

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

**BURDEN HOURS STATEMENT:** Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

#### **Additional Information**


#### Location of Well

 $0. \ SHL: \ NWNE \ / \ 990 \ FNL \ / \ 1650 \ FEL \ / \ TWSP: \ 17S \ / \ RANGE: \ 29E \ / \ SECTION: \ 29 \ / \ LAT: \ 32.8100891 \ / \ LONG: \ -104.0937593 \ (\ TVD: \ 0 \ feet, \ MD: \ 0 \ feet, \ MD: \ 0 \ feet)$  BHL: \ NWNE \ / \ 990 \ FNL \ / \ 1650 \ FEL \ / \ TWSP: \ 17S \ / \ SECTION: \ / \ LAT: \ 0.0 \ / \ LONG: \ 0.0 \ (\ TVD: \ 0 \ feet, \ MD: \ 0 \ feet)


White Star Fed #9 Eddy County, NM API: 30-015-30694

# White Star Fed 9 P&A Procedure

- 1. POOH with all tubing and rods in the hole.
- 2. Set 5-1/2" CIBP at 3900'. Pressure test casing to 500psi for 30mins. Run CBL from 3900' to surface. Spot 29 sxs of Class C Cmt from 3900'-3611'. WOC and Tag. (Yeso, Glorieta, DV Tool)
- 3. Plug 2: Spot 54 sxs Class C Cmt from 2486'-1941'. WOC and tag. (San Andres, Grayberg)
- 4. Plug 3: Spot 25 sxs Class C Cmt from 1798'-1546'. WOC and tag. (Queen)
- 5. Plug 4: Spot 100 sxs Class C Cmt from 1013'-Surface. WOC and tag. (Yates, Salt Base, Salt Top-Surface)
- 6. Ensure all annuli are cemented to surface. Cut-off wellhead. Weld on dryhole marker.

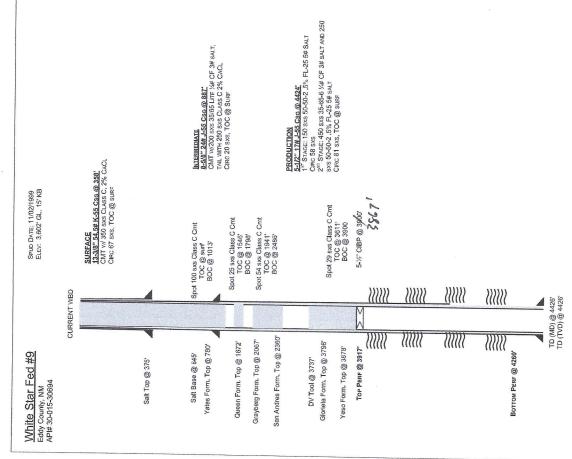

CREATED ON 11/20/24 UPDATED

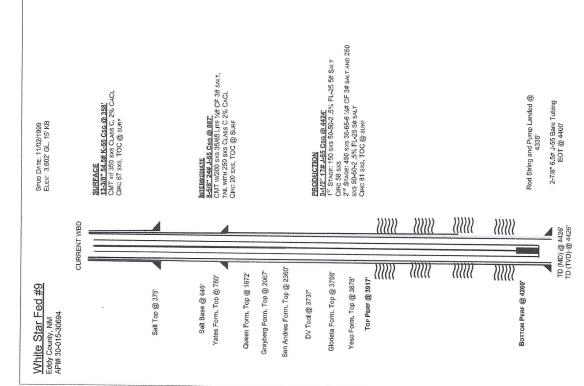

CREATED ON 11/20/24 UPDATED

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

#### Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified *BY PHONE* (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



# **United States Department of the Interior**

#### BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

#### **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or

concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos

Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Doris Lauger Martinez
Environmental Protection Specialist
575-234-5926

Jaden Johnston Environmental Protection Asst. (Intern) 575, 234, 6252

Released to Imaging: 1/2/2025 10:50:39 AM

30.0   100.00   100	Sundry ID	2823838						
30							Cement	
334   337   334   30   345   30   34   30	Plug Type	Тор	Bottom	Length	Tag	Sacks	Class	Notes
334   337   334   30   345   30   34   30								
334   337   334   30   345   30   34   30			400.00	400.00	- 04 16			
### Spot cement from 100								
Spot cement from   1000 to surface.   Spot cement from   1000 to sur								
828.13 937.00 108.87 Tag/Verify 101.00 C Verify at surface.  20ueen	Yates @ 806							
1591.42   1708.00   108.87   Tag/Verify   101.00   C   Verify at surface.								Spot cement from
Dase no   Dase		000.40	007.00	400.07	T 0/ :6	404.00		
Spot cement from   Spot cement from   Spot cement from   1708 to 1591.	8.625 inch- Shoe Plug	828.13	937.00	108.87		101.00	C	verify at surface.
1591.42   1708.00   116.58   Tag   25.00   C   1708' to 1591'.								0 1 15
If solid base no need to Tag (CIBP) present and/or Mechanic at Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if solid base no need to Tag (CIBP) present and/or Mechanic at Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio 23798   3710.02   3848.00   137.98   If solid base no need to Tag (CIBP) present and/or Mechanic at Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP present and/or Mechanic at Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test all CIBP if no Open Perforatio Sqc then Tag, Leak Test CIBP.	Quaan @ 1658	1501 /2	1708 00	116 59		25.00	C	
Base no	Queen @ 1656	1391.42	1706.00	110.56	тау	25.00	C	1700 to 1591.
Base no								
Reed to   Tag   C(IBP   present   and/or   Mechanic   al Integrity   Test), If   Perf & S   Sqz then   Tag, Leak   Test all   C(IBP if no   Open   Perforatio   Spot cement from   2284.42   2408.00   123.58   ns   25.00   C   2408' to 2284'.					If solid			
Tag (CIBP present and/or Mechanic at Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP fro Open Perforatio 2358   3710.02 3848.00 133.88   Isolid								
CiBP present and/or Mechanic at Integrity Test), if Perf & Sqz then Tag, Leak Test all CiBP from Open Perforatio 2408* to 2284*.   San Andres @ 2358   2284.42   2408.00   123.58   ns   25.00 C   2408* to 2284*.   Significate @ 3788   3710.02   3848.00   137.98   if solid   137.98   if solid   137.98   if solid   138.78   i								
Present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP Plug   Perforatio								
San Andres @ 2358   2284.42   2408.00   123.58   rs   25.00   C   2408' to 2284'.					`			
Mechanic al Integrity   Test), if   Perf &   Sag then   Tag, Leak   Test all   CIBP if no   Open   Perforatio   Spot cement from   Spot cement f								
San Andres @ 2358   2284.42   2408.00   123.58   16   125.00   C   2408' to 2284'.								
Test)   F   Perf &   Sqz then   Tag, Leak   Test all   CIBP if no   Open   Perforatio   Spot cement from   San Andres @ 2358   2284.42   2408.00   123.58   ns   25.00   C   2408' to 2284'.								
Perf & Sqz then   Tag, Leak   Test all   CIBP if no   Open   Perforatio   Perforatio   Spot cement from								
Tag, Leak Test all CIBP if no Open Perforatio   Spot cement from Open Open Open Open Open Open Open Open								
Test all CIBP if no Open								
CIBP if no Open								
San Andres @ 2358   2284.42   2408.00   123.58   ns   25.00   C   2408' to 2284'.								
San Andres @ 2358   2284.42   2408.00   123.58   ns   25.00   C   2408' to 2284'.								
2358   2284.42   2408.00   123.58   ns   25.00   C   2408' to 2284'.								Snot cement from
3710.02   3848.00   137.98   If solid	San Andres @ 2358	2284.42	2408.00			25.00	С	
If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio Perforatio Spot 25 sxs on top.    CIBP Plug   3832.00   3867.00   35.00   35.00   S   25.00   C   Leak test CIBP.	Glorieta @ 3798	3710.02		137.98	If solid			
base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio Spot 25 sxs on top.  CIBP Plug 3832.00 3867.00 35.00 ns 25.00 C Leak test CIBP.  Perforations Plug (If No CIBP) 3867.00 4310.00 443.00 Tag/Verify	Yeso @ 3878	3789.22	3928.00	138.78	If solid			
base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio Spot 25 sxs on top.  CIBP Plug 3832.00 3867.00 35.00 ns 25.00 C Leak test CIBP.  Perforations Plug (If No CIBP) 3867.00 4310.00 443.00 Tag/Verify								
base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio Spot 25 sxs on top.  CIBP Plug 3832.00 3867.00 35.00 ns 25.00 C Leak test CIBP.  Perforations Plug (If No CIBP) 3867.00 4310.00 443.00 Tag/Verify					If solid			
need to   Tag   (CIBP   present   and/or   Mechanic   al Integrity   Test), If   Perf &   Sqz then   Tag, Leak   Test all   CIBP if no   Open   Open   Open   Perforatio   Spot 25 sxs on top.   Leak test CIBP.								
Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio Spot 25 sxs on top.  CIBP Plug 3832.00 3867.00 35.00 ns 25.00 C Leak test CIBP.  Perforations Plug (If No CIBP) 3867.00 4410.00 443.00 Tag/Verify								
present and/or   Mechanic   Al Integrity   Test), If   Perf &   Sqz then   Tag, Leak   Test all   CIBP if no   Open   Open   Set CIBP at 3867'.   Perforatio   Spot 25 sxs on top.   CIBP Plug   3832.00   3867.00   35.00   ns   25.00   C   Leak test CIBP.   Perforations Plug (If No CIBP)   3867.00   4310.00   443.00   Tag/Verify   Perforations Plug (If No CIBP)   Perforations Plug (If No CIBP)					Tag			
and/or   Mechanic   al Integrity   Test), If   Perf &   Sqz then   Tag, Leak   Test all   CIBP if no   Open   Open   Set CIBP at 3867'.   Perforatio   Spot 25 sxs on top.   CIBP Plug   3832.00   3867.00   35.00   ns   25.00   C   Leak test CIBP.   Perforations Plug (If No CIBP)   3867.00   4310.00   443.00   Tag/Verify   CIBP					-			
Mechanic   al Integrity   Test), If   Perf &   Sqz then   Tag, Leak   Test all   CIBP if no   Open   Set CIBP at 3867'.   Perforatio   Spot 25 sxs on top.   CIBP Plug   3832.00   3867.00   35.00   ns   25.00   C   Leak test CIBP.   Perforations Plug (If No CIBP)   3867.00   4310.00   443.00   Tag/Verify   CIBP   C								
al Integrity   Test), If   Perf &   Sqz then   Tag, Leak   Test all   CIBP if no   Open   Set CIBP at 3867'.   Spot 25 sxs on top.   CIBP Plug   3832.00   3867.00   35.00   ns   25.00   C   Leak test CIBP.   Perforations Plug (If No CIBP)   3867.00   4310.00   443.00   Tag/Verify   CIBP   CIBP								
Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Set CIBP at 3867'. Spot 25 sxs on top. Leak test CIBP.  CIBP Plug 3832.00 3867.00 35.00 ns 25.00 C Leak test CIBP.  Perforations Plug (If No CIBP) 3867.00 4310.00 443.00 Tag/Verify								
Perf & Sqz then   Tag, Leak   Test all   CIBP if no   Open   Set CIBP at 3867'.   Spot 25 sxs on top.   CIBP Plug   3832.00   3867.00   35.00   ns   25.00   C   Leak test CIBP.								
Sqz then   Tag, Leak   Test all   CIBP if no   Open   Set CIBP at 3867'.   Spot 25 sxs on top.   CIBP Plug   3832.00   3867.00   35.00   ns   25.00   C   Leak test CIBP.								
Tag, Leak Test all CIBP if no Open Set CIBP at 3867'. Spot 25 sxs on top.  CIBP Plug 3832.00 3867.00 35.00 ns 25.00 C Leak test CIBP.  Perforations Plug (If No CIBP) 3867.00 4310.00 443.00 Tag/Verify					Sqz then			
CIBP if no Open   Set CIBP at 3867'.   Spot 25 sxs on top.   Leak test CIBP.								
CIBP Plug   3832.00   3867.00   35.00   Tag/Verify   Set CIBP at 3867'.   Spot 25 sxs on top.   Leak test CIBP.   Leak test CIBP.   Leak test CIBP.   CIBP Plug   CIBP Perforations Plug (If No CIBP)   Set CIBP at 3867'.   Spot 25 sxs on top.   Leak test CIBP.   CIBP Plug Perforations Plug (If No CIBP)   Set CIBP at 3867'.   Spot 25 sxs on top.   Leak test CIBP.   CIBP Plug Perforations Plug (If No CIBP)   Set CIBP at 3867'.   Spot 25 sxs on top.   Leak test CIBP.   CIBP Plug Plug Plug Plug Plug Plug Plug Plu								
Spot 25 sxs on top.   CIBP Plug   3832.00   3867.00   35.00   ns   25.00   C   Leak test CIBP.								0-4-0100 4-0007
CIBP Plug         3832.00         3867.00         35.00 ns         25.00 C         Leak test CIBP.           Perforations Plug (If No CIBP)         3867.00         4310.00         443.00 Tag/Verify         Leak test CIBP.								
Perforations Plug (If No CIBP) 3867.00 4310.00 443.00 Tag/Verify	CIRP Plug	3832 00	3867 00			25 00	C	
5.5 inch- Shoe Plug 4329.76 4474.00 144.24 Tag/Verify	Perforations Plug (If No CIBP)				Tag/Verify	20.00	<del> </del>	LOUIC COLUMN .
	5.5 inch- Shoe Plug						1	

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole. Class H > 7500' Class C < 7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement Requirement:	Low		
13.375 inch- Shoe Plug @	358.00		
8.625 inch- Shoe Plug @	887.00		
5.5 inch- Shoe Plug @	4424.00		
Derferenterer Terr (2)	2047.00	Doufoustion -	4000.00
Perforatons Top @	3917.00	Perforations	4260.00

CIBP @ 3867.00

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

# State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 412482

#### **CONDITIONS**

Operator:	OGRID:
Spur Energy Partners LLC	328947
9655 Katy Freeway	Action Number:
Houston, TX 77024	412482
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By	Condition	Condition Date
gcordero	Adhere to current Plug & Abandon (P&A) Conditions Of Approvals (COA).	1/2/2025
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	1/2/2025
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	1/2/2025