12/30/2024
/State: LEA /
Name:
er:

Notice of Intent

Sundry ID: 2822605 Type of Submission: Notice of Intent Date Sundry Submitted: 11/14/2024 Date proposed operation will begin: 01/22/2025

Type of Action: Plug and Abandonment Time Sundry Submitted: 11:40

Procedure Description:


Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

WBD_proposed_Blocker_2_20241226130800.pdf WBD_current_Blocker_2_20241226130800.pdf Procedure_Blocker_2_P_A_20241114113731.pdf

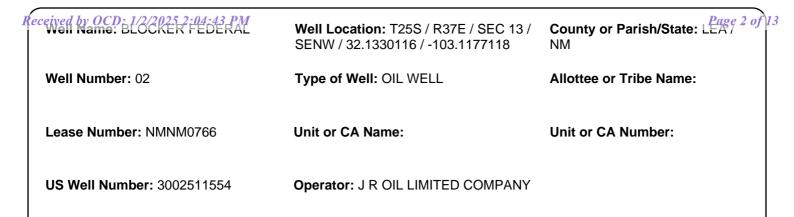

Conditions of Approval

Specialist Review

BLOCKER_FEDERAL_02___2822605___COA_AND_PROCEDURE_20241228152834.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: MAREN LATIMER

Name: J R OIL LIMITED COMPANY

Title: Operator

Street Address: 5700 W CARLSBAD HWY

City: HOBBS State: NM

Phone: (575) 691-6790

Email address: MLATIMER@RAVENOP.COM

Field

Representative Name: Ian PetersenStreet Address: PO Box 2975City: HobbsState: NMPhone: (432)634-4922

Email address: ian@ddpetro.com

BLM Point of Contact

BLM POC Name: KEITH P IMMATTY BLM POC Phone: 5759884722 Disposition: Approved Signature: KEITH IMMATTY Signed on: DEC 26, 2024 01:08 PM

Zip: 88240

BLM POC Title: ENGINEER

BLM POC Email Address: KIMMATTY@BLM.GOV

Disposition Date: 12/28/2024



Blocker Federal #2

Abandonment Procedure

October 23, 2024

- 1. MIRU plugging service
- 2. Lay down rods
- 3. Trip bit & scraper to top perf (3,186')
- 4. Set CIBP @ +/- 3,136'
- 5. Test 5-1/2 casing to 500 psi for 30 min.
- 6. Run CBL as per NMOCD requirements to verify cement to surface. If cemented to surface, spot OK for surface plug (382')
- 7. Spot 25 sx Class C neat cement on CIBP, WOC, and tag
- 8. Circulate MLF
- 9. Log cement bond from PBTD to surface
- 10. Spot 25 sx @ 2,485'
- 11. Spot 35 sx @ 1,246'
- 12. Perf 382' & circ. 96 sx or more to surface
- 13. Cut off well head 3' beneath grade, top off cement, weld marker, and back fill.
- 14. Remove all underground piping and surface equipment. Remediate surface location per OCD.

Information

<u>Well</u>

Name: Blocker Federal #2

API: 30-025-11554

Location: Unit F, section 13, T 25S, R 37E, 1,650' FNL, 2,310' FWL

Lat/long: 32.1330223, -103.1177063

Directions: From the intersection of 128 & 18 in Jal, travel east 3.8 miles, Turn north (left) onto Blocker Rd, and travel 0.5 miles, Turn east (right), and travel 0.4 miles, Follow the road as it turns north (left), The first well on the left is the #2.

Contacts

Company Man in charge:	Bobby Stearns (575) 760-2482
Engineer:	lan Petersen (432) 634-4922
Production Foreman:	Josh Latimer (575) 414-9188
Pumper:	Charles Cowger (575) 631-7939

Received by OCD: 1/2/2025 2:04:43 PM

Blocker Federal #2

Well Lawe, how Prices 02 FORMATION Code No. UND 2002, 100, 2007, 100, 200 100, 2017, 2010, 2017, 2010, 2017, 201	JIN					DI	JCKe.	гге	uera	l <i>#∠</i>				
BUILD ALLY, INST. 1070 COMPT deal ComPT deal <thcompt deal<="" th=""> ComPT deal</thcompt>						F								
Or Toke 1000 Description Description <thdescription< th=""> <thdescription< th=""></thdescription<></thdescription<>									x					
Bit Mark B: 58 5100 J-55 9377 7.972 0'' 3325' I J 260 Mill (sec) a and the sec S 100 J-55 S 107 4.807 D'' 3325' I J 356 Mill (sec) a and the sec S 100 J-55 S 107 4.807 D'' 3325' I J 356 Mill (sec) a and the sec S 100 J-55 S 107 A 307 D'' 3325' I I J <td< th=""><th></th><th></th><th>-</th><th></th><th>CASING</th><th>1 -</th><th></th><th></th><th>1</th><th></th><th>CEMENT &</th><th>HOLE DATA</th><th>-</th><th></th></td<>			-		CASING	1 -			1		CEMENT &	HOLE DATA	-	
Bet Acc Production 5 12 14.00 J-65 512 14.87 0 J-385											bit size	depth		
Design 20 Design 20 21/1785 Style J Avelou-Philard G (LOC), per Daren (P 12 SUPD 300 100 100 mode 100														
Design 20 Design 20 21/1785 Style J Avelou-Philard G (LOC), per Daren (P 12 SUPD 300 100 100 mode 100														
Design 20 Design 20 21/1785 Style J Avelou-Philard G (LOC), per Daren (P 12 SUPD 300 100 100 mode 100														
Design 20 Design 20 21/1785 Style J Avelou-Philard G (LOC), per Daren (P 12 SUPD 300 100 100 mode 100														
Design 20 Design 20 21/1785 Style J Avelou-Philard G (LOC), per Daren (P 12 SUPD 300 100 100 mode 100														
a.8.** Store 3221980 Pert U, Dasen, acklar 2.6 get 55%, the C.464 2000 geat of 1 3.05 3.361 U. Gueen active 1 0.0600 Bit 100 active a.8.** Store 103/1184 Diction of the Tatleton*, POP, dump 220 get 10%. 103/1184 Diction of the Tatleton*, POP, dump 220 get 10%. 103/1184 Diction of the Tatleton*, POP, dump 220 get 10%. 103/1184 Diction of the Tatleton*, POP, dump 220 get 10%. D0 Tate 1.018 Image: Distribution of the Tatleton*, POP, dump 220 get 10%. 103/1184 Diction of the Tatleton*, POP, dump 220 get 10%. 103/1184 Diction of the Tatleton*, POP, dump 220 get 10%. D0 Tate 1.018 Image: Distribution of the Tatleton*, POP, dump 220 get 10%. 103/1184 Diction of the Tatleton*, POP, dump 220 get 10%. 103/1184 Diction of the Tatleton*, POP, dump 220 get 10%. D0 Tate 1.018 Image: Distribution of the Tatleton*, POP, dump 220 get 10%. Image: Distribution of the Tatleton*, POP, dump 220 get 10%. D0 Tate 1.018 Image: Distribution of the Tatleton*, POP, dump 220 get 10%. Image: Distribution of the Tatleton*, POP, dump 220 get 10%. D0 Tate 1.018 Image: Distribution of the Tatleton*, POP, dump 220 get 10%. Image: Distribution of the Tatleton*, POP, dump 220 get 10%. D0 Tate 1.018 Image: Distribution of the Tatleton*, POP, dump 220 get 10%. Image: Distribution of the Tatleton of the				norson-Prich	ard Oil Corp	norf Quoon II					7000	etatue	ttl shots	data
DV 100 1.10 DV 100 1.00 DV 10			3/20/1980 Perf U. Q	ueen, acidize 2					3,186'	3,304'	U. Queen	active		04/05/80
DU TU L L L L DU TU L L L L L L DU TU L L L L L L L L L L L L L L L L L L	8-5/8" 332'				OP dump 25	0 gal 15%			3,342'	3,376'	Queen	active		02/10/56
TUBING (N) erg/l tength = 3,585*/- - - Tubric 2.38 1.985 110 3,586,03 3,366 SN - - - 1.00 3,366 SN - - - 1.00 3,366 SN - - - - 1.00 3,366 SN - - - - - - - RODE (NL) -			1,10,1004 01001100	to bottom, r	or , dump 20	o gai 1070								
TUBING (N) erg/l tength = 3,585*/- - - Tubric 2.38 1.985 110 3,586,03 3,366 SN - - - 1.00 3,366 SN - - - 1.00 3,366 SN - - - - 1.00 3,366 SN - - - - - - - RODE (NL) -														
TUBING (N) erg/l tength = 3,585*/- - - Tubric 2.38 1.985 110 3,586,03 3,366 SN - - - 1.00 3,366 SN - - - 1.00 3,366 SN - - - - 1.00 3,366 SN - - - - - - - RODE (NL) -														
TUBING (N) erg/l tength = 3,585*/- - - Tubric 2.38 1.985 110 3,586,03 3,366 SN - - - 1.00 3,366 SN - - - 1.00 3,366 SN - - - - 1.00 3,366 SN - - - - - - - RODE (NL) -														
TUBING (N) erg/l tength = 3,585*/- - - Tubric 2.38 1.985 110 3,586,03 3,366 SN - - - 1.00 3,366 SN - - - 1.00 3,366 SN - - - - 1.00 3,366 SN - - - - - - - RODE (NL) -														
TUBING (N) erg/l tength = 3,585*/- - - Tubric 2.38 1.985 110 3,586,03 3,366 SN - - - 1.00 3,366 SN - - - 1.00 3,366 SN - - - - 1.00 3,366 SN - - - - - - - RODE (NL) -														
TUBING (N) erg/l tength = 3,585*/- - - Tubric 2.38 1.985 110 3,586,03 3,366 SN - - - 1.00 3,366 SN - - - 1.00 3,366 SN - - - - 1.00 3,366 SN - - - - - - - RODE (NL) -														
COLUME DOLUME DOLUME<	DV Tool 1,015') ava it long	th - 30 501'			
N 1.0 3.368 SN 1.0 3.361 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 10 0 0 0 0 0 0 110 3300 354 112 0 120 3366 110 112 112 14 320 3366 114 320 3366 111 112 112 114 320 3366 114 112 114 112 114 112 114<	P									OD (in)	ID (in)	joints	length (ft)	depth (ft)
0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0.1 0										2 3/8	1.995	110		
OD (in) grade rods length (t) depth (t) Polined rods 56 134 3,350 3,354 Pump 1.1/2 12.0 3,366 Pump 1.1/2 1.2.0 1.2.0 Dometric 1.1.0 1.1.0 1.1.0 1.1.0 D									ON				1.10	3,300
OD (in) grade rods length (t) depth (t) Polined rods 56 134 3,350 3,354 Pump 1.1/2 12.0 3,366 Pump 1.1/2 1.2.0 1.2.0 Dometric 1.1.0 1.1.0 1.1.0 1.1.0 D														
OD (in) grade rods length (t) depth (t) Polined rods 56 134 3,350 3,354 Pump 1.1/2 12.0 3,366 Pump 1.1/2 1.2.0 1.2.0 Dometric 1.1.0 1.1.0 1.1.0 1.1.0 D														
OD (in) grade rods length (t) depth (t) Polined rods 56 134 3,350 3,354 Pump 1.1/2 12.0 3,366 Pump 1.1/2 1.2.0 1.2.0 Dometric 1.1.0 1.1.0 1.1.0 1.1.0 D														
OD (in) grade rods length (t) depth (t) Polined rods 56 134 3,350 3,354 Pump 1.1/2 12.0 3,366 Pump 1.1/2 1.2.0 1.2.0 Dometric 1.1.0 1.1.0 1.1.0 1.1.0 D														
OD (in) grade rods length (t) depth (t) Polined rods 56 134 3,350 3,354 Pump 1.1/2 12.0 3,366 Pump 1.1/2 1.2.0 1.2.0 Dometric 1.1.0 1.1.0 1.1.0 1.1.0 D														
OD (in) grade rods length (t) depth (t) Polined rods 56 134 3,350 3,354 Pump 1.1/2 12.0 3,366 Pump 1.1/2 1.2.0 1.2.0 Dometric 1.1.0 1.1.0 1.1.0 1.1.0 D														
OD (in) grade rods length (t) depth (t) Polined rods 56 134 3,350 3,354 Pump 1.1/2 12.0 3,366 Pump 1.1/2 1.2.0 1.2.0 Dometric 1.1.0 1.1.0 1.1.0 1.1.0 D														
Point and value 0.0 4 Sucker code 56 134 3.360 Pump 1 1.2 1.20 3.364 Image: State of the									RODS (NA)					
Sucker roots 508 134 33300 3384 Pump 1 1/2 1 120 3386 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0									Polished red	OD (in)	grade	rods		
U. Queen perfs 3,186' - 304' Pump intake 3,366' Queen perfs 3,342' - 76' To 3,87'									Sucker rods			134	3,350.0	3,354
5-1/2" 3,385' TD 3,387'									Pump	1 1/2			12.0	3,366
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'		U. Queen	perfs 3,186' - 304'											
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
5-1/2" 3,385' TD 3,387'														
TD 3,387'		Queen pe	erfs 3,342' - 76'											
TD 3,387'														
Lingston: Lietonor 1/ 2017/ Bullon Dotoreon	TD 3,387	71									Undet	d: October 1	4 2024 by la	n Petersen

Updated: October 14, 2024 by Ian Petersen

Received by OCD: 1/2/2025 2:04:43 PM

Blocker Federal #2 PROPOSED

			API NO:	Blocker Fed 30-025-115 February 10	54	F	FORMATION: FIELD: COUNTY:	Langlie Mattix	(KB: PBTD: TD: CEMENT &	3,387		
			joints	OD	lb/ft	grade	ID (in)	drift (in)	top	bottom	bit size	depth	sacks	тос
		Surface Production		8 5/8 5 1/2	24.00 14.00	J-55 J-55	8.097 5.012	7.972 4.887	0' 0'	332' 3,385'			250 350	surf. (cal surf. (cal
		History:							PERFORAT	ONS				
						perf Queen, II ac 49k# 20/40		-	top 3,186'	bottom 3,304'	zone U. Queen	status active	ttl shots	date 04/05/80
rc. 96 sx			30k gal "m	-frac"	OP, dump 25				3,342'	3,376'	Queen	active		02/10/5
	TOC 908'													
	100 000							-	TUBING (no					
	Top of Sal	t 1,196'						-		OD (in)	ID (in)	joints	length (ft)	depth (f
	35 sx 1,24													
	TOC 2,24	5'						-	RODS (none	e) OD (in)	grade	rods	length (ft)	depth (1
	Base of Sa													
	Top of Yat 25 sx 2,48													
	MLF TOC 2,986 25 sx CIBP 3,13													
	U. Queen	perfs 3,186' -	- 304'											
		fs 3,342' - 76												

Sundry ID	2822605					
Plug Type	Тор	Bottom	Length	Tag	Sacks	Notes
				Verify		
Surface Plug	0.00	382.00	382.00	circulated		Spot OK if cement to
Shoe Plug	278.68	382.00	103.32	to surface	96.00	surface
DV tool plug	954.85	1065.00	110.15			
				WOC and		
Top of Salt @ 1196	1134.04	1246.00	111.96	Tag	35.00	
Base of Salt @ 2365	2291.35	2415.00	123.65	WOC and		
Yates @ 2435	2360.65	2485.00	124.35	Tag	25.00	
				Verify		Leak test 500psi,
CIBP Plug	3101.00	3136.00	35.00	depth	25.00	30mins

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between	en plugs
in cased hole.	
Class H >7500'	
Class C<7500'	
Fluid used to mix the cement in R111P shall be saturated with the salts common to the section	
penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cer	nent will
be considered the desired mixture whenever possible.	
Critical, High Cave Karst: Cave Karst depth to surface	
R111P: Solid plug in all annuli - 50' from bottom of salt to surface.	

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	Low		500.00
Shoe @	332.00		
Shoe @	3385.00		
Perforatons Top @	3186.00	Perforations Bottom @	3376.00
		2010011 0	
DV Tool @	1015.00	CIBP @	3136.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified** *BY PHONE* (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or

concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Doris Lauger Martinez Environmental Protection Specialist 575-234-5926

Jaden Johnston Environmental Protection Asst. (Intern) *Released to Imaging: 1/3/2025 12:10:46 PM* Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
J R OIL, LTD. CO.	256073
P.O. Box 53657	Action Number:
Lubbock, TX 79453	416537
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)
CONDITIONS	

CONDITIONS

Created By	Condition	Condition Date
gcordero	Adhere to current Plug & Abandon (P&A) Conditions Of Approvals (COA).	1/3/2025
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	1/3/2025
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	1/3/2025

Page 13 of 13

CONDITIONS

Action 416537