Sundry Print Report

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Lease Number: NMNM19625

Well Name: LONGWAY DRAW Well Location: T25S / R34E / SEC 8 /

NWSE / 32.1431711 / -103.4898384

County or Parish/State: LEA /

NM

Well Number: 01 Type of Well: CONVENTIONAL GAS

WELL

Allottee or Tribe Name:

Unit or CA Name: LONGWAY DRAW

Unit or CA Number:

NMNM72405

INCORPORATED

Notice of Intent

Sundry ID: 2834063

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 01/27/2025 Time Sundry Submitted: 03:46

Date proposed operation will begin: 02/05/2025

Procedure Description: EOG PROPOSES TO P&A THIS WELLBORE USING THE ATTACHED PROCEDURE. CURRENT AND PROPOSED WELLBORE SCHEMATICS ATTACHED.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

 $Longway_Draw_Fed_Com__1_Proposed_WBD_20250127154549.pdf$

 $Longway_Draw_Fed_Com__1_Current_WBD_20250127154534.pdf$

 $Longway_Draw_Fed_Com__1_PA_Procedure_20250127154522.pdf$

eceived by OCD: 2/12/2025 3:26:33 PM
Well Name: LONGWAY DRAW

Well Location: T25S / R34E / SEC 8 /

NWSE / 32.1431711 / -103.4898384

County or Parish/State: LEA/

NM

Well Number: 01

Type of Well: CONVENTIONAL GAS

WELL

Allottee or Tribe Name:

Unit or CA Name: LONGWAY DRAW

Unit or CA Number: NMNM72405

US Well Number: 3002528549

Lease Number: NMNM19625

Operator: EOG RESOURCES

INCORPORATED

Conditions of Approval

Specialist Review

Longway_Draw_1_Sundry_ID_2834063_P_A_20250211073840.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: ALVINO GARCIA Signed on: JAN 27, 2025 03:46 PM

Name: EOG RESOURCES INCORPORATED

Title: Regulatory Specialist

Street Address: 5509 CHAMPIONS BLVD

City: MIDLAND State: TX

Phone: (432) 236-2924

Email address: ALVINO_GARCIA@EOGRESOURCES.COM

Field

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: LONG VO **BLM POC Title:** Petroleum Engineer

BLM POC Phone: 5759885402 BLM POC Email Address: LVO@BLM.GOV

Disposition: Approved **Disposition Date:** 02/11/2025

Signature: Long Vo

Page 2 of 2

Form 3160-5 (June 2019)

UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED
OMB No. 1004-0137
Expires: October 31, 202

BUREAU OF LAND MANAGEMENT			5. Lease Serial No.			
Do not use this t	IOTICES AND REPORTS ON form for proposals to drill or Use Form 3160-3 (APD) for s	6. If Indian, Allottee or Tribe Name				
SUBMIT IN	TRIPLICATE - Other instructions on p	page 2	7. If Unit of CA/Agreement, N	Name and/or No.		
1. Type of Well Oil Well Gas W	Vell Other		8. Well Name and No.			
2. Name of Operator			9. API Well No.			
3a. Address	3b. Phone N	No. (include area cod	2) 10. Field and Pool or Explorat	tory Area		
4. Location of Well (Footage, Sec., T., R	2.,M., or Survey Description)		11. Country or Parish, State			
12. CHE	CK THE APPROPRIATE BOX(ES) TO	INDICATE NATURI	E OF NOTICE, REPORT OR OTH	HER DATA		
TYPE OF SUBMISSION		TY	PE OF ACTION			
Notice of Intent		eepen ydraulic Fracturing	Production (Start/Resume) Reclamation	Water Shut-Off Well Integrity		
Subsequent Report		ew Construction	Recomplete	Other		
Subsequent Report	Change Plans	ug and Abandon	Temporarily Abandon			
Final Abandonment Notice	Convert to Injection	ug Back	Water Disposal			
is ready for final inspection.)	tices must be filed only after all requirem	ents, including reclar	nation, have been completed and t	the operator has detennined that the site		
14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)		Title				
Title						
Signature		Date				
	THE SPACE FOR FE	DERAL OR ST	ATE OFICE USE			
Approved by		Tial -		Data		
	hed. Approval of this notice does not war equitable title to those rights in the subject duct operations thereon.		ļ	Date		
Title 18 U.S.C Section 1001 and Title 4	3 U.S.C Section 1212, make it a crime for	r any person knowing	gly and willfully to make to any de	epartment or agency of the United States		

any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

(Form 3160-5, page 2)

Additional Information

Location of Well

 $0. \ SHL: \ NWSE \ / \ 1980 \ FSL \ / \ 1980 \ FEL \ / \ TWSP: \ 25S \ / \ RANGE: \ 34E \ / \ SECTION: \ 8 \ / \ LAT: \ 32.1431711 \ / \ LONG: \ -103.4898384 \ (\ TVD: \ 0 \ feet \)$ BHL: \ \ NWSE \ / \ 1980 \ \ FSL \ / \ 1980 \ \ FEL \ / \ TWSP: \ 25S \ / \ SECTION: \ / \ LAT: \ 0.0 \ / \ LONG: \ 0.0 \ (\ TVD: \ 0 \ feet \ MD: \ 0 \ feet \)

1.084

1,750 4,450

5,306

9,288

12,440

13,898

14,039

14,443

14,716

15,620

Well Name: Longway Draw Fed Com #1

Location: 1980' FSL & 1980' FEL Sec. 8-25S-34E

County: Lea, NM

32.1431847, -103.4897995 NAD83 Lat/Long: API#:

Spud Date: 12/31/83

30-025-28549 Compl. Date: 7/3/84



Rustler

Top of Salt

Delaware

Wolfcamp

Strawn

Atoka

Morrow

Chester

Morrow CL

Bone Spring

Bottom of Salt

Formation Tops

Proposed P&A Wellbore Diagram: Verify cmt to surf on all csg strings.

KB: GL: 3,348' Perf/sqz 60 sx cmt @ 150'-surf Surface plug 17-1/2" Hole

13-3/8" 54.5# J-55 @ 602' Cmt w/ 650 sx (circ)

12-1/4" Hole

10-3/4" 51# & 40.5# J-55 & K-55 @ 5,168' Cmt w/ 2,200 sx (circ)

9-1/4" Hole

Top of 5" csg hanger @ 13,200' 7-5/8" 39# & 33.7# P-110 @ 13,600' Cmt w/ 1,450 sx. Est TOC @ 5,000' 6-1/2" Hole

> 5" 18# P-110 @ 15,700' Cmt w/ 365 sx

Perf/sqz 40 sx cmt @ 650'-550' (tag) Covers 13-3/8" csg shoe

Perf/sqz 45 sx cmt @ 1,800'-1,690' (tag) Covers top of Salt

Perf/sqz 55 sx cmt @ 4,500'-4,360' (tag) Covers base of Salt

Perf/sqz 95 sx cmt @ 5,360'-5,070' (tag) Covers top of Delaware & 10-3/4 csg shoe

Spot 35 sx cmt plug @ 6,200'-6,040' (no tag req) Spacer plug

Spot 45 sx cmt plug @ 9,340'-9,150' (no tag req) Covers top of Bone Spring

Spot 50 sx cmt plug @ 12,490'-12,270' (no tag req) Covers top of Wolfcamp

Spot 75 sx cmt plug @ 13,650'-13,020' (tag) Covers 7-5/8 csg shoe & 5" liner top

Sqz 70 sx cmt plug @ 14,100'-14,865' (tag & psi test) Covers Morrow perfs & fish left in hole Fish left in hole (4-22-2010) @ 14,175'-14,671'

2-7/8 tbg & packer @ 14,671 Morrow perfs: 14,829'-14,865'

PBTD @ 15,314' TD @ 15,700'

Morrow perfs: 15,047'-15,289' Sqz'd Morrow perfs: 15,331'-15,336' RBP @ 15,314' Morrow perfs: 15,605'-15,610'

> Not to Scale By: BL 1/27/25

Well Name: Longway Draw Fed Com #1

Location: 1980' FSL & 1980' FEL Sec. 8-25S-34E


County: Lea, NM

Lat/Long: 32.1431847, -103.4897995 NAD83

API #: 30-025-28
Spud Date: 12/31/83
Compl. Date: 7/3/84

30-025-28549 12/31/83



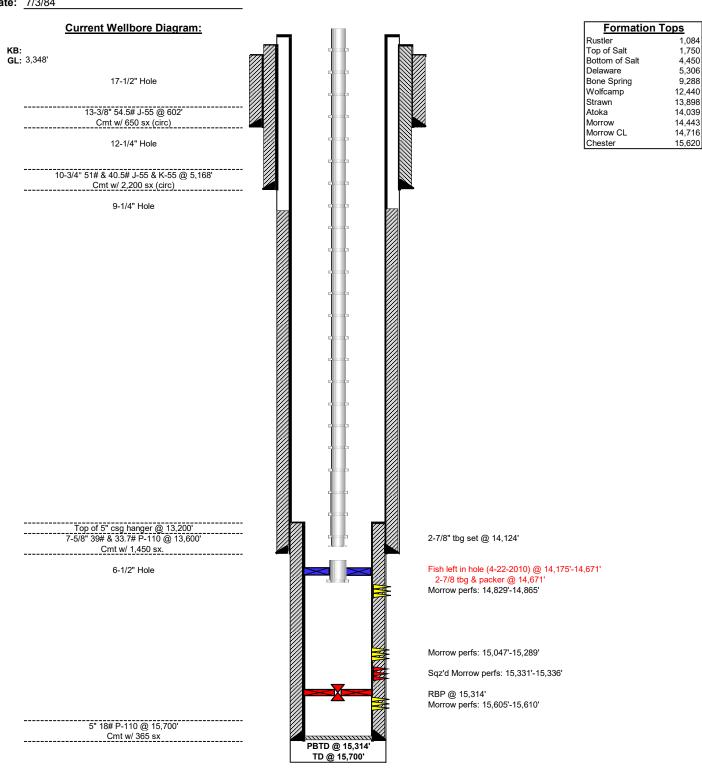

Not to Scale By: BL 1/8/25



Longway Draw Fed Com #1 API # 30-025-28549 1980' FSL & 1980' FEL – Sec. 8-25S-34E Lea County, New Mexico

P&A Procedure AFE # 187837

Executive Summary:

P&A wellbore, cutoff wellhead and install dry hole marker.

TD: 15,700' **PBTD:** 15,314' **GL:** 3,348' **KB:**

Surface Casing: 13%" 54.5# J-55 at 602'. Cemented with 650 sx. Cement circulated.

Intermediate: 10¾" 51# & 40.5# J-55 at 5,168'. Cemented with 2,200 sx. Cement circulated. 7½" 39# & 33.7# P-110 at 13,600'. Cemented with 1,450 sx. Calc TOC at 5,000'.

Production Liner: 5" 18# P-110 at 13,200'-15,700'. Cemented with 365 sx.

Producing Interval: Morrow perfs at 14,829-865'; 15,047-289'; 15,331-336' (sqz'd); 15,605-610'

Other: RBP set at 15,314' on 6/14/1984

Fish left in hole on 4/22/2010: 2-7/8" tbg & packer at 14,175'-14,671'

P&A Procedure:

- 1. MIRU well service unit and all necessary safety equipment. Kill the well, ND WH and NU BOP.
- 2. Open ended 2\%" tbg currently set at 14,124'. POOH laying down tbg.
- **3.** Pick up packer & 2-7/8" work string, TIH with packer to squeeze perfs below the fish left in hole. Set packer in 5" liner at 14,080', establish injection down into perfs, then squeeze 70 sx class "H" cement from 14,100'-14,865' (covers upper Morrow perfs, top of Morrow, and top of fish). Release packer, pick up, reverse clean, WOC and tag (re-sqz if necessary). POOH to lay down packer.
- 4. MIRU WL to run CBL from ~8,000'-surface to verify TOC for 7-5/8" casing. RDMO WL.
- **5.** TIH w/ open ended 2-7/8" work string to 13,650' and circulate plugging mud to surface. Spot 75 sx class "H" cement at 13,650'-13,020' (covers 7-5/8 csg shoe and 5" liner top). Pull uphole, reverse clean, WOC and tag.
- 6. PU and spot 50 sx class "H" cement from 12,490'-12,270' (covers top of Wolfcamp), no tag required.
- 7. PU and spot 45 sx class "H" cement from 9,340'-9,150' (covers top of Bone Spring), no tag required.
- **8.** PU and spot 35 sx class "H" cement from 6,200'-6,040' (spacer plug), no tag required. PU, reverse clean and POOH.
- **9.** RU & RIH WL to perf 7%" casing at 5,360'. POOH w/ WL. TIH with tubing to spot/sqz 95 sx class "C" cement inside and outside 7%" csg from 5,360'-5,070' (covers top of Delaware and 10%" csg shoe). PU, reverse clean and POOH to WOC.



- 10. RU WL to RIH to tag TOC, then perf 7%" casing at 4,500'. POOH w/ WL. TIH with tubing to spot/sqz 55 sx class "C" cement inside and outside 7%" csg from 4,500'-4,360' (covers Base of Salt). PU, reverse clean and POOH to WOC.
- 11. RU WL to RIH to tag TOC, then perf 7%" casing at 1,800'. POOH w/ WL. TIH with tubing to spot/sqz 45 sx class "C" cement inside and outside 7%" csg from 1,800'-1,690' (covers Top of Salt). PU, reverse clean and POOH to WOC.
- 12. RU WL to RIH to tag TOC, then perf 7%" casing at 650'. POOH w/ WL. TIH with tubing to spot/sqz 40 sx class "C" cement inside and outside 7%" casing from 650'-550' (covers 13%" csg shoe). PU, reverse clean and POOH to WOC.
- 13. RU WL to RIH to tag TOC, then perf 7%" casing at 150'. POOH w/ WL. Circulate 60 sx class "C" cement inside and outside 7%" csg from 150'-surface (surface plug).
- **14.** Cutoff WH, verify cement to surface on all casing strings and top off as necessary.
- **15.** RDMO well service unit, install dry hole marker and clean location.

Production Engineer:

Date: <u>1/27/2025</u>



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Lease Number: NMNM19625

Sundry Print Repor

Well Name: LONGWAY DRAW Well Location: T25S / R34E / SEC 8 /

NWSE / 32.1431711 / -103.4898384

Unit or CA Name: LONGWAY DRAW

County or Parish/State: LEA /

Well Number: 01 Type of Well: CONVENTIONAL GAS

Allottee or Tribe Name:

Unit or CA Number:

NMNM72405

US Well Number: 3002528549

Operator: EOG RESOURCES

INCORPORATED

Notice of Intent

Sundry ID: 2834063

Type of Submission: Notice of Intent Type of Action: Plug and Abandonment

Date Sundry Submitted: 01/27/2025 Time Sundry Submitted: 03:46

Date proposed operation will begin: 02/05/2025

Procedure Description: EOG PROPOSES TO P&A THIS WELLBORE USING THE ATTACHED PROCEDURE.

CURRENT AND PROPOSED WELLBORE SCHEMATICS ATTACHED.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Longway_Draw_Fed_Com__1_Proposed_WBD_20250127154549.pdf

Longway_Draw_Fed_Com__1_Current_WBD_20250127154534.pdf

Longway_Draw_Fed_Com__1_PA_Procedure_20250127154522.pdf

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND SPECIAL STIPULATIONS ATTACHED

Page 1 of 2

eceived by OCD: 2/12/2025 3:26:33 PM
Well Name: LONGWAY DRAW

Well Location: T25S / R34E / SEC 8 /

NWSE / 32.1431711 / -103.4898384

County or Parish/State: Page 11 of

Well Number: 01

Type of Well: CONVENTIONAL GAS

Allottee or Tribe Name:

Lease Number: NMNM19625

Unit or CA Name: LONGWAY DRAW

Unit or CA Number: NMNM72405

US Well Number: 3002528549

Operator: EOG RESOURCES

INCORPORATED

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: ALVINO GARCIA Signed on: JAN 27, 2025 03:46 PM

Name: EOG RESOURCES INCORPORATED

Title: Regulatory Specialist

Street Address: 5509 CHAMPIONS BLVD

City: MIDLAND State: TX

Phone: (432) 236-2924

Email address: ALVINO_GARCIA@EOGRESOURCES.COM

Field

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

APPROVED by Long Vo

Petroleum Engineer Carlsbad Field Office 575-988-50402

LVO@BLM.GOV

Form 3160-5 (June 2019)

UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED
OMB No. 1004-0137
Expires: October 31, 202

BURI	EAU OF LAND MANAGI	EMENT	5. Lease Serial No.			
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.			6. If Indian, Allottee or Tribe Name			
SUBMIT IN T	TRIPLICATE - Other instruction	ns on page 2	7. If Unit of CA/Agreement,	Name and/or No.		
1. Type of Well Gas W	/ell Other		8. Well Name and No.			
2. Name of Operator			9. API Well No.			
3a. Address	3b. I	Phone No. (include area code	10. Field and Pool or Explora	atory Area		
4. Location of Well (Footage, Sec., T.,R	2.,M., or Survey Description)		11. Country or Parish, State			
12. CHE	CK THE APPROPRIATE BOX(E	S) TO INDICATE NATURE	OF NOTICE, REPORT OR OT	THER DATA		
TYPE OF SUBMISSION		TY	PE OF ACTION			
Notice of Intent	Acidize	Deepen	Production (Start/Resume)) Water Shut-Off		
	Alter Casing	Hydraulic Fracturing	Reclamation	Well Integrity		
Subsequent Report	Casing Repair	New Construction	Recomplete	Other		
	Change Plans	Plug and Abandon	Temporarily Abandon			
Final Abandonment Notice	Convert to Injection	Plug Back	Water Disposal			
is ready for final inspection.)			nation, have been completed and	the operator has detennined that the site		
4. I hereby certify that the foregoing is	true and correct. Name (Printed/	Typed) Title				
Signature		Date				
	THE SPACE FO	R FEDERAL OR ST	ATE OFICE USE			
Approved by Long Vo		Title	roleum Engineer	2/11/2025 Date		
Conditions of approval, if any, are attack ertify that the applicant holds legal or e which would entitle the applicant to con	equitable title to those rights in the	e subject lease Office C	arlsbad Field Office			
Fitle 18 U.S.C Section 1001 and Title 43	3 U.S.C Section 1212, make it a c	rime for any person knowing	ly and willfully to make to any d	department or agency of the United States		

any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

(Form 3160-5, page 2)

Additional Information

Location of Well

 $0. \ SHL: \ NWSE \ / \ 1980 \ FSL \ / \ 1980 \ FEL \ / \ TWSP: \ 25S \ / \ RANGE: \ 34E \ / \ SECTION: \ 8 \ / \ LAT: \ 32.1431711 \ / \ LONG: \ -103.4898384 \ (\ TVD: \ 0 \ feet \)$ BHL: \ \ NWSE \ / \ 1980 \ \ FSL \ / \ 1980 \ \ FEL \ / \ TWSP: \ 25S \ / \ SECTION: \ / \ LAT: \ 0.0 \ / \ LONG: \ 0.0 \ (\ TVD: \ 0 \ feet \ MD: \ 0 \ feet \)

Well Name: Longway Draw Fed Com #1

Location: 1980' FSL & 1980' FEL Sec. 8-25S-34E

County: Lea, NM

Lat/Long: 32.1431847, -103.4897995 NAD83

API #: 30-025-28549 Spud Date: 12/31/83

Spud Date: <u>12/31/83</u> Compl. Date: <u>7/3/84</u>

Proposed P&A Wellbore Diagram:

KB: GL: 3,348'

17-1/2" Hole

13-3/8" 54.5# J-55 @ 602' Cmt w/ 650 sx (circ)

12-1/4" Hole

10-3/4" 51# & 40.5# J-55 & K-55 @ 5,168' Cmt w/ 2,200 sx (circ)

9-1/4" Hole

REVISED

1:27 pm, Feb 10, 2025

Top of 5" csg hanger @ 13,200' 7-5/8" 39# & 33.7# P-110 @ 13,600' Cmt w/ 1,450 sx. Est TOC @ 5,000'

6-1/2" Hole

5" 18# P-110 @ 15,700' Cmt w/ 365 sx



Formation Tops Rustler 1.084 Top of Salt 1,750 4,450 Bottom of Salt Delaware 5,306 Bone Spring 9,288 Wolfcamp 12,440 Strawn 13,898 Atoka 14,039 Morrow 14,443 Morrow CL 14,716 Chester 15,620

*If CBL indicates cement behind casing, spot cement instead.

Verify cmt to surf on all csg strings. Perf/sqz 235 sx cmt @ 650'-Surf

Covers 13-3/8" csg shoe

Perf/sqz 45 sx cmt @ 1,800'-1,690' (tag) Covers top of Salt

Perf/sqz 55 sx cmt @ 4,500'-4,355' (tag) Covers base of Salt

Perf/sqz 95 sx cmt @ 5,360'-5,066' (tag) Covers top of Delaware & 10-3/4 csg shoe

Spot 35 sx cmt plug @ 6,200'-6,040' (no tag req) Spacer plug

Spot 45 sx cmt plug @ 9,340'-9,142' (no tag req) Covers top of Bone Spring

Spot 180 sx cmt plug @ 14100' to 12265' (tag) Covers 7-5/8 csg shoe & 5" liner top

Sqz 70 sx cmt plug @ 14,100'-14,865' (tag & psi test) Covers Morrow perfs & fish left in hole Fish left in hole (4-22-2010) @ 14,175'-14,671' 2-7/8 tbg & packer @ 14,671' Morrow perfs: 14,829'-14,865'

Morrow perfs: 15,047'-15,289'

Sqz'd Morrow perfs: 15,331'-15,336'

RBP @ 15,314'

PBTD @ 15,314' TD @ 15,700' Morrow perfs: 15,605'-15,610'

If no injection set 5" CIBP at 14100'. Leak test and Run CBL from 8000' to surface.

Not to Scale By: BL 1/27/25

1,750

4,450 5,306

9,288 12,440

13,898

14,039

14,443

14,716

15,620

Well Name: Longway Draw Fed Com #1


Location: 1980' FSL & 1980' FEL Sec. 8-25S-34E

County: Lea, NM

Lat/Long: 32.1431847, -103.4897995 NAD83

API #: 30-025-28549
Spud Date: 12/31/83
Compl. Date: 7/3/84



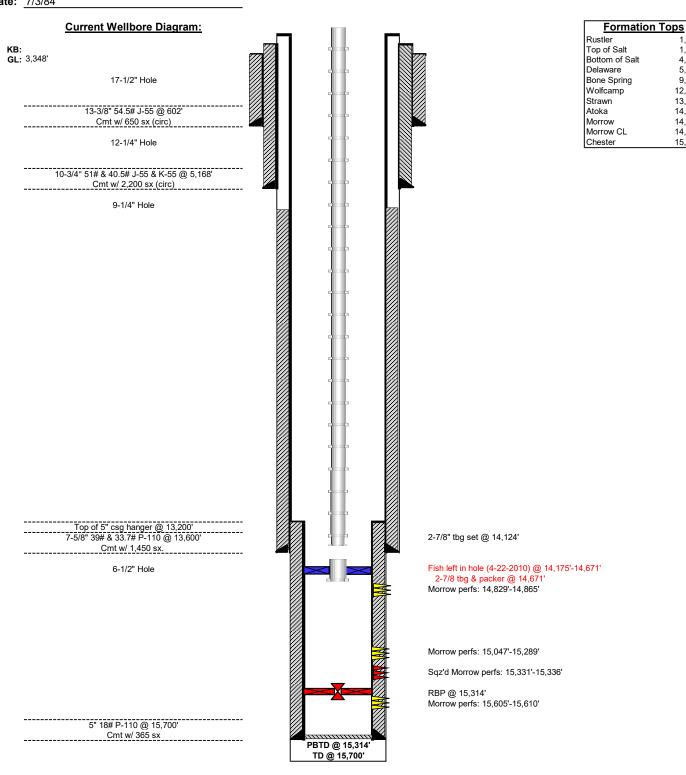

Not to Scale By: BL 1/8/25





Longway Draw Fed Com #1 API # 30-025-28549 1980' FSL & 1980' FEL - Sec. 8-25S-34E Lea County, New Mexico

P&A Procedure AFE # 187837

Executive Summary:

P&A wellbore, cutoff wellhead and install dry hole marker.

TD: 15,700' **PBTD:** 15,314' **GL**: 3,348' KB:

Surface Casing: 13%" 54.5# J-55 at 602'. Cemented with 650 sx. Cement circulated.

10¾" 51# & 40.5# J-55 at 5,168'. Cemented with 2,200 sx. Cement circulated. Intermediate: **Production Casing:** 7%" 39# & 33.7# P-110 at 13,600'. Cemented with 1,450 sx. Calc TOC at 5,000'.

5" 18# P-110 at 13,200'-15,700'. Cemented with 365 sx. **Production Liner:**

Producing Interval: Morrow perfs at 14,829-865'; 15,047-289'; 15,331-336' (sqz'd); 15,605-610'

RBP set at 15,314' on 6/14/1984 Other:

Fish left in hole on 4/22/2010: 2-7/8" tbg & packer at 14,175'-14,671'

P&A Procedure:

- 1. MIRU well service unit and all necessary safety equipment. Kill the well, ND WH and NU BOP.
- 2. Open ended 2\%" tbg currently set at 14,124'. POOH laying down tbg.
- 3. Pick up packer & 2-7/8" work string, TIH with packer to squeeze perfs below the fish left in hole. Set If no injection set packer in 5" liner at 14,080', establish injection down into perfs, then squeeze 70 sx class "H" cement from 14,100'-14,865' (covers upper Morrow perfs, top of Morrow, and top of fish). Release CIBP packer, pick up, reverse clean, WOC and tag (re-sqz if necessary). POOH to lay down packer.

5" CIBP at 14100'. Leak test

- 4. MIRU WL to run CBL from ~8,000'-surface to verify TOC for 7-5/8" casing. RDMO WL.
- 5. TIH w/ open ended 2-7/8" work string to 14100' and circulate plugging mud to surface. Spot 180 sx class "H" cement at 14100' to 12265' (covers 7-5/8 csg shoe and 5" liner top). Pull uphole, reverse clean, WOC and tag.
- **6.** PU and spot 45 sx class "H" cement from 9,340'-9,142' (covers top of Bone Spring), no tag required.
- 7. PU and spot 35 sx class "C" cement from 6,200'-6,040' (spacer plug), no tag required. PU, reverse clean and POOH.
- 8. RU & RIH WL to perf 7%" casing at 5,360'. POOH w/ WL. TIH with tubing to spot/sqz 95 sx class "C" cement inside and outside 7%" csg from 5,360'-5,066' (covers top of Delaware and 10%" csg shoe). PU, reverse clean and POOH to WOC. If CBL indicate cement behind casing, spot cement instead. (In 54 sxs/Out 41 sxs)





- 10. RU WL to RIH to tag TOC, then perf 7%" casing at 4,500'. POOH w/ WL. TIH with tubing to spot/sqz 55 sx class "C" cement inside and outside 7%" csg from 4,500'-4,355' (covers Base of Salt). PU, reverse clean and POOH to WOC. If CBL indicate cement behind casing, spot cement instead. (In 27 sxs/Out 28 sxs)
- 11. RU WL to RIH to tag TOC, then perf 7%" casing at 1,800'. POOH w/ WL. TIH with tubing to spot/sqz 45 sx class "C" cement inside and outside 7%" csg from 1,800'-1,690' (covers Top of Salt). PU, reverse clean and POOH to WOC. (In 20 sxs/Out 25 sxs)
- 12. RU WL to RIH to tag TOC, then perf 7%" casing at 652'. POOH w/ WL. TIH with tubing to spot/sqz 235 sx class "C" cement inside and outside 7%" casing from 652'-surface (covers 13%" csg shoe). PU, reverse clean and POOH to WOC. (In 119 sxs/Out 116 sxs)
- 13. Cutoff WH, verify cement to surface on all casing strings and top off as necessary.
- 14. RDMO well service unit, install dry hole marker and clean location.

Production Engineer:

Date: 1/27/2025

Brice A. Letcher, P.E.

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified *BY PHONE* (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or

concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos

Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Doris Lauger Martinez Environmental Protection Specialist 575-234-5926

Jaden Johnston Environmental Protection Asst. (Intern) 575-234-6252

Released to Imaging: 3/10/2025 7:16:37 AM

Sundry ID	2834063	T	T		T	ı	
Plug Type	Тор	Bottom	Length	Tag	Sacks	Cement Class	Notes
Surface Plug	0.00	100.00	100.00	Tag/Verify			
							Perf and squeeze from 652' to surface.
							Verify at surface. (In 119 sxs/Out 116
13.375 inch- Shoe Plug	545.98	652.00	106.02	Tag/Verify	235.00	С	sxs) Perf and squeeze
							from 1800' to 1690'.
Top of Salt @ 1420	1355.80	1470.00	114.20	Tag/Verify	45.00	С	WOC and Tag. (In 20 sxs/Out 25 sxs)
							Perf and attempt squeeze from 4500'
							to 4355'. (In 27 sxs/Out 28 sxs)
							WOC and Tag. If CBL indicate
							cement behind
Base of Salt @ 4450	4355.50	4500.00	144.50	Tag/Verify	55.00	С	casing, spot cement instead.
10.75 inch- Shoe Plug	5066.32	5218.00	151.68	Tag/Verify			
				If solid base no			
				need to Tag			
				(CIBP present			
				and/or			
				Mechanic al Integrity			
				Test), If Perf &			Perf and attempt squeeze from 5360'
				Sqz then Tag, Leak			to 5066'. (In 54 sxs/Out 41 sxs)
				Test all CIBP if no			WOC and Tag. If CBL indicate
				Open			cement behind
Delaware @ 5306	5202.94	5356.00		Perforatio ns	95.00	С	casing, spot cement instead.
				If solid base no			
				need to Tag			
				(CIBP			
				present and/or			
				Mechanic al Integrity			
				Test), If Perf &			
				Sqz then Tag, Leak			
				Test all			
				CIBP if no Open			
Spacer Plug @ 6150	6038.50	6200.00		Perforatio ns	35.00	С	Spot cement from 6200' to 6040'.
						·	

				If solid			
				base no			
				need to			
				Tag			
				(CIBP			
				present			
				and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak			
				Test all			
				CIBP if no			
				Open			
				Perforatio			Spot cement from
Banaansinga @ 0205	0140 45	0225.00	100.05		45.00	L	9340' to 9142'.
Bonesprings @ 9285	9142.15				45.00	П	2340 IO 914Z.
Wolfcamp @ 12440	12265.60		224.40				
Liner Top @ 13200	13018.00	13250.00	232.00	it solia			
7.625 inch- Shoe Plug	13414.00	13650.00	236.00	Tag/Verify			
Strawn @ 13854	13665.46	13904.00	238.54	If solid			
			,				
				If solid			
				base no			
				need to			
				Tag			
				(CIBP			
				•			
				present			
				and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak			
				Test all			
				CIBP if no			Spot cement from
				Open			14100' or CIBP to
				Perforatio			12265'. WOC and
Atoka @ 14039	13848.61	14089.00	240.39		180.00	Н	Tag.
7.10.11. @ 7.1000			2.0.00		100.00		
							1
				If solid			1
				base no			
				need to			
							1
				Tag			1
				(CIBP			
				present			
				and/or			1
				Mechanic			
				al Integrity			Attempt squeeze 70
				Test), If			sxs Class H from
				Perf &			14100' to
				Sqz then			perforations below.
				Tag, Leak			WOC and Tag. If no
				Test all			injection set CIBP at
				CIBP if no			14100' at top of fish.
				Open			Leak Test CIBP.
				Perforatio			Run CBL from CIBP
M @ 44440	14248.57	14493.00	244.43		70.00	Н	to surface.
INOTOW (d) 14443	17470.0/	17700.00	277.70		, 5.50	l	5411400.
Morrow @ 14443 Perforations Plug (If No CIBP)		14915 00	248 65	Tag/\/erifv			
Perforations Plug (If No CIBP)	14666.35	14915.00		Tag/Verify			
		14915.00 15339.00	341.50	Tag/Verify Tag/Verify Tag/Verify			

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole. Class H >7500' Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement Requirement:	<u>Low</u>		
13.375 inch- Shoe Plug @ 10.75 inch- Shoe Plug @ 7.625 inch- Shoe Plug @ 5 inch- Shoe Plug @	602.00 5168.00 13600.00 15700.00	тос @	4000.00
Perforatons Top @ Perforatons Top @	15047.50 14829.00	Perforations Perforations	15289.00 14865.00

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 431489

CONDITIONS

Operator:	OGRID:
EOG RESOURCES INC	7377
5509 Champions Drive	Action Number:
Midland, TX 79706	431489
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	Run CBL from 14000' to Surface	3/7/2025
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	3/7/2025
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	3/7/2025