

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Report

Well Name: HUDSON 11 FEDERAL Well Location: T18S / R31E / SEC 11 / County or Parish/State: EDDY /

TR 9 / SENE / 32.7640333 / -

103.8337642

Well Number: 2 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMLC062052 Unit or CA Name: Unit or CA Number:

COMPANY

Notice of Intent

Sundry ID: 2838804

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 02/25/2025 Time Sundry Submitted: 03:10

Date proposed operation will begin: 03/01/2025

Procedure Description: Matador is requesting to plug and abandon the Hudson 11 Federal #2 per the required COA, following the procedure below: • Notify OCD 24 hrs before MIRU. • Safety mtg, MIRU, check pressures, ND wellhead, NU & test BOPs, POOH w/ rods and tubing. • 8,165': RIH & set CIBP; TIH & Circulate wellbore full of MLF; Pressure Test casing to 500 psi for 30 minutes & Bubble test; TIH & spot 50 sks class H cmt on CIBP (Est. 7,759') (Open perforations); WOC & Tag. • Run CBL to Surface. • 6,055': Spot 36 sks class C cmt balanced plug (DV Tool, Bone Springs) (Est. 5,691' / Req. 5,690') WOC and Tag. • 4,302': Spot 95 sks class C cmt balanced plug (San Andres, Grayburg, Queen)

(Est. 3,341' / Req. 3,351') WOC and Tag. • 2,780': Spot 25 sks class C cmt balanced plug (7 Rivers) (Est. 2,527' / Req. 2,680'). • 2,406': Perf @ 2,406' and squeeze 95 sks class C cmt plug (Intermediate Shoe, Yates & B. Salt) (Est. 2,206' / Req. 2,004'). WOC & Tag. • 1100': Spot 25 sks class C cmt (Top of Salt & Est. TOC) (Est. 495' / Req. 989') WOC and Tag. • 400': Perf @ 400' & Squeeze class C cmt to surface on all strings (Surface Plug) (Est. 238 sks). • Cut off wellhead and ensure cmt to surface on all csg strings. • Install dry hole marker per NMOCD specifications. *Current and proposed wellbore diagrams attached **Mud laden fluid (MLF) mixed at 25sks/100 bbls water will be spotted between each plug.

Surface Disturbance

Is any additional surface disturbance proposed?: No

APPROVAL SUBJECT TO
GENERAL REQUIREMENTS AND
SPECIAL STIPULATIONS
ATTACHED

NOI Attachments

Procedure Description

Files_Combined_hudson_11_fed_2_20250225151016.pdf

Well Name: HUDSON 11 FEDERAL Well Location: T18S / R31E / SEC 11 / County or Parish/State: EDBY 7 of

TR 9 / SENE / 32.7640333 / -

103.8337642

Well Number: 2 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMLC062052 Unit or CA Name: Unit or CA Number:

COMPANY

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: BRETT JENNINGS Signed on: FEB 25, 2025 03:10 PM

Name: MATADOR PRODUCTION COMPANY

Title: Regulatory Analyst

Street Address: 5400 LBJ FREEWAY STE 1500

City: DALLAS State: TX

Phone: (972) 629-2160

Email address: BRETT.JENNINGS@MATADORRESOURCES.COM

Field

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

APPROVED by Long Vo Petroleum Engineer Carlsbad Field Office 575-988-50402 LVO@BLM.GOV Form 3160-5 (June 2019)

UNITED STATES DEPARTMENT OF THE INTERIOR DUDE ALL OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0137
Expires: October 31, 202

BUREAU OF LAND MANAGEMENT			5. Lease Serial No.	
Do not use this t	NOTICES AND REPORTS (form for proposals to drill Use Form 3160-3 (APD) fo	or to re-enter an	6. If Indian, Allottee or Tribe	Name
SUBMIT IN	TRIPLICATE - Other instructions of	on page 2	7. If Unit of CA/Agreement,	Name and/or No.
1. Type of Well Oil Well Gas W	Vell Other		8. Well Name and No.	
2. Name of Operator	Ven Outer		9. API Well No.	
3a. Address	3b. Pho	ne No. (include area code)	10. Field and Pool or Explora	atory Area
4. Location of Well (Footage, Sec., T., K	R.,M., or Survey Description)		11. Country or Parish, State	
12. CHE	CK THE APPROPRIATE BOX(ES)	TO INDICATE NATURE C	PF NOTICE, REPORT OR OT	HER DATA
TYPE OF SUBMISSION		TYPE	OF ACTION	
Notice of Intent	Acidize Alter Casing	Deepen [] Hydraulic Fracturing	Production (Start/Resume) Reclamation	Well Integrity
Subsequent Report	Casing Repair Change Plans	New Construction Plug and Abandon	Recomplete Temporarily Abandon	Other
Final Abandonment Notice	Convert to Injection	Plug Back	Water Disposal	
is ready for final inspection.)				
			— 36 sxs, WOC and Ta	
— /	_	Spot from 1	100' to 989'. WOC and Tag	Squeeze 95 sxs, Tag 2004'.
14. I hereby certify that the foregoing is	true and correct. Name (Printed/Typ	ed) Title		
Signature		Date		
	THE SPACE FOR	FEDERAL OR STA	TE OFICE USE	
Approved by Long Vo	200	Title Petr	oleum Engineer	4-5-2025 Date
Conditions of approval, if any, are attack certify that the applicant holds legal or ϵ which would entitle the applicant to con	equitable title to those rights in the su		urlsbad Field Office	
Title 19 IJ S C Section 1001 and Title 4	3 II S C Section 1212 make it a crim	e for any person knowingly	and willfully to make to any d	enartment or agency of the United States

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

(Form 3160-5, page 2)

Additional Information

Additional Remarks

Cut off wellhead and ensure cmt to surface on all csg strings.

Install dry hole marker per NMOCD specifications.

*Current and proposed wellbore diagrams attached

Location of Well


 $0. \ SHL: \ SENE\ /\ TR\ 9\ /\ 1930\ FNL\ /\ 660\ FEL\ /\ TWSP: \ 18S\ /\ RANGE: \ 31E\ /\ SECTION: \ 11\ /\ LAT: \ 32.7640333\ /\ LONG: \ -103.8337642\ (\ TVD: \ 0\ feet\ ,\ MD: \ 0\ feet\)$ $BHL: \ SENE\ /\ TR\ 9\ /\ 1930\ FNL\ /\ 660\ FEL\ /\ TWSP: \ 18S\ /\ SECTION: \ 9\ /\ LAT: \ 0.0\ /\ LONG: \ 0.0\ (\ TVD: \ 0\ feet\ ,\ MD: \ 0\ feet\)$

^{**}Mud laden fluid (MLF) mixed at 25sks/100 bbls water will be spotted between each plug.

Received by OCD: 4/8/2025 2:40:58 Partie Chicken, Low Cave

Hudson 11 Federal #2 1930 FNL' & 660' FEL Sec. 11-T18S-R31E UL T Lea County, NM API: 30-015-25740 CURRENT WELLBORE SCHEMATIC

Spudded: 7/1/2987

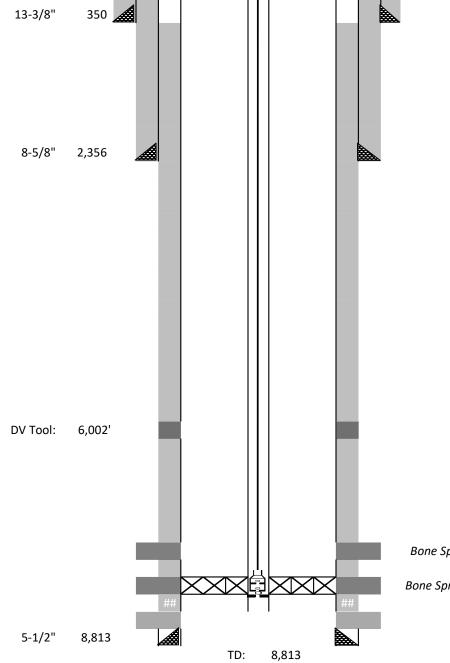

PBTD:

8,771

Bone Spring perfs (Abandoned) 7,934'-7,998'

Bone Springs Perfs (Abandoned) 8,050'-8,150'

Bone Springs Perfs 8,214'-8,695'

	Casing Information					
	Hole Size	Casing Size	Туре	Weight (lb/ft)	Joints	Depth Set
Surface	17-1/2"	13-3/8"		54.5#	-	350
Intermediate	11"	8-5/8"	J-55	24# & 32#		2,356
Production	7-7/8"	5-1/2"	J55	17#	217	8,813

	Cementing Record		
	Туре	TOC	Date Run
Surface	350 sks Cl C	Surface	7/1/1987
Intermediate	800 sks DLW III & 200 sks Class C	Surface	7/4/1987
Production	1985 sks	600	7/10/1984

	Tubing Detal	
Detail	Count	Depth
2-3/8"	271	
TAC	1	8,169'
SN	1	8,750'

TBG between TAC & SN. No details found.

Rod Detail				
Detail	Count			
7/8"	21			
3/4"	238			
7/8"	89			
2"x1.25"x24' Pump	1			

	Perforation Information	
Date	Formation	Depth
8/28/1987	Bone Spring perfs (Abandoned)	7,934'-7,998'
9/22/1987	Bone Springs Perfs	8,214'-8,695'
10/27/1993	Bone Springs Perfs (Abandoned)	8,050'-8,150'

Geologic Markers				
T. Salt	800			
Yates & B. Salt	2,302			
7 Rivers	2,730			
Queen	3,436			
Grayburg	3,964			
San Andres	4,252			
Bone Spring	5,798			

	Plugging Information	1
Date	Туре	Depth
9/24/1992	CIBP w/ 35sks cmt	8,390
	CIBP	8,190
7/17/2002	Squeezed 200 sks cmt to 7,934'-7,998' perfs & 8,050'-8,150' perfs.	TOC @8,159
7/23/2002	RBP (Pulled 7/26/2002)	8,729'

Released to Imaging: 4/10/2025 12:34:47 PM

Received by OCD: 4/8/2025 2:40:58 PM Page 7 of 15

Hudson 11 Federal #2 1930 FNL' & 660' FEL Sec. 11-T18S-R31E UL T

Lea County, NM API: 30-015-25740

CURRENT WELLBORE SCHEMATIC

Spudded: 7/1/2987

50 sks Class C

25 sks class C

95 sks class C

35 sks Class C

50 sks Class H

CIBP

TD: PBTD: 8,813

8,771

13-3/8"

8-5/8"

DV Tool:

5-1/2"

6,002

8,813

2,356

Casing Information Hole Size Weight (lb/ft) Casing Size Type Joints Depth Set Surface 54.5# 17-1/2" 13-3/8" 350 Intermediate 11" 8-5/8" J-55 24# & 32# 2,356 Production 7-7/8" 5-1/2" J55 17# 217 8,813

Plugged Well Marker 100': Perf @ 400' and attempt injection. If Established, squeeze sks class C cmt to surface on all strings. (Est. 238sks) 238 sks Class C If NO injection, drop to 450' and spot class C cmt to surf. (Est. 45sks) 35 sks class C

1100': Spot 25 sks class C cmt (Est. 495' / Req.989') (Top of Salt / Est. TOC) WOC and Tag

	Cementing Record		
	Туре	TOC	Date Run
Surface	350 sks Cl C	Surface	7/1/1987
Intermediate	800 sks DLW III & 200 sks Class C	Surface	7/4/1987
Production	1985 sks	600	7/10/1987

2,406': Perf @ 2,406' and attempt to circualte.

If established, squeeze 95 sks class C cmt (Est. 2,206' / Req.2,004') (Intermediate Shoe, Yates & B. Salt) WOC & Tag

If NO injection, drop to 2,460' and spot 40 sks class C cmt (Est. 2,103' / Req. 2,004) (Intermediate Shoe, Yates & B. Salt) WOC & Tag

2,780': Spot 25 sks class C cmt (Est. 2,527' / Req. 2,680') (7 Rivers)

4,302': Spot 95 sks class C cmt (Est. 3,341' / Req. 3,351') (San Andres, Grayburg, Queen) WOC and Tag

6,055': Spot 36 sks class C cmt (Est. 5,691' / Req. 5,748') (DV Tool, Bone Springs) WOC and Tag

Perforation Information Date Formation Depth 8/28/1987 Bone Spring perfs (Abandoned) 7,934'-7,998' 9/22/1987 Bone Springs Perfs 8,214'-8,695' 10/27/1993 8,050'-8,150' Bone Springs Perfs (Abandoned)

Geologic Markers		
T. Salt	800	
Yates & B. Salt	2,302	
7 Rivers	2,730	
Queen	3,436	
Grayburg	3,964	
San Andres	4,252	
Bone Spring	5,798	

Run RCBL to Surface.

Bone Spring perfs (Abandoned) 7,934'-7,998'

8,165': Spot 50 sks class H cmt on CIBP (Est. 7,759') (Open Perforations) WOC & Tag

Bone Springs Perfs (Abandoned) 8,050'-8,150'

CIBP @8,165'. Pressure test.

Bone Springs Perfs 8,214'-8,695'

Plugging Information	
Туре	Depth
CIBP w/ 35sks cmt (Drilled out)	8,390
CIBP (Drilled out)	8,190
Squeezed 200 sks cmt to 7,934'-7,998' perfs	TOC @8,159
& 8,050'-8,150' perfs.	100 @8,139
RBP (Pulled 7/26/2002)	8,729'
	Type CIBP w/ 35sks cmt (Drilled out) CIBP (Drilled out) Squeezed 200 sks cmt to 7,934'-7,998' perfs & 8,050'-8,150' perfs.

REVISED 1:09 pm, Apr 05, 2025

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Lea County, call 575-689-5981. Eddy County, please email notifications to: <u>BLM NM CFO PluggingNotifications@BLM.GOV</u>. The Eddy County inspector on call phone, 575-361-2822, will remain active as a secondary contact.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified BY PHONE (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing. The following information shall be permanently inscribed on the plate: well name and number, name of operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between

the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St.

620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.

For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well abandonment.

The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.

Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.

It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.

At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229 Stephanie McCarty Environmental Protection Specialist 575-234-5985

Jaden Johnston Environmental Protection Asst. (Intern) 575-234-6252

Sundry ID	2838804						
Plug Type	Тор	Bottom	Length	Tag	Sacks	Cement Class	Notes
Surface Plug	0.00	100.00	100.00	Tag/Verify			
					0.1.00		Perf and squeeze from 400' to surface. (In 40 sxs/Out 54
13.375 inch- Shoe Plug	296.50	400.00	103.50	Tag/Verify	94.00	С	sxs) Spot cement from 1100' to 989'. WOC
Top of Salt @ 1050	989.50	1100.00	110.50	Tag/Verify	25.00	С	and Tag.
Base of Salt @ 2075	2004.25		120.75	Tag/Verify			Ğ
Yates @ 2302	2228.98	2352.00	123.02	If solid			
8.625 inch- Shoe Plug	2282.44	2406.00	123.56	Tag/Verify	95.00	С	See procedure
Queen @ 3436	3351.64	3486.00		base no need to			
Queen @ 3436	3331.04	3400.00	134.30	rag			
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio			Spot cement from 4302' to 3351'.
Grayburg @ 3964	3874.36	4014.00	139.64	ns If solid	94.00	С	WOC and Tag.
Bonesprings @ 5798	5690.02	5848.00	157.98	base no			
DV tool plug	5891.98	6052.00	160.02	Tag/Verify	36.00	С	Spot cement from 6052' to 5690'. WOC and Tag.
CIBP Plug	8130.00	8165.00	35.00		45.00	Н	Set CIBP at 8165'. Leak test CIBP. Spot cement from 8165' to 7804'. WOC and Tag.
Perforations Plug (If No CIBP)	8164.00	8745.00	581.00	Tag/Verify	13.00		
5.5 inch- Shoe Plug	8674.87			Tag/Verify			

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole. Class H >7500' Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement Requirement:	<u>Low</u>		
13.375 inch- Shoe Plug @ 8.625 inch- Shoe Plug @ 5.5 inch- Shoe Plug @	350.00 2356.00 8813.00	тос @	600.00
Perforatons Top @	8214.00	Perforations	8695.00
DV Tool @	6002.00	CIBP @	8165.00

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 449939

CONDITIONS

Operator:	OGRID:
MATADOR PRODUCTION COMPANY	228937
One Lincoln Centre	Action Number:
Dallas, TX 75240	449939
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	4/10/2025
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	4/10/2025