

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

Online Phone Directory Visit:
<https://www.emnrd.nm.gov/ocd/contact-us/>

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

| | |
|--|--|
| WELL API NO. 30-025-00037 | |
| 5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/> | |
| 6. State Oil & Gas Lease No. | |
| 7. Lease Name or Unit Agreement Name New Mexico B State | |
| 8. Well Number 3 | |
| 9. OGRID Number 247692 | |
| 10. Pool name or Wildcat Mescalero Permo Penn | |
| 4. Well Location Unit Letter B : 319 feet from the North line and 2341 feet from the East line Section 27 Township 10 S Range 32 E NMPM County Lea | |
| 11. Elevation (Show whether DR, RKB, RT, GR, etc.) | |

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK PLUG AND ABANDON
TEMPORARILY ABANDON CHANGE PLANS
PULL OR ALTER CASING MULTIPLE COMPL
DOWNHOLE COMMINGLE
CLOSED-LOOP SYSTEM
OTHER:

SUBSEQUENT REPORT OF:

REMEDIAL WORK ALTERING CASING
COMMENCE DRILLING OPNS. P AND A
CASING/CEMENT JOB
OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

See attached:

Spud Date:

09/02/2025

Rig Release Date:

09/12/2025

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE



TITLE

Agent

DATE 01/27/2026

Type or print name Quang Truong
For State Use Only

E-mail address: qtriam@jaymgt.com

PHONE: 713-621-6785

APPROVED BY: _____ TITLE: _____ DATE: _____
Conditions of Approval (if any):

RIG 123

NM B #3 – JAY MANAGEMENT – START 9.2.25 LEA CTY NM

FINISH 9.12.25

API# 30-025-00037

9.2.25

DROVE TO LOCATION

SPOT BASE BEAM AND RIG #123

CHK WELL PRESSURE '0' PSI

DIG 3' FT IN SELLER INSTALL 2" SURFACE VALVE REMOVE TBG HEAD CAP POOH LD 3" JNT CK ID IN
CASING NOT 5.5 CSG IT'S 7 5/8 ND TBG HEAD CHECK PRODUCTION CSG CONFIRM SIZE 7 5/8 INSTAL
CSG HEAD BACK

TRAVEL

9.3.25

DROVE TO LOCATION

HOLD TGSM

RU AAA WIRELINE RIH W/6.1 GAGE RING TAG @ 4300' COULDN'T GO PASS POOH PU 4.6 GAGE RING
FOR 5.5 CSG RIH DOWN TO @8270 POOH PICK UP 5.5 SIBP RIH SET @ 8270' RDWL OCD MR. R.

TRUJILLO

PICK UP BOP NU WORK ON RD 4" LINE CONNECTED TO THE WELL HEAD

RU FLOOR & TBG EQUIPMENT WORK ON BJ TONGS REPLACE HYDRAULIC HOSES

PU RIH W/70 JNS OF 2 3/8 TCH DOWN TO @2290' SECURE WELL & LOCATION SDFN

TRAVEL TO MOTEL

9.4.25

DROVE TO LOCATION

HOLD TGSM

RIH PU TOTAL OF 253 JNS 2 3/8 TBG TAG CIBP @8270'

WORK ON PUMP AND SENTRIFUGAL PUMP

LOAD HOLE W/170 BBL OF MLF MUD CIRCULATE TO SURFACE WITH 278 BBL

ATTEMPT TO PRESSURE TEST PUMP 10 BBL MUD DO NOT HOLD PRESSURE

PLUG #1

POOH STAND BACK 35 STDS TO @5641' CALL OCD MR. TRUJILLO APPROVE TO TAG PLUG

ATTEMPT TO REVERSE CIRCULATE PUMP 80 BBL 9.5# MLF MUD LOST RETURNS DO NOT LOAD HOLE
SECURE WELL & LOCATION SDFN

TRAVEL TO MOTEL

9.5.25

DROVE TO LOCATION

HOLD TGSM

CHECK WELL PRESSURE '0' PSI, RIH W/35 STDS PU 11 JNS TO @8290' DO NOT TAG CIBP, CALL OCD 8:20 AM MR. TRUJILLO APPROVE TO SET CIBP @8250'

POOH STAND BACK 126 STDS

WO WL

RU AAA WL MAKE UP 5.5 CIBP RIH ATTEMPT TO SET IT POOH MISSED RUN WORK ON WARNING CONNECTIONS MAKE UP CIBP

RIH W/5.5 CIBP AND SET @8250' POOH RD WL SECURE WELL & LOCATION SDFD

TRAVEL TO YARD

9.8.25

TRAVEL TO LOCATION

TGSM

CHECK WELL PRESSURE '0' PSI W/126 STDS TAG CIBP @ 8250'

LOAD HOLE W/190 BBL OF CBL MUD CIRCULATE TO SURFACE W/280 BBL

TEST PLUG W/600 PSI HOLD PRESSURE

PLUG #1 A

POOH STAND BACK 125 STDS SECURE WELL & LOCATION SDFN

TRAVEL TO MOTEL

9.9.25

DROVE TO LOCATION

RU AAA WL RIH LOG CBL FROM 8050' UP TO SURFACE

MR. ROBERT TRUJILLO W/OCD APPROVE TO SPOT THE PLUGS ALL W/25 SKS AND COMVINE THE 8440' TO 4450 W/40 SKS THE 1575' W/30 SKS FROM 505' UP TO SURFACE

RIH W/122 STDS PU 1 JNT TO EOT @ 8030' LOAD HOLE W/3 BBL MUD

PLUG #2

POOH LD 30 JNS TO EOT @ 7043' PU 10' FT SUB TO 7053' LOAD HOLE W/5 BBL

PLUG #3

POOH LD 67 JNS TO EOT @4852' LOAD HOLE W/7 BBL MUD REVERSE CIRCULATE PUMP 25 BBL MUD

TRAVEL TO MOTEL

9.10.25

TRAVEL TO LOCATION

TGSM

LOAD HOLE W/2 BBL MUD PLUG #4

POOH LD 43 JNS TO EOT @3443' LOAD HOLE W/4 BBL MUD

PLUG #5

POOH LD 57 JNS TO EOT @1577 LOAD HOLE W/7 BBL MUD

PLUG #6

POOH LD 32 JNS TO EOT @524' LOAD HOLE W/4 BBL MUD

PLUG #7

POOH LD 16 JNS WASH TUBING & EQUIPMENT FROM CEMENT

RD FLOOR & TBG EQUIPMENT, ND BOP LOAD CEMENT TO TOP, SECURE WELL & LOCATION SDFD

TRAVEL TO MOTEL

9.11.25

TRAVEL TO LOCATION

TGSM

RDSU RINSE RIG CLEAN READY TO MOVE

PICK UP PUMP AND RINSE CLEAN READY TO MOVE

DIG SELLAR STARTED CUT OFF CASING HEAD TORCH BROKE COULDN'T FINISH CUT OFF SECURE WELL & LOCATION SDFD

TRAVEL TO MOTEL

9.12.25

TRAVEL TO LOCATION

FINISH CUT OFF CASING HEAD WELD PLATE AND PIPE W/INFORMATION OF THE WELL AND SLIVE W/CEMENT


COVER WELL LEVEL LOCATION SDFD

TRAVEL TO YARD



Jay Management Company

Current WB Diagram

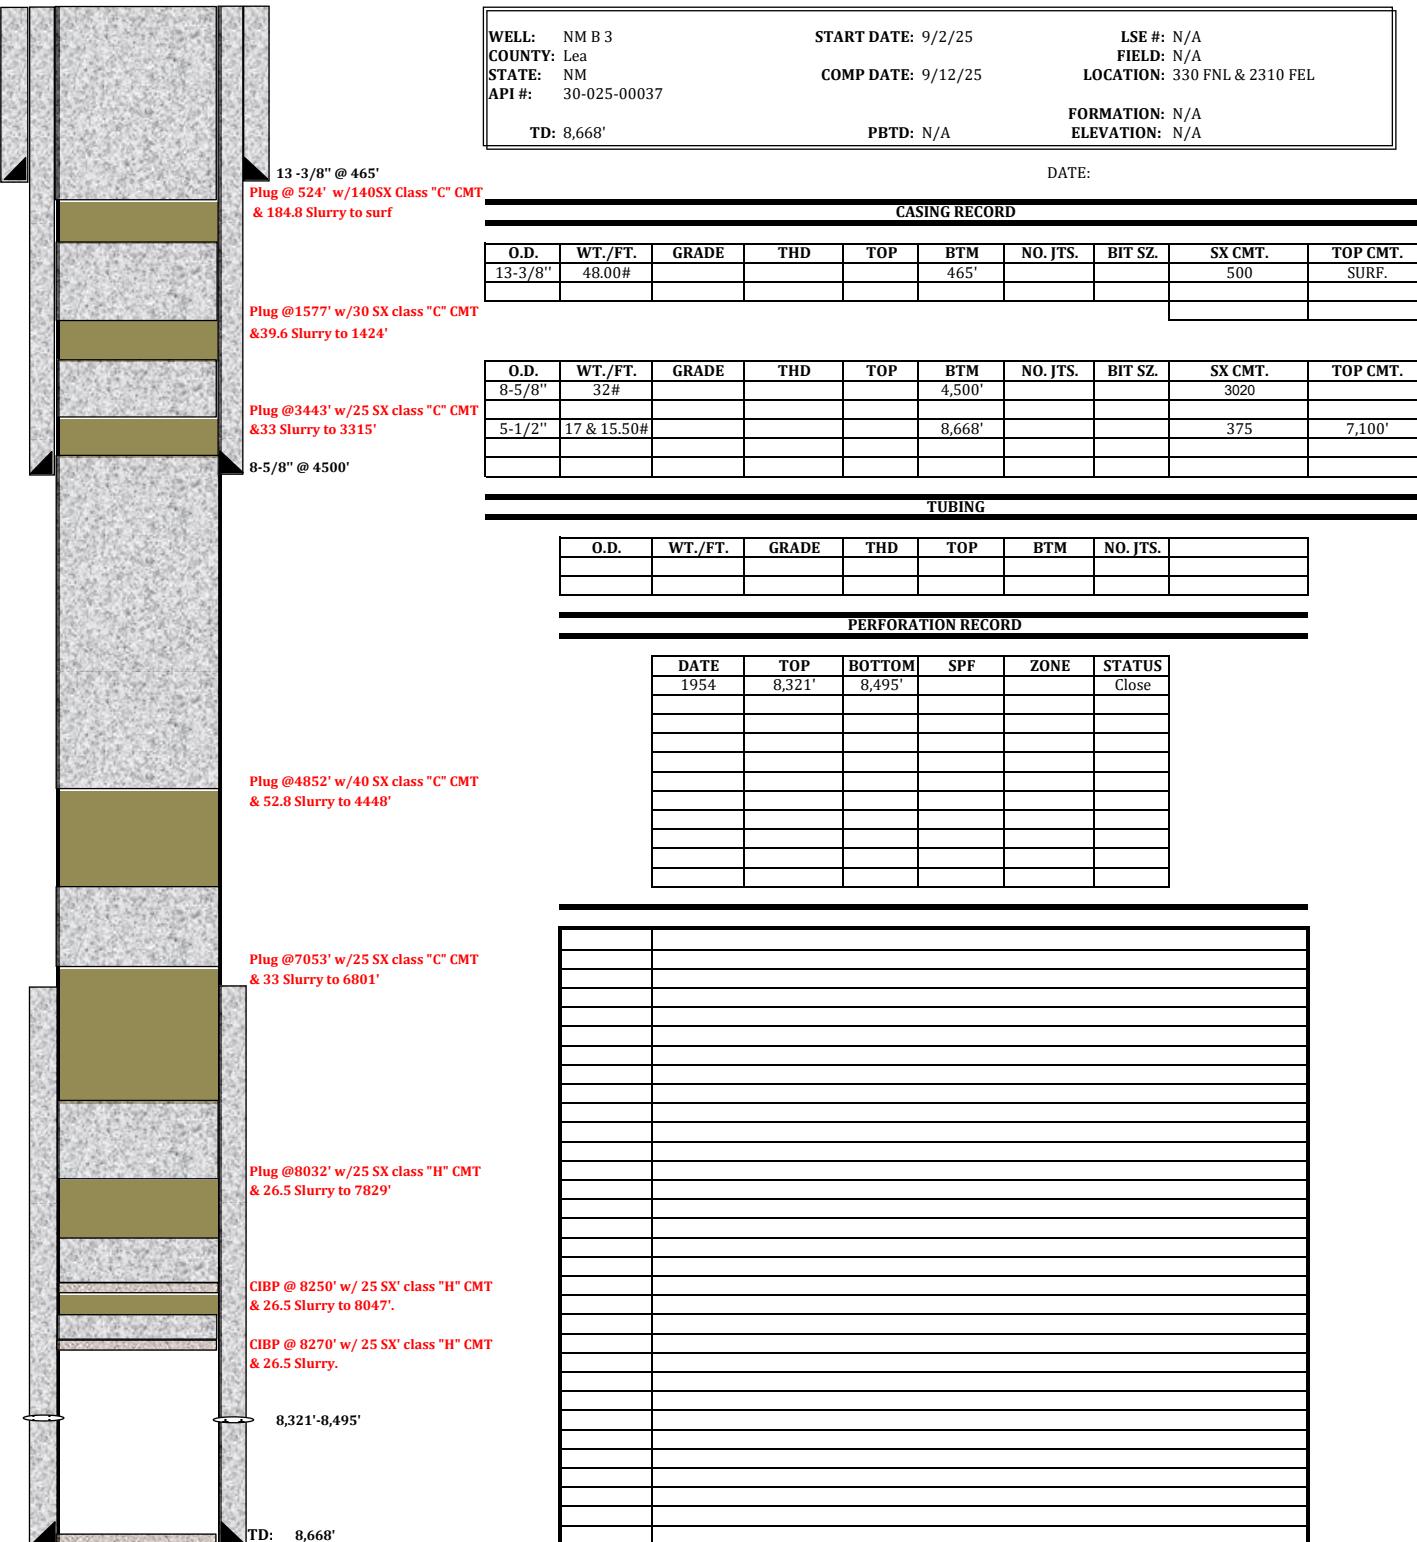

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 546678

CONDITIONS

| | |
|---|--|
| Operator: JAY MANAGEMENT COMPANY, LLC 2401 Fountain View Drive Houston, TX 77057 | OGRID: 247692 |
| | Action Number: 546678 |
| | Action Type: [C-103] Sub. Plugging (C-103P) |

CONDITIONS

| Created By | Condition | Condition Date |
|------------|---|----------------|
| gcordero | Clean Location in accordance with 19.15.25.10 NMAC. | 1/29/2026 |
| gcordero | Submit C-103Q within one year of plugging. | 1/29/2026 |