

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

State of New Mexico
Energy, Minerals and Natural Resources

Online Phone Directory Visit:
<https://www.emnrd.nm.gov/ocd/contact-us/>

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-23338
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Jay Management Company, LLC		6. State Oil & Gas Lease No.
3. Address of Operator 2401 Fountain View Drive, Suite 420, Houston, TX 77057		7. Lease Name or Unit Agreement Name Warren A State
4. Well Location Unit Letter <u>I</u> : <u>2125</u> feet from the <u>South</u> line and <u>660</u> feet from the <u>East</u> line Section <u>28</u> Township <u>11 S</u> Range <u>33 E</u> NMPM County		8. Well Number <u>1</u>
		9. OGRID Number 247692
		10. Pool name or Wildcat Bagley Permo Penn North
		11. Elevation (Show whether DR, RKB, RT, GR, etc.) 4264.5 GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

See attached

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE Agent DATE 03/19/2026

Type or print name Quang Truong E-mail address: qtram@jaymgt.com PHONE: 713-621-6785

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____
Conditions of Approval (if any): _____

RIG 110

WARREN A STATE #1 – JAY MGMNT – START 11.7.24 FINISH 11.21.24

API# 30-025-23338

11.7.24

DROVE TO LOCATION

HOLD TGSM

GET EQUIPMENT READY AND MOVED FROM ENFIELD # 1 TO WARREN A STATE # 1 6 MILES AWAY

SPOT BASE BEAM RUSU AND ALL EQUIPMENT

N/D WELL HEAD N/U BOP RIG UP FLOOR AND TBG EQUIPMENT

WAIT ON WIRE LINE

RIG UP AAA WIRE LINE RIH W/ GAUGE RING TAG TIGHT SPOT AT 2258 TRY TO PASS THROUGH STACKED

OUT POOH AND RUN BACK W/ WEIGHT BARS TAG AT SAME SPOT POOH RIG DOWN AAA WIRE LINE

SECURE WELL SDFN

TRAVEL HOME

11.8.24

DROVE TO LOCATION

HOLD TGSM

WAIT ON BAD WEATHER

LOAD TBG 310 JTS ON ENFIELD #1 AND MOVED TO WARREN A STATE # 1 TRY TO GETTED SPOT TRUCKS

GET STUCK LOCATION TO WET SDFN

TRAVEL HOME

11.11.24

DROVE TO LOCATION

HOLD TGSM

WORK TO GET TBG TRAILER UNSTUCK AND SPOTTED

MIRU DRILL BIT AND BIT SUB RIH W/ 69 JTS PASS TIGHT SPOT AT 2258 AND PICK UP 6 JTS MORE TO EOT AT 2449

POOH W/ 75 JTS

RIG UP CASING SCRAPER AND DRILL BIT RIH TO EOT AT 2542 W/ 78 JTS

POOH W/78 JTS LAY DOWN SCRAPER

RIG UP DRILL BIT AND BIT SUB RIH W/ 78 JTS TO EOT AT 2547

WORK W/ TONGS MAKE 3 FT

POOH W/ 78 JTS AND BIT LOAD HOLE W/40 BBLs OF FRESH WATER SECURE WELL SECURE WELL SDFN

TRAVEL HOME

11.12.24

DROVE TO LOCATION

HOLD TGSM CHK PRESSURE 4 1/2 CASING 0 Psi SURFACE 200 PSI
MIRU NOTCH COLLAR RIH W/ 85 JTS AT 2776 FALL DOWN 288 FT
TURN W/ TONGS PASS BRDGE PUMP 40 BBLS OF FRESH WATER WELL ON VACUMM
CONTINUE RIH W/ 164 AT 5356 TAG TIGHE SPOT AGAIN
PUMP 80 BBLS FRESH WATER
WORK TO PASS BRIDGE NO LUCK
POOH W/164 JTS
RIG UP DRILL BIT BIT SUB AND CASING SCRAPER RIH W/ 85 JTS WORK TO PASS THROUGH TIGHT SPOT
AND CONTINUE RIH TO EOT AT 5323
POOH W/ 163 JTS LAY DOWN BIT AND SCRAPER
RIG UP 4 1/2 PCKER RIH W/ 163 JTS TO EOT AT 5323 SECURE WELL SDFN TRAVEL
HOME

11.13.24

DROVE TO L;OCATION
HOLD TGSM
LOAD HOLE PUMP 25 BBLS DOWN TBG PUMP 130 BBLS DOWN CASING WELL ON VACUMM
POOH W/ 163 JTS AND PKR SECURE WELL
TRAVEL HOME

11.14.24

DROVE TO LOCATION
HOLD TGSM
MIRU AAA WIRE LINE RIH W/ CICR TAG TIGHT SPOT AT 2767 POOH RIG DOWN AAA WIRE LINE
MIRU DRILL BIT SUB AND 4.5 SCRAPER RIH TO TIGHT SPOT AT 2763 WORK TO PASS THROUGH TIGHT
SPOT EVERY TIME HAVE TO TURN TO PASS THROUGH TIGHT SPOT WAIT ON ORDERS

POOH W/ 85 JTS AND LAY DOWN BIT AND SCRAPER
CHANGE RUBBERS ON 4.5 PKR
MIRU 4.5 PACKER RIH TO EOT AT 5000
PUMP 50 BBLS OF FRESH WATER
PLU # 1MIX & PUMP 430 SXS SECURE WELL SDFN
TRAVEL HOME

11.15.24

DROVE TO LOCATION
HOLD TGSM PUMP 150 BBLS OF FRESH WATER WELL ON VACUMM
PLUG # 1-A MIX & PUMP 110 SXS CLOSE PRESSURE 1400 PSI WOC
BLEED OFF PRESSURE POOH W/ 153 JTS PKR (PACKER DAMAGED) SECURE WELL SDFN

TRAVEL HOME

11.18.24

DROVE TO LOCATION

HOLD TGSM

MIRU 4.5 PKR RIH W/ 149 TO EOT AT 4866 SET PKR

MIRU AAA WIRE LINE RIH W/ PERFORATING GUNS TAG PLUG # 1 AT 5207 PULL TO 5160 SHOT 4.5

CASING POOH RIG DOWN AAA WIRE LINE

GET INJECTION RATE 2X MINUTE AT 400 PSI PLUG # 2 MIX & PUMP 65 SXS WOC

WOC

RIH W/ 6 JTS TAG PLUG # 2 AT 5030 POOH LAY DOWN 43 JTS TO EOT AT 3461

RIG UP AAA WIRE LINE RIH W/ PERFORATING GUNS SHOT 4.5 CASING AT 3800 POOH RIG DOWN AAA

WIRE LINE

GET INJECTION RATE PRESSURE UP TO 1000 PSI BLEED OFF PRESSURE RIH W/ 6 STANDS TO EOT AT 3853

PLUG # 3 MIX & PUMP 25 SXS

POOH W/ 30 STANDS SECURE WELL SDFN

TRAVEL TO HOTEL

11.19.24

DROVE TO AAA SAFETY MEETING

HOLD AAA SAFETY MEETING

DROVE TO LOCATION

RIH W/ 25 STANDS TAG PLUG # 3 AT 3430 POOH LAY DONW 54 JTS TO EOT AT 2090 SET PKR

MIRU AAA WIRE LINE RIH W/ PERFORATING GUNS SHOT 4.5 CASING AT 2485 POOH RIG DOWN AAA

WIRE LINE

GET INJECTION RATE 2 X MINUTE @ 300 PSI PLUG # 4 MIX & PUMP 65 SXS WOC

RIH W/ 6 JTS TAG PLUG # 4 AT 2287 POOH LAY W/20 JTS TO EOT AT 1437

RIG UP AAA WIRE LINE SHOT 4.5 CASING AT 1805 POOH RIG DOWN WIRE LINE

GET INJECTION RATE 2 X MINUTE @ 200 PSI PLUG # 5 MIX & PUMP 65 SXS

POOH W/ 24 STANDS RIG UP AAA WIRE LINE RIH W/ PERFORATING GUNS SHOT 4.5 CASING 426 POOH

RIG DOWN AAA WIRE LINE SDFN

TRAVEL HOTEL

11.20.24

DROVE TO LOCATION

HOLD TGSM

RIH W/ 19 STANDS TAG PLUG # 5 AT 1630 POOH LAY DOWN / 34 JTS TO EOT AT 326

SET PKR GET INJECTION RATE 2 X MINUTE AT 100 PSI UNSET PKR POOH LAY DOWN 10 JTS

PLUG # 6 MIX & PUMP 120 SXS

RIG DOWN TBG EQUIPMENT AND FLOOR N/D BOP

RDSU AND ALL EQUIPMENT

11.21.24


DIG SELLER CUT WELL HEAD INSTALL DRY HOLE MARKER MIX CMT LEVEL LOCATION

Unit Letter I, 2125' South , 660' East
Sect 28, Township 11S, Range 33E NMPM
Lea Co, NM ()
API No. 30-025-23338

Jay Management Company, LLC
2401 Fountain View, Suite 420
Houston, TX 77057

Slurp Cons: 13-3/8" set at
Cmnt w/ 400sx Class x to Surface 376 376

Int Cons: 8-5/8" set at
Cmnt w/ 200sx Class x to Surface 3750 3750

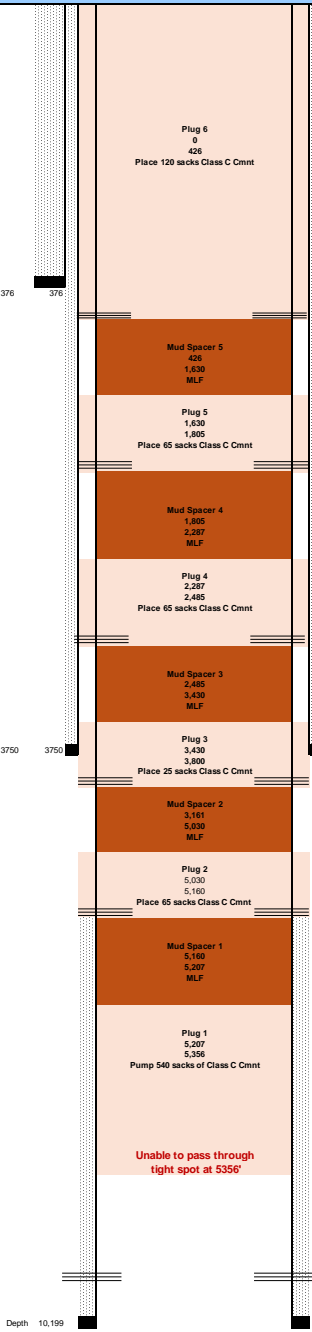

Plug 6		
ft	bbf	sacks
426	7	120

manual entry

Mud Spacer 5		
ft	bbf	sacks
1,204	20	

Plug 5		
ft	bbf	sacks
175	3	65

manual entry

Mud Spacer 4		
ft	bbf	sacks
482	8	

Plug 4		
ft	bbf	sacks
198	3	65

manual entry

Mud Spacer 3		
ft	bbf	sacks
945	15	

Plug 3		
ft	bbf	sacks
370	6	25

manual entry

Mud Spacer 2		
ft	bbf	sacks
1869	30	

Plug 2		
ft	bbf	sacks
130	2	65

manual entry

Mud Spacer 1		
ft	bbf	sacks
47	1	

Plug 1		
ft	bbf	sacks
149	2	540

manual entry

bbf to load well	total mud used	total class H sx of Cmnt	total class C sx of Cmnt
87,12196346	87,12196346		880

Unable to pass through
tight spot at 5356'

Perfs	Top	Bottom
	9,768	10,199

Prod Cons:	ID (in)	Weight #	Grade	Depth
Cmnt w/ 550sx Class x to Surface	4-1/2"	9	H-40	10,199

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 564621

CONDITIONS

Operator: JAY MANAGEMENT COMPANY, LLC 2401 Fountain View Drive Houston, TX 77057	OGRID: 247692
	Action Number: 564621
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	Clean Location in accordance with 19.15.25.10 NMAC.	3/19/2026
gcordero	Submit C-103Q within one year of plugging.	3/19/2026