

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

Initial Report Final Report

Name of Company St. Mary Land & Exploration Co.	Contact Donna Huddleston
Address 3300 N. A Street, Bldg. 7, Ste. 200 Midland, Tx	Telephone No. (432) 688-1789
Facility Name ESDU Injection Station	Facility Type Injection Station

Surface Owner: BLM	Mineral Owner: BLM	Lease No.
---------------------------	---------------------------	-----------

LOCATION OF RELEASE

Unit Letter A	Section 24	Township 18S	Range 31E	Feet from the	North/South Line	Feet from the	East/West Line	County Eddy
-------------------------	----------------------	------------------------	---------------------	---------------	------------------	---------------	----------------	-----------------------

Latitude N 32.736941° Longitude W 103.81544°

NATURE OF RELEASE

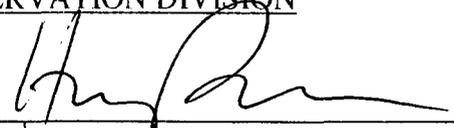
Type of Release: Produced Water	Volume of Release 200 bbls	Volume Recovered 0 bbls
Source of Release: Injection line at the Wellhead.	Date and Hour of Occurrence 11/11/2009	Date and Hour of Discovery 11/11/2009 6:30 p.m.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Jim Amos-BLM & Darold Gray-NMOCD	
By Whom? Bill Hearne	Date and Hour 11/11/2009 8:25 p.m.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A	

If a Watercourse was Impacted, Describe Fully.*
N/A

Describe Cause of Problem and Remedial Action Taken.*
Discovered steel (IPC) 2 3/8" 8rd X 2" 11 1/2 V thread changeover had failed due to external corrosion. Shut down injection pumps and closed off tanks. Closed trunk line valve, feeding injection line lateral, to shut off leak. Broke out failed connection and replaced with stainless steel changeover.

Describe Area Affected and Cleanup Action Taken.*
Tetra Tech inspected site and collected samples to define the spills extent. Soil that exceeded RRAL was removed and hauled away for proper disposal. Site was then brought up to surface grade with clean backfill material. Tetra Tech prepared closure report and submitted to NMOCD for review.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:		OIL CONSERVATION DIVISION	
Printed Name: Aaron Hale		Approved by District Supervisor: 	
Title: Project Manager		Approval Date: 7/20/15	Expiration Date: N/A
E-mail Address: aaron.hale@tetratech.com		Conditions of Approval: Final	Attached <input type="checkbox"/>
Date:	Phone: (432) 682-4559		

* Attach Additional Sheets If Necessary

28D-365