

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1000 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company: Targa Midstream Services L P	Contact: Tim Jordan or Ralph England
Address: PO Box 1689 Lovington, NM 88260	Telephone No. (575) 396-3221
Facility Name: Saunders Plant	Facility Type: Gas Processing Plant

Surface Owner: Etcheverry (West)	Mineral Owner:	Lease No.
-------------------------------------	----------------	-----------

LOCATION OF RELEASE

Unit Letter A	Section 1	Township 15S	Range 33E	Feet from the	North/South Line	Feet from the	East/West Line	County Lea
------------------	--------------	-----------------	--------------	---------------	------------------	---------------	----------------	---------------

Latitude N33.05066 Longitude W103.56724

NATURE OF RELEASE

Type of Release: Natural Gas and Produced Liquid	Volume of Release: Approximately 14.15 mcf of raw gas and unknown amount of Produced liquid.	Volume Recovered: 0
Source of Release: Hole in 4" Pipeline with 14 psig of pressure passing about 70mcf of natural gas with containing 2500ppm of H2S. Line has been taken out of service.	Date and Hour of Occurrence: Not sure	Date and Hour of Discovery 05/05/09 Line monitor aircraft discovered leak
Was Immediate Notice Given? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	
By Whom?	Date and Hour	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*



Describe Cause of Problem and Remedial Action Taken. *

A 4 inch gathering line had a leak and released gas and any produced liquids that were lying in the line. Line was repaired with clamp. Line has been taken out of service to prevent future contamination. Contaminated soil will be hauled to an approved landfill. Area will be cleaned to meet OCD guidelines. Line monitor aircraft discovered leak.

Describe Area Affected and Cleanup Action Taken.*

Targa has excavated the contaminated area from leak to include runoff. Contaminated soil has been hauled to an approved landfarm. Targa purchased soil from Landowner to fill excavation after approval to close.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

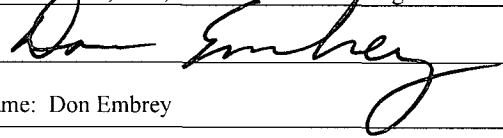Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Don Embrey	Approved by ENV. ENGINEER:  District Supervisor:	
Title: Training Specialist	Approval Date: <u>09/28/09</u>	Expiration Date: <u>-</u>
E-mail Address: dembrey@targaresources.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 08/05/09 Phone: (432) 688-0546	IRP-09-6-2202	

* Attach Additional Sheets If Necessary

District I
1625 N. French Dr. Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

RECEIVED

JUN 11 2009

HOBBS

Form C-141
Revised October 10, 2003
Submit 3 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company: Targa Midstream Services L P	Contact: Tim Jordan or Ralph England	
Address: PO Box 1689 Lovington, NM 88260	Telephone No. (575) 396-3221	
Facility Name: Saunders Plant	Facility Type: Gas Processing Plant	
Surface Owner: Etcheverry (West)	Mineral Owner:	Lease No.

LOCATION OF RELEASE

Unit Letter A	Section I	Township 15S	Range 33E	Feet from the	North/South Line	Feet from the	East/West Line	County Lea
------------------	--------------	-----------------	--------------	---------------	------------------	---------------	----------------	---------------

Latitude N33.05066 Longitude W103.56724

NATURE OF RELEASE


Type of Release: Natural Gas and Produced Liquid	Volume of Release: Approximately 14.15 mcf of raw gas and unknown amount of Produced liquid.	Volume Recovered: 0
Source of Release. Hole in 4" Pipeline with 14 psig of pressure passing about 70mcf of natural gas with containing 2500ppm of H2S. Line has been taken out of service.	Date and Hour of Occurrence: Not sure	Date and Hour of Discovery 05/05/09 Line monitor aircraft discovered leak.
Was Immediate Notice Given? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES. To Whom?	
By Whom?	Date and Hour	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	
If a Watercourse was Impacted. Describe Fully.*		
Describe Cause of Problem and Remedial Action Taken.* A 4 inch gathering line had a leak and released gas and any produced liquids that were lying in the line. Line was repaired with clamp. Line has been taken out of service to prevent future contamination. Contaminated soil will be hauled to an approved landfill. Area will be cleaned to meet OCD guidelines. Line monitor aircraft discovered leak.		
Describe Area Affected and Cleanup Action Taken.* Targa will excavate the contaminated area from leak to include runoff. Contaminated soil will be hauled to an approved landfarm.		
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.		
Signature <i>Don Embrey</i>	OIL CONSERVATION DIVISION	
Printed Name: Don Embrey	Approved by District Supervisor <i>J. Johnson</i>	
Title: Training Specialist	ENVIRONMENTAL ENGINEER	
E-mail Address: dembrey@targaresources.com	Approval Date: 6.11.09	Expiration Date: 9.11.09
Date: 06/09/09 Phone: (432) 688-0546	Conditions of Approval:	Attached <input type="checkbox"/>
		IRP # 09-6-2202

* Attach Additional Sheets If Necessary

FGRL 09 1635 6811


ETCHEVERRY WEST

SAMPLE DATE	SAMPLE I.D.	SOIL STATUS	TPH GRO	TPH DRO	CHLORIDE
6/8/2009	#1 West	Excavated	<10	23.9	<16
6/8/2009	#2 Middle	Excavated	12.6	3220	1020
6/8/2009	#3 East	Excavated	361	995	160
6/8/2009	Composite	Excavated	<10	356	672
6/25/2009	#5 Clamp (Middle)	Excavated	<10	73.1	112
6/25/2009	#6 East	In Situ	<10	<10	48
7/27/2009	#7 Clamp (Middle)	In Situ	<10	22.6	<16
7/27/2009	#8 West	In Situ	<10	<10	<16

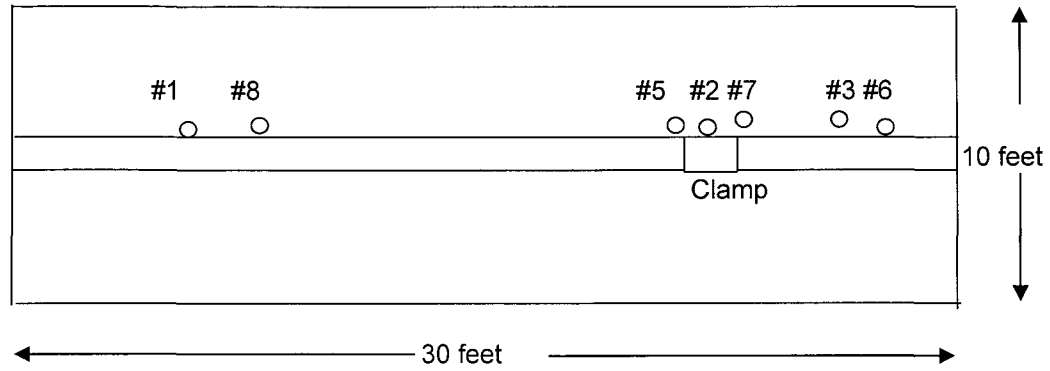



PHONE (575) 393-2326 • 101 E MARLAND • HOBBS, NM 88240

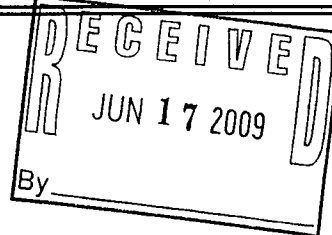

ANALYTICAL RESULTS FOR
TARGA
ATTN: DON EMBREY
6 DESTA DRIVE, SUITE 3300
MIDLAND, TX 79705
FAX TO: (432) 688-0552

Receiving Date: 06/08/09
Reporting Date: 06/10/09
Project Number: NOT GIVEN
Project Name: NOT GIVEN
Project Location: ECHEBERRY


Sampling Date: 06/08/09
Sample Type: SOIL
Sample Condition: INTACT @ 12°C
Sample Received By: ML
Analyzed By: AB/HM


LAB NUMBER	SAMPLE ID	GRO	DRO	*Cl ⁻
		(C ₆ -C ₁₀) (mg/kg)	(>C ₁₀ -C ₂₈) (mg/kg)	(mg/kg)
ANALYSIS DATE		06/09/09	06/09/09	06/09/09
H17578-1	W. EX WEST	<10.0	23.9	<16
H17578-2	W. EX MIDDLE	12.6	3,220	1,020
H17578-3	W. EX EAST	361	995	160
H17578-4	W. EX COMPOSITE	<10.0	356	672
H17578-5	M. EX CLAMP	368	2,000	288
H17578-6	M. EX NORTH CLAMP	<10.0	24.8	<16
H17578-7	E. EX CLAMP	17.2	364	192
Quality Control		538	539	490
True Value QC		500	500	500
% Recovery		108	108	98.0
Relative Percent Difference		3.8	0.8	2.0

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; Cl⁻: Std. Methods 4500-Cl⁻B

*Analyses performed on 1:4 w:v aqueous extracts. Reported on wet weight.

Surrogate for H17578-1 outside historical limits due to matrix interference.

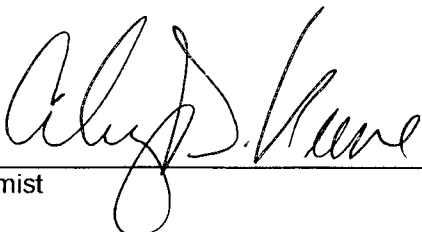
Chemist


Date

H17578 TCL TARGA

PLEASE NOTE **Liability and Damages.** Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



CARDINAL LABORATORIES

101 East Marland, Hobbs, NM 88240

(575) 393-2326 Fax (575) 393-2476

Page ____ of ____

Company Name: TARGA Project Manager: Don Embrey Address: 6 Desta Drive Suite 3300 City: MIDLAND State: TX Zip: 79705 Phone #: 432-688-0546 Fax #: 432-688-0552 Project #: Project Owner: Project Name: Project Location: Echeberry Sampler Name: Don Embrey				BILL TO P.O. #: Company: TARGA Attn: Address: P.O. Box 1689 City: Lovington State: NM Zip: 88260 Phone #: Fax #:				ANALYSIS REQUEST																
FOR LAB USE ONLY																								
Lab I.D.	Sample I.D.	(G)RAB OR (C)OMP.	# CONTAINERS	GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE	OTHER	ACID/BASE	ICE / COOL	OTHER	DATE	TIME										
H1758-1	W. Ex West		1			✓							6-8-09	10:45	✓	✓								
-2	W. Ex MIDDLE		1			✓								10:45	✓	✓								
-3	W. Ex East		1			✓								10:45	✓	✓								
-4	W. Ex Composite		1			✓								10:45	✓	✓								
-5	M. Ex Clamp		1			✓								11:00	✓	✓								
-6	M. Ex North Clamp		1			✓								11:00	✓	✓								
-7	E. Ex Clamps		1			✓								11:15	✓	✓								

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analyses. All claims including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.

Sampler Relinquished: Date: _____ Time: _____		Received By: Date: 6-8-09 Time: 2:15 <i>[Signature]</i>		Phone Result: <input type="checkbox"/> No Fax Result: <input type="checkbox"/> No REMARKS:		Add'l Phone #: Add'l Fax #:	
Relinquished By: <i>[Signature]</i>		Received By: <i>[Signature]</i>					
Delivered By: (Circle One) Sampler - UPS - Bus - Other:		Temp. 12°C Sample Condition: Cool Intact <input type="checkbox"/> Yes <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> No		CHECKED BY: (Initials) <i>[Signature]</i>			

† Cardinal cannot accept verbal changes. Please fax written changes to 575-393-2476.

* samples in cool w/ blue packs




ARDINAL LABORATORIES

PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

June 29, 2009

Don Embrey
Targa
6 Desta Drive Suite 3300
Midland, TX 79705

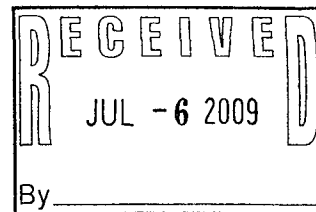

Re: Etcheverry West

Enclosed are the results of analyses for sample number H17702, received by the laboratory on 06/25/09 at 12:39 pm.

Cardinal Laboratories is accredited through Texas NELAP for:

Method SW-846 8021	Benzene, Toluene, Ethyl Benzene, and Total Xylenes
Method SW-846 8260	Benzene, Toluene, Ethyl Benzene, and Total Xylenes
Method TX 1005	Total Petroleum Hydrocarbons

Certificate number T104704398-08-TX. Accreditation applies to solid and chemical materials and non-potable water matrices.

Total Number of Pages of Report: 3 (includes Chain of Custody)

Sincerely,

Celey D. Keene
Laboratory Director

This report conforms with NELAP requirements.



ANALYTICAL RESULTS FOR
TARGA
ATTN: DON EMBREY
6 DESTA DRIVE SUITE 3300
MIDLAND, TX 79705
FAX TO: (432) 688-0552

Sampling Date: 06/25/09
Sample Type: SOIL
Sample Condition: COOL & INTACT @ 6°C
Sample Received By: ML
Analyzed By: AB/HM

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; Cl⁻: Std. Methods 4500-Cl⁻B

*Analyses performed on 1:4 w:v aqueous extracts. Reported on wet weight.

****Surrogates outside historical limits for H17702-2 due to matrix interference.**

Date

H17702 TCL TARGA

PLEASE NOTE **Liability and Damages** **Cardinal's** liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by **Cardinal** within thirty (30) days after completion of the applicable service. In no event shall **Cardinal** be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by **Cardinal**, regardless of whether such claim is based upon any of the above-stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

**CARDINAL LABORATORIES**

101 East Marland, Hobbs, NM 88240

(575) 393-2326 Fax (575) 393-2476

Page ____ of ____

Company Name: TARGA				BILL TO				ANALYSIS REQUEST																								
Project Manager: Don Embrey				P.O. #:				<div>TPH 8013 C1</div>																								
Address: 6 Delta Drive Suite 3300				Company: TARGA																												
City: MIDLAND State: TX Zip: 79705				Attn: Ralph England																												
Phone #: Fax #:				Address: PO Box 1689																												
Project #: Project Owner:				City: Louington																												
Project Name: Etcheberry West				State: NM Zip: 88260																												
Project Location:				Phone #:																												
Sampler Name: Don Embrey				Fax #:																												
FOR LAB USE ONLY		Lab I.D.		Sample I.D.		(G)RAB OR (C)OMP.	# CONTAINERS	MATRIX				PRESERV.		SAMPLING																		
								GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE	OTHER	ACID/BASE	ICE / COOL	OTHER	DATE	TIME														
H17702-1		E. West Clamp		G		1				✓				✓			6/25/09	9:30	XX	XX												
-2		E. West EAST END		G		1				✓				✓				1	XX	XX												

PLEASE NOTE: Liability and Damages: Cardinal's liability and client's exclusive remedy for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.

Sampler Relinquished By:		Date: 6-26-09	Received By:		Phone Result: <input type="checkbox"/> No	Add'l Phone #:
Relinquished By:		Time: 12:39	Received By:		Fax Result: <input type="checkbox"/> No	Add'l Fax #:
		Date:			REMARKS:	
Time:						
Delivered By: (Circle One)			Temp.	Sample Condition	CHECKED BY:	
Sampler - UPS - Bus - Other:			60C	Cool Intact <input checked="" type="checkbox"/> Yes <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> No		

† Cardinal cannot accept verbal changes. Please fax written changes to 575-393-2476.

**ARDINAL
LABORATORIES**PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

July 28, 2009

Don Embrey
Targa Resources
6 Desta Drive Suite 3300
Midland, TX 79705

Re: Etcheverry

Enclosed are the results of analyses for sample number H17874, received by the laboratory on 07/27/09 at 12:15 pm.

Cardinal Laboratories is accredited through Texas NELAP for:

Method SW-846 8021	Benzene, Toluene, Ethyl Benzene, and Total Xylenes
Method SW-846 8260	Benzene, Toluene, Ethyl Benzene, and Total Xylenes
Method TX 1005	Total Petroleum Hydrocarbons

Certificate number T104704398-08-TX. Accreditation applies to solid and chemical materials and non-potable water matrices.

Total Number of Pages of Report: 3 (includes Chain of Custody)

Sincerely,

Celey D. Keene
Laboratory Director

This report conforms with NELAP requirements.



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
TARGA
ATTN: DON EMBREY
6 DESTA DRIVE SUITE 3300
MIDLAND, TX 79705
FAX TO: (432) 688-0552

Receiving Date: 07/27/09
Reporting Date: 07/28/09
Project Number: NOT GIVEN
Project Name: ETCHEVERRY
Project Location: NOT GIVEN


Sampling Date: 07/27/09
Sample Type: SOIL
Sample Condition: INTACT @ 7°C
Sample Received By: NF
Analyzed By: AB/HM

LAB NUMBER SAMPLE ID	GRO (C ₆ -C ₁₀) (mg/kg)	DRO (>C ₁₀ -C ₂₈) (mg/kg)	*Cl (mg/kg)
ANALYSIS DATE	07/28/09	07/28/09	07/28/09
H17874-1 W. ETCHEVERRY CLAMP	<10.0	22.6	< 16
H17874-2 W. ETCHEVERRY W. END	<10.0	<10.0	< 16
H17874-3 M. ETCHEVERRY CLAMP	<10.0	<10.0	< 16
H17874-4 M. ETCHEVERRY N. SIDE	<10.0	<10.0	< 16
H17874-5 E. ETCHEVERRY	<10.0	14.4	64
H17874-6 FAR E. ETCHEVERRY	<10.0	42.6	< 16
Quality Control	533	586	500
True Value QC	500	500	500
% Recovery	107	117	100
Relative Percent Difference	19.4	4.5	2.0

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; Cl: Std. Methods 4500-ClB

*Analyses performed on 1:4 w:v aqueous extracts. Reported on wet weight.

Surrogate for DRO on H17874-3 and 4 was outside historical limits due to matrix interference.

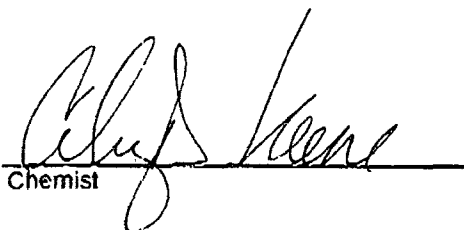
Chemist

07/29/09
Date

H17874 TCL TARGA

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



CARDINAL LABORATORIES

101 East Marland, Hobbs, NM 88240

(575) 393-2326 Fax (575) 393-2476

Page ____ of ____

Company Name: TARGA				BILL TO				ANALYSIS REQUEST											
Project Manager: Don Embrey				P.O. #:															
Address: 6 Desta Drive				Company: TARGA															
City: MIDLAND State: TX Zip: 79705				Attn:															
Phone #: 432-557-9831 Fax #: 432-688-0552				Address: P.O. Box 1689															
Project #: Etcchaverry Project Owner:				City: Louington															
Project Name: Etcchaverry				State: NM Zip: 88260															
Project Location:				Phone #:															
Sampler Name: Don Embrey				Fax #:															
Lab ID	Sample ID	(GRAB OR (COMP. # CONTAINERS	MATRIX	PRESERV.	SAMPLING														
			GROUNDWATER WASTEWATER SOIL OIL SLUDGE OTHER	ACID/BASE ICE / COOL OTHER	DATE TIME														
H1787H1	W. Etcchaverry Clamp				7-27-01 10 AM	X													
-2	W. Etcchaverry W. END				10 AM	X													
-3	M. Etcchaverry Clamp				10:05 AM	X													
-4	M. Etcchaverry N. Side				10:05 AM	X													
-5	E. Etcchaverry				10:10 AM	X													
-6	FAR E. Etcchaverry				10:30 AM	X													

PLEASE NOTE: Liability and Damages: Cardinal's liability and client's exclusive remedy for any claim arising out of or from this contract or for any claim arising out of or from this contract shall be limited to the amount paid by the client for the analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services furnished by Cardinal, regardless of whether such claim is based upon any of the above stated theories or otherwise.

Sampler Relinquished By: Don Embrey	Date: 7-27-01	Received By: AD Fuller	Phone Result: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Add'l Phone #:
Relinquished By:	Date: 7-27-01	Received By:	Fax Result: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Add'l Fax #:
Time:	Time:		REMARKS:	
Delivered By: (Circle One)	Temp: 7°	Sample Condition: <input checked="" type="checkbox"/> Cool <input type="checkbox"/> Intact	CHECKED BY: (Initials)	
Sampler - UPS - Bus - Other:		<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No		

on ice, cooling process begun @ 10:00 AM per customer

† Cardinal cannot accept verbal changes. Please fax written changes to 575-393-2476.

#26

West




06/08/2009

West



06/08/2009

West

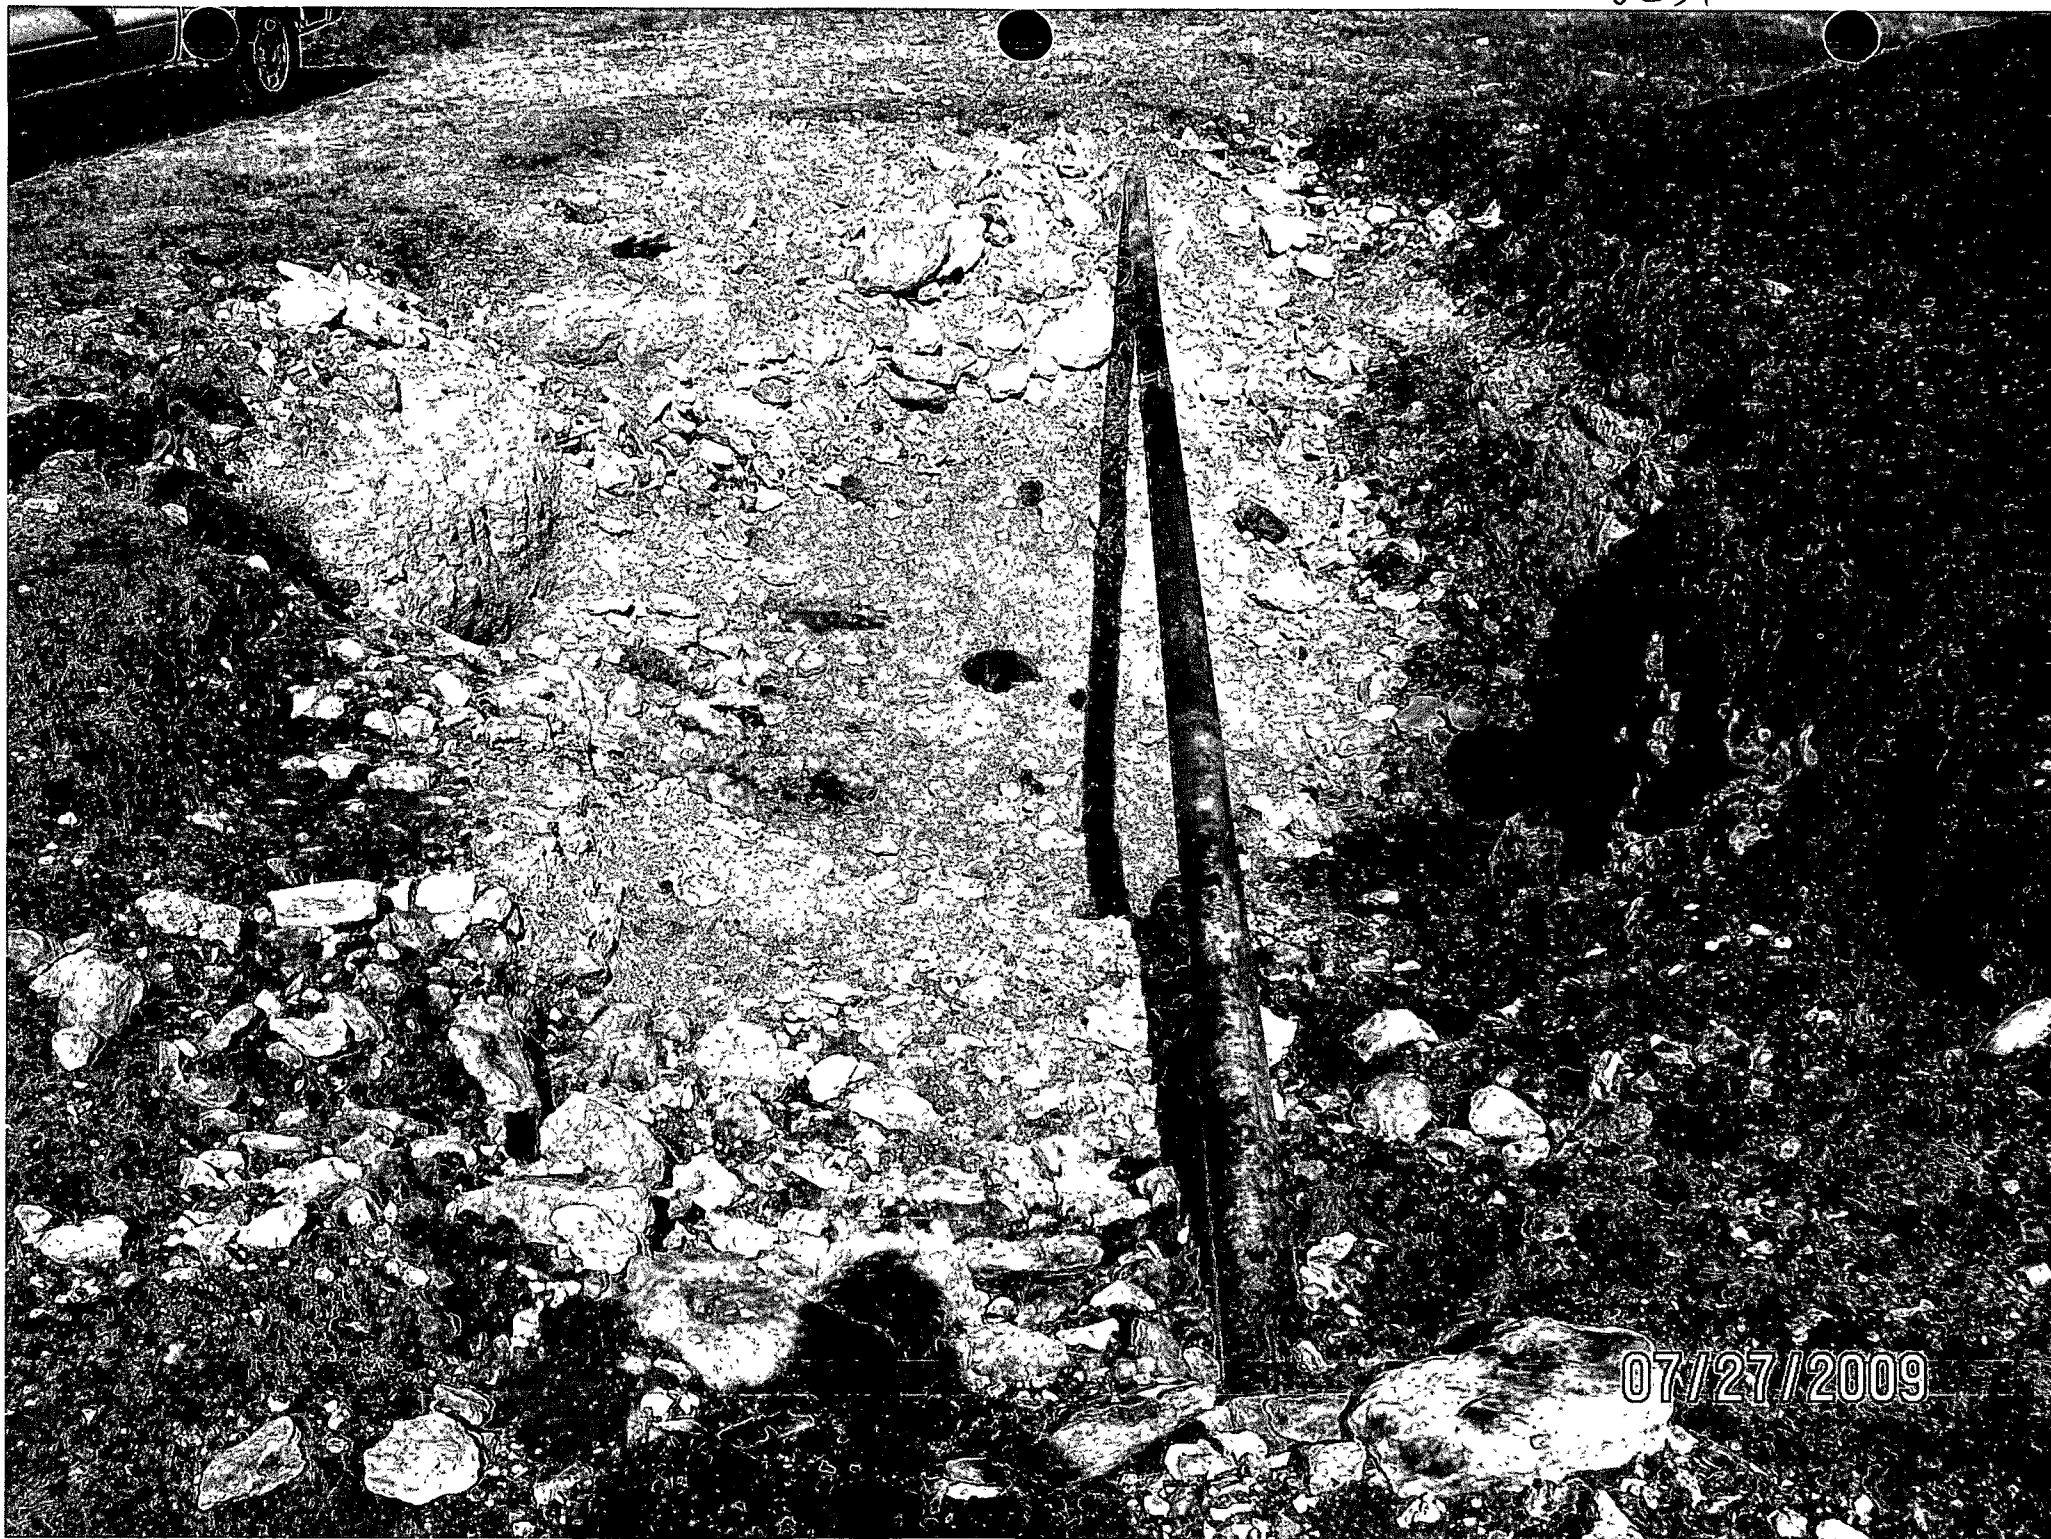

07/27/2009

West



07/27/2009