

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

OCD Rec'd: 08/17/18

Form C-141
Revised April 3, 2017

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Submit 1 Copy to appropriate District Office in
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company: XTO Energy BOPCO OGRID: 260737	Contact: Kyle Littrell
Address: 522 W. Mermod, Suite 704 Carlsbad, N.M. 88220	Telephone No: 432-221-7331
Facility Name: Indian Flats Bass Federal #6	Facility Type: Exploration and Production

Surface Owner: Federal	Mineral Owner: Federal	API No: 30-015-22673
------------------------	------------------------	----------------------

LOCATION OF RELEASE

Unit Letter O	Section 35	Township 21S	Range 28E	Feet from the 330	North/South Line South	Feet from the 2310	East/West Line East	County Eddy
------------------	---------------	-----------------	--------------	----------------------	---------------------------	-----------------------	------------------------	----------------

Latitude 32.430410 Longitude -104.056060 NAD83

NATURE OF RELEASE

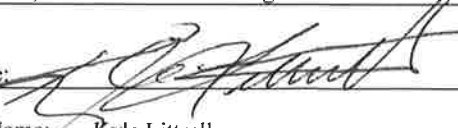

Type of Release Produced water and oil	Volume of Release 31bbl produced water, 1bbl oil	Volume Recovered 29bbl produced water, 1bbl oil
Source of Release Casing	Date and Hour of Occurrence 8/3/2018, AM	Date and Hour of Discovery 8/3/2018, 9:00 AM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher and Maria Pruett (NMOCD), Jim Amos and Tucker Shelly (BLM)	
By Whom? Amy Ruth	Date and Hour: 8/7/2018, 9:41 AM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A	

If a Watercourse was Impacted, Describe Fully.*
N/A

Describe Cause of Problem and Remedial Action Taken.*
Release was from internal corrosion on casing beneath wellhead. Well was on long-term shut in. Release was slow, but due to the location of the leak the crew could not immediately stop the flow. They kept a vacuum truck on site to collect fluid as it was released. Notification was made on 8/7/18 when vacuum truck had recovered over 25bbl. A pulling unit was brought on site to repair casing leak.

Describe Area Affected and Cleanup Action Taken.*
Fluid pooled around wellhead with no impact to pasture. Standing fluids were recovered by vacuum truck. An environmental contractor has been retained to assist with remediation efforts.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION		
Printed Name: Kyle Littrell	Approved by Environmental Specialist: 		
Title: Environmental Coordinator	Approval Date: 08/18/18	Expiration Date: N/A	
E-mail Address: Kyle.Littrell@xtoenergy.com	Conditions of Approval:	Attached <input type="checkbox"/>	
Date: 8-17-18 Phone: 432-221-7331	N/A	2RP-4928	

* Attach Additional Sheets If Necessary

A#: pMAP1823048469

I#: nMAP1823048577