

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

3

DISTRICT I


P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec NM 87410

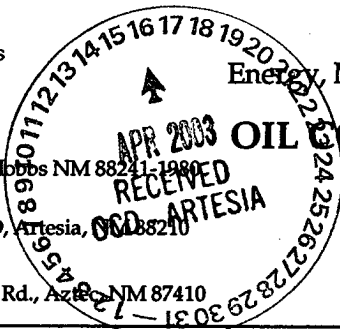

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 30.01500900
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. E-3635
7. Lease Name or Unit Agreement Name Empire Abo Unit 'Q'
8. Well No. 6
9. Pool name or Wildcat Empire Abo

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
2. Name of Operator BP America Production Company	
3. Address of Operator P.O. Box 1089 Eunice, NM 88231	
4. Well Location Unit Letter C : 1980 Feet From The W Line and 660 Feet From The N Line Section 16 Township 18S Range 27E NMPM Eddy County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3496' DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: Repair Casing Leak ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD: 5680' PBD: 5620' PERFS: 5568-5582'

03.07.03: MIRUPU. NDWH. NUBOP. POH w/tbg.

03.10.03: RIH w/RBP. Set @ 2086'. Load hole w/2% KCL & test csg to 500# psi. Held good.

03.11.03: POH. RUWL & perf 4 holes @ 480'. Press up on csg to 500# psi. Did not hold.
Work press until break out perfs.

03.14.03: RU cmt truck. Pmp on 4-1/2" csg. Break circulation. Pmp 100 sxs cmt, 26 bbls total squeeze.

03.17.03: RIH w/bit & DC's. Tag cmt @ 106'. DO to 465'.

03.20.03: Load hole & test csg to 500# psi for 5 mins. Held good. POH w/bit & DC's.

03.24.03: Finish cmt'g surface wellhead w/2.5 sxs cmt. RIH & rls RBP. POH.

03.25.03: RIH w/prod. assy. Set 2-3/8" tbg @ 5498'. SN @ 5502'. RTP. In 24 hrs pmp 42 BO, 5 BW, 73 MCF.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kellie D. Murrish TITLE Sr. Administrative Assistant DATE 04.15.03

TYPE OR PRINT NAME Kellie D. Murrish TELEPHONE NO. 505.394.1649

(This space for State Use)

APPROVED BY Accept For Record TITLE Accept For Record DATE 4-15-03

CONDITIONS OF APPROVAL, IF ANY: