

Oil Cons.
N.M. DIV-Dist. 2
1301 W. Grand Avenue
Artesia, NM 88210
UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

Oil ☐ Gas ☐
Well ☐ Well ☒ Other ☐

2. Name of Operator

STRATA PRODUCTION COMPANY

3. Address and Telephone No.

P. O. Box 1030
Roswell, New Mexico 88202-1030
505-622-1127

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

860' FSL & 660' FWL
Section 11-16S-30E

5. Lease Designation and Serial No.

NM - 11814

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

30-015-29927

8. Well Name and No.

Duncan Federal

9. API Well No.

#1

10. Field and Pool, or Exploratory Area

Henshaw-Q -G-SA

11. County or Parish, State

Eddy

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)


13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

03/27/03: Notify OCD. MIRU. NUBOP. POOH w/76 jnts 2 3/8" tbq. RIH w/5 1/2" CIBP set @ 2500'. Dump 35' cmt on top. SI.

03/28/03: RIH w/MMCPI workstring. Mix 10# mud. POOH. Spot 25 sxs @ 1540'. POOH. WOC. RIH & tag @ 1155'. POOH & spot 40 sxs @ 567' to surface. Dig out & cut off wellhead & anchors. RD. Install dry hole marker.

Approved for plugging of the well bore.
Liability under bond is retained until
surface restoration is completed.

Accepted for record

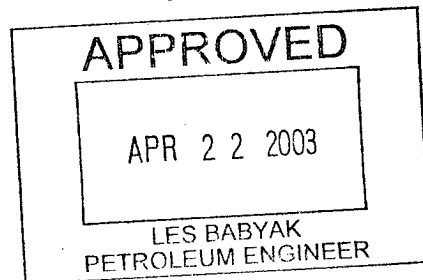

14. I hereby certify that the foregoing is true and correct

Signed Kelly M. Britt

Title Production Records

Date 04/21/03

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any: