N.M. Oil Cons. DIV-Dist. 2 1301 W. Grand Avenue Artesia, NM 88210

FORM APPROVED Form 3160-3 (August 1999) OMB No. 1004-0136 Expires November 30, 2000 5. Lease Serial No. **UNITED STATES** DEPARTMENT OF THE INTERIOR NM 103865 6. If Indian, Allottee or Tribe Name **BUREAU OF LAND MANGEMENT** APPLICATION FOR PERMIT TO DRILL OR REENTER 1a... Type of Work: DRILL REENTER 7. If Unit or CA Agreement, Name and No. 8. Lease Name and Well No. Oil Well X Gas Well 1b... Type of Well: Single Zone Multiple Zone Cielo 4 Fed Com No.1 9. API Well No. 2. Name of Operator 50 *"015-3*3919 EOG Resources, Inc 3b. Phone No. (include area code) 10. Field and Pool, or Exploratory 3a. Address V. Undes East Lale: P.O. Box 2267 Midland, TX 79702 (432) 686-3714 Location of Well (Report location clearly and in accordance with any State requirements.*) 11. Sec., T., R., M., or Blk. And Survey or Area Sec.4 T-19-S;R-27-E SFNL& 1650' FEL U/LB At surface At proposed prod. Zone 14. Distance in miles and direction from nearest town or post office* 12. County or Parish 13. State 16 mi north from Carlsbad Eddy NM 17. Spacing Unit dedicated to this well 15. Distance from proposed 995 16. No. of Acres in lease E/2 Sec 33(320 ac.)location to nearest 320 RECEIVEL property or lease line, ft. (Also to nearest drlg. Unit line, if any) 995 FEB 0 1 2005 20. BLM/BIA Bond No. on file 18. Distance from proposed locations 19. Proposed Depth QUILAPTERIA to nearest well, drilling, completed NM2308 applied for, on this lease, ft. 21. Elevations (Show whether DF, KDB, RT, GL, etc) 22. Approximate date work will start* 23. Estimated duration 1/15/2005 GL 3396 24. Attachments The following completed in accordance with the requirements of Onshore Oil an Gas Order No. 1, shall be attached to this form: 1. Well plat certified by a registered surveyor. 4. Bond to cover the operations unless covered by an existing bond on file (see 2. A Drilling Plan. Item 20 above) 3. A Surface Use Plan (if the location is on National Forest Sytem Lands, the Operator certification. SUPO shall be filed with the appropriate Forest Service Office) 6. Such other site specific information and/or plans as may be required by the authorized officer. Name (Printed/Typed) 25. Signature Date Mike Francis 12/6/2004 Title Name (Printed/Typed) /S/ Joe G. Lara Approved by (Signature) JAN 2 8 2005 /s/ Joé G. Lara CARLSBAD FIELD OFFICE D MANAGER

Application approval does not warrant or certify the applicant holds legal or equitable title to those rightes in the subject lease

operations theron. APPROVAL FOR 1 YEAR

Conditions of approval, if any, are attached

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United

States any false, fictitious or fraudulent statements or representations as to any matter within its jurisidiction.

*(Instructions on reverse)

Robred Controlled Water Bosin

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND FPECIAL STIPULATIONS ATTACHED

and the second of the second of the second

District. I
1625 N. French Dr., Hobbs NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-102 Revised June 10, 2003

Submit to Appropriate District Office

File No. A-2646A3.DWG

State Lease - 4 Copies Fee Lease - 3 Copies

☐ AMENDED REPORT

			W	<u> </u>) A	CREAGE D	EDICA'	110N		
'API Number					2 P	ool Code		wi	ldcat		³ Pool Name	
⁴ Propert	y Code			<u> </u>			5Proper	ty Name	Tucat			⁶ Well Number
Cielo "4" Fed Com					1							
ogrii 7	377	E	EOG Re	sour	ces, Inc		⁸ Operat	or Name				Elevation 3397
					-		ace	Location				
L or lot no.	Section	Township	p Ru	nge	Lot idn	Feet from th		North/South line	Feet fro	m the	East/West line	County
В	4	19 S	27	E		1055		North	165	0	East	Eddy
			1	¹ Bott	om Ho	ole Location	n If	Different F	rom Su	rface	;	
L or lot no.	Section	Township		inge	Lot Idn	Feet from th		North/South line	Feet from		East/West line	County
<u> </u>	13 Joint or	- t-en	1601	J-1/2- /	3-2- 15	Order No.						
Dedicated Acres	Joint of	. 100.111	¹⁴ Consoli	dauon (Code	Urder No.						
20	<u> </u>	i										
O ALLOWA	BLE WII	L BE										LIDATED OR A NON-
		<u> </u>		TANI	DARD U	NIT WAS BE	CEN .	APPROVED B	Y THE I			
6							1	\	1	н		CERTIFICATION
						٠ ,	ر. ا			11		nformation contained herein is est of my knowledge and
							1055		\	bels		est of my knowledge and
						No. 1	1		,	V	mike t	7
						Elev. 3397'	<u> </u>	1650' -		Sign	sature L	lane
							<u></u>	1050 =]\`		
	<u> </u>	1				 ,				╢	Mike Fran	ncis
									`	Prin	ted Name	
										V	Agent	
								İ		nue	and E-mail Address	-
		İ								1,	05/2005	
										1 / Date	05/2005	
										185	SURVEYOR C	CERTIFICATION
										\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	reby certify that the we	ell location shown on this plat
										11 `		of actual surveys made by
										II.	•	n, and that the same is true
					`					and	correct to the best of m	
										N_1	2-21-2004	CHAEL L. STANKOR
,					$-\downarrow$					Date	of Survey	CHAPLE
										Sign	ature and Scal of Profess	
					,				`	1	REGISTERED AND A PROPERTY OF THE PROPERTY OF T	7 \ \\\ \\\\
											(3)	(10324)
										_	7. 【爱	
										السن ا	Male I	POFOR LAND
						` \			\	Certi	ificate Number 10324	POFESSI SNAVET
					<u>-</u>			' \ 		<u></u>		/

17.5 Miles N of Carlsbad, New Mexico.

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 Form C-144 March 12, 2004 For drilling and production facilities, submit to appropriate NMOCD District Office. For downstream facilities, submit to Santa Fe


office

Pit or Below-Grade Tank Registration or Closure


	or below-grade tank 🔀 Closure of a pit or bel					
		mik	e_francis@			
Operator: EOG Resources, Inc.		14 e-mail address:	resources.com			
Address: P.O. Box 2267 Midland Texas						
Facility or well name: Cielo 4 Fed Con "IAPI #:			41.4			
County: Fddy Latitude N 32.694155 Longitude W	104.18128 NAD: 1927 ☑ 1983 ☐ Sur	face Owner Federal 🔼 Stat	te 🗌 Private 🔲 Indian 🗍			
Pit	Below-grade tank					
Type: Drilling X Production Disposal	Volume:bbl Type of fluid:		<u> </u>			
Workover Emergency	Construction material:		•			
Lined 🖸 Unlined 🔲	Double-walled, with leak detection? Yes	If not, explain why not.				
Liner type: Synthetic K Thickness 12 mil Clay Volume			,			
bbi						
D. A	Less than 50 feet	(20 points)				
Depth to ground water (vertical distance from bottom of pit to seasonal high	50 feet or more, but less than 100 feet	(10 points)				
water elevation of ground water.)	100 feet or more	(0 points)	RECEIVED			
Wellhead protection area: (Less than 200 feet from a private domestic	Yes	(20 points)	DEC 1/3 2004			
water source, or less than 1000 feet from all other water sources.)	(No)	(0 points)	OCD-ARTESIA			
	1	(00 11)	AGB-bull II ISSUE			
Distance to surface water: (horizontal distance to all wetlands, playas,	Less than 200 feet	(20 points)				
irrigation canals, ditches, and perennial and ephemeral watercourses.)	200 feet or more, but less than 1000 feet	(10 points)				
	door leet of more	(o points)	· · · · · · · · · · · · · · · · · · ·			
	Ranking Score (Total Points)					
		20	· · · · · · · · · · · · · · · · · · ·			
If this is a pit closure: (1) attach a diagram of the facility showing the pit's		·				
onsite Offsite If offsite, name of facility	(3) Attach a general description of remed	lial action taken including i	emediation start date and end			
date. (4) Groundwater encountered: No 🗌 Yes 🗋 If yes, show depth belo	w ground surfacefl. and attach	sample results. (5) Attach	soil sample results and a			
diagram of sample locations and excavations.						
hereby certify that the information above is true and complete to the best of been/will be constructed or closed according to NMOCD guidelines 23, a Date: 12/10/04	my knowledge and belief. I further certify the general permit , or an (attached) alterna	nat the above-described p tive OCD-approved plan	it or below-grade tank has			
Printed Name/Title Mike Francis Agent	Signature Micha Comme		Section 1985			
Your certification and NMOCD approval of this application/closure does not obtherwise endanger public health or the environment. Nor does it relieve the regulations.	relieve the operator of liability should the cont	ents of the pit or tank conta	minate ground water or or local laws and/or			
DEC 1 Cass						
	oproval: ULU I 0 ZUU4					
ate:						
Printed Name/Title	Signature					
ı ı	er Guidelines, a					
deta	iled closure plan must					
be s	ubmitted prior to					

closure.

New Mexico Ground Level Double Horseshoe Pits (EOG)

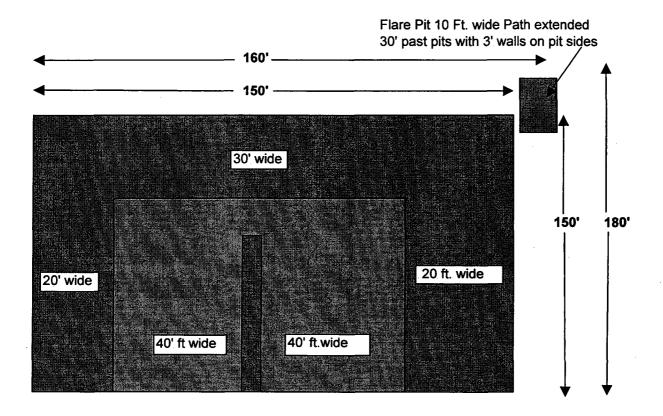

Pits will be 150' deep X 150' wide ground level. Flare pit is 10 X30

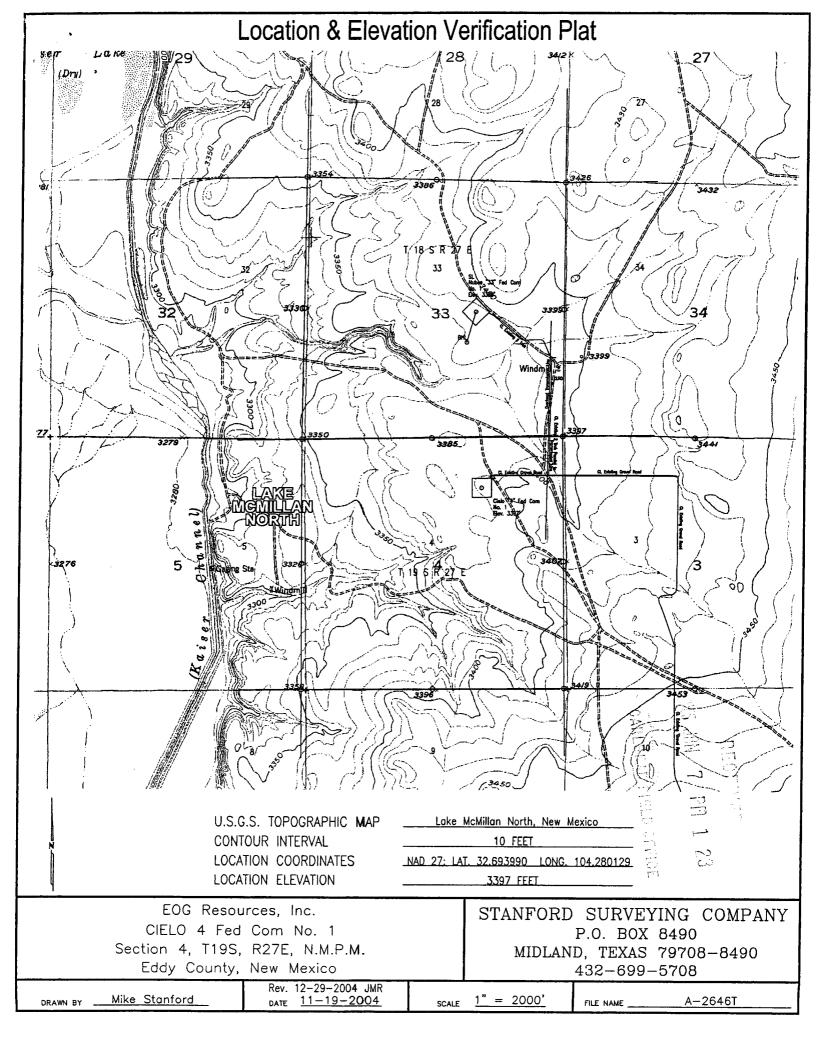

EOG RESOURCES, INC. Cielo 4 Fed Com No.1

1. GEOLOGIC NAME OF SURFACE FORMATION:

Permian

2. ESTIMATED TOPS OF IMPORTANT GEOLOGICAL MARKERS:

Rustler	600'
Grayburg	1500'
San Andres	1800'
Bone Spring	4400'
Strawn	8850'
Atoka	9300'
Morrow	9530'
Barnett	9900'

3. ESTIMATED DEPTHS OF ANTICIPATED FRESH WATER, OIL OR GAS:

Upper Permian Sands	Above 200'	Fresh Water
Grayburg	1600	Oil
Strawn	8850	Gas
Atoka	9350	Gas
Morrow	9600	Gas

CASING PROGRAM

Hole Size	Interval	OD Casing	Weight Grade Jt. Cond. Type
14 3/4	0-400'	11 3/4"	42# H-40 ST&C
11"	0-2400'	8 5/8"	32# J-55 LT&C
7 7/8'	0-10'100	5 ½'	17# N80/S95 LT&C

Cementing Program:



11 3/4" Surface Casing: Cement to surface with 100 sx Prem Plus, 3%

Econolite, 2% Calcium Chloride, 0.25#/sx Flocele,

150 sx Prem Plus, 2% Calcium Chloride

8 5/8" Intermediate: Cement to surface with 550 sx Interfill C, .25#/sx

flocele, 230 sx Premium Plus, 2% Calcium Chloride

5 ½" Production: Cement w/600 sx Premium, 3% Econolite, 5#/sx

Salt (3%), 0.2% HR5, .25#/sk Flocele, 485sx 50/50 Poz with retarders.. This is designed to bring TOC

to 2000'.

EOG RESOURCES, INC. Cielo 4 Fed Com No.1

5. MINIMUM SPECIFICATIONS FOR PRESSURE CONTROL:

(SEE EXHIBIT #1)

The blowout preventer equipment (BOP) shown in Exhibit #1 will consist of a double ram-type (5000 psi WP) preventer and an annular preventer (5000-psi WP). Units will be hydraulically operated and the ram-type will be equipped with blind rams on top and drill pipe rams on bottom. All BOP's and accessory equipment will be tested in accordance with Onshore Oil & Gas order No. 2. EOG request authorization to use a 2M system, providing for an annular preventer to be used prior to drilling the surface casing shoe before drilling out of surface casing. Before drilling out of 1st intermediate casing, the ram-type BOP and accessory equipment will be tested to 5000/1000 psi and the annular to 3500/5000-psig pressure.

Pipe rams will be operationally checked each 24-hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets.

6. TYPES AND CHARACTERISTICS OF THE PROPOSED MUD SYSTEM:

The well will be drilled to TD with a combination of brine, cut brine, and polymer/KCL mud system. The applicable depths and properties of this system are as follows:

		Wt Viscosi	ty Waterle	oss
<u>Depth</u>	<u>Type</u>	(PPG)	(sec)	<u>(cc)</u>
0-400'	Fresh Water	8.5	40-45	N.C.
400'-2400'	Brine Water	10.0	30	N.C.
2400'- TD	Cut Brine + Polymer/KCI	8.8 – 9.2	32	10

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept at the wellsite at all times.

7. AUXILIARY WELL CONTROL AND MONITORING EQUIPMENT:

- (A) A kelly cock will be kept in the drill string at all times.
- (B) A full opening drill pipe-stabbing valve (inside BOP) with proper drill pipe connections will be on the rig floor at all times.
- (C) A mud logging unit complete with H2S detector will be continuously monitoring drilling penetration rate and hydrocarbon shows from 5000' to TD.

EOG RESOURCES, INC. Cielo 4 Fed Com No.1

8. LOGGING, TESTING AND CORING PROGRAM:

Electric logging will consist of GR-Dual Induction Focused and GR-Compensated Density-Neutron from TD to intermediate casing with a GR-Compensated Neutron run from intermediate casing to surface and optional Sonic from TD to Intermediate casing.

Possible sidewall cores based on shows.

9. ABNORMAL CONDITIONS, PRESSURES, TEMPERATURES AND POTENTIAL HAZARDS:

The estimated bottom hole temperature (BHT) at TD is 175 degrees F with an estimated maximum bottom-hole pressure (BHP) at TD of 5000 psig. No hydrogen sulfide or other hazardous gases or fluids have been encountered, reported or are known to exist at this depth in this area. No major loss circulation zones have been reported in offsetting wells.

10. ANTICIPATED STARTING DATE AND DURATION OF OPERATIONS:

The drilling operation should be finished in approximately one month. If the well is productive, an additional 30-60 days will be required for completion and testing before a decision is made to install permanent facilities.

EOG RESOURCES, INC. Cielo 4 Fed Com No.1

ATTACHMENT TO EXHIBIT #1

- 1. Wear ring to be properly installed in head.
- 2. Blow out preventer and all fittings must be in good condition, 5000 psi W.P. minimum. Exhibit #1.
- 3. All fittings to be flanged
- 4. Safety valve must be available on rig floor at all times with proper connections, valve to be full bore 5000 psi W.P. minimum.
- 5. All choke and fill lines to be securely anchored especially ends of choke lines.
- 6. Equipment through which bit must pass shall be at least as large as the diameter of the casing being drilled through.
- 7. Kelly cock on kelly.
- 8. Extension wrenches and hand wheels to be properly installed.
- 9. Blow out preventer control to be located as close to driller's position as feasible.
- 10. Blow out preventer closing equipment to include minimum 40-gallon accumulator, two independent sources of pump power on each closing unit installation, and meet all API specifications.

Cielo 4 Fed Com No.1

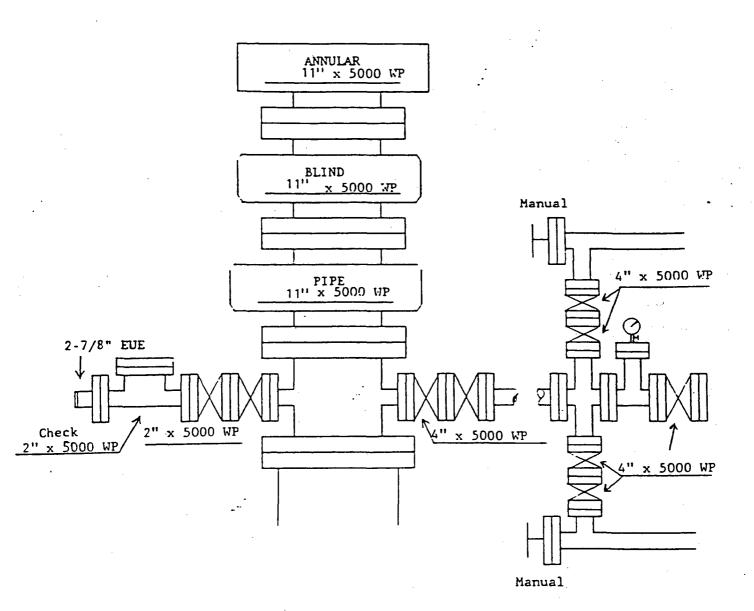


Exhibit 1

RECEIVED

2005 JAN - 6 AN II: 44

SAPEAL TO LANGEOVE ROSMELL CHOCK

EOG RESOURCES, INC.
HYDROGEN SULFIDE (H2S) CONTINGENCY PLAN
FOR DRILLING/COMPLETING/WORKOVER/FACILITY
WITH THE EXPECTATION OF H2S IN EXCESS OF 100 PPM

EOG Resources, Inc. Cielo 4 Fed com. No.1 Well Eddy Co. NM

TABLE OF CONTENTS

GENERAL EMERGENCY PLAN	Page 2
EMERGENCY PROCEDURE FOR UNCONTROLLED RELEASE OF H2S	Page 2
EMERGENCY NUMBERS OF NOTIFICATION	Page 3
LOCATION MAP	Page 4
PROTECTION OF THE GENERAL (ROE) RADIUS OF EXPOSURE	Page 5
PUBLIC EVACUATION PLAN	Page 5
PROCEDURE FOR IGNITING AN UNCONTROLLABLE CONDITION:	
INSTRUCTIONS FOR IGNITION:	Page 6
REQUIRED EMERGENCY EQUIPMENT	Page 6-7
USING SELF-CONTAINED BREATHING AIR EQUIPMENT (SCBA):	Page 7
RESUCE & FIRST AID FOR VICTIMS OF HYDROGEN SULFIDE (H2S) POISONING:	Page 8
H2S TOXIC EFFECTS	Page 9
H2S PHYSICAL EFFECTS	Page 9

GENERAL H2S EMERGENCY ACTIONS:

In the event of an H2S emergency, the following plan will be initiated.

- 1) All personnel will immediately evacuate to an up-wind and if possible up-hill "safe area".
- 2) If for any reason a person must enter the hazardous area, they must wear a SCBA (Self contained breathing apparatus)
- 3) Always use the "buddy system"
- 4) Isolate the well/problem if possible
- 5) Account for all personnel and provide for medical treatment if needed.
- 6) Display the proper colors warning all unsuspecting personnel of the danger at hand.
- 7) As per EOG's Crisis Management Plan contact EOG Management.

At this point the company representative will evaluate the situation and co-ordinate the necessary duties to bring the situation under control, and if necessary, the notification of emergency response agencies and residents.

EMERGENCY PROCEDURES FOR AN UNCONTROLLABLE RESLEASE OF H2S

- 1) All personnel will don the self-contained breathing apparatus
- 2) Remove all personnel to the "safe area" (always use the "buddy system")
- 3) Contact company personnel if not on location.
- 4) Set in motion the steps to protect and or remove the general public to an upwind "safe area". Maintain strict security & safety procedures while dealing with the source. Provide for medical treatment if necessary
- 5) No entry to any unauthorized personnel.
- 6) Notify the appropriate agencies:

City Police-City street(s)


State Police-State Rd

County Sheriff-County Rd.

(will assist in general public evacuation/safety while maintaining roadblocks)

7) Call the NMOCD

EOG Resources, Inc.	<u>OFFICE</u> 432/686-3600	MOBI	<u>LE</u>	HOME
David Anderson	432/686-3601	432/6	432/634-1002	
Billy Helms	432/686-3795	432/5	432/557-5345	
Howard Kemp	432/686-3704	432/6	34-1001	
EMERGENCY RESPONSE	NUMBERS: Eddy	County,	New Mexico	
State Police			505/748-9718	1
Eddy County Sheriff			505/746-2701	
Emergency Medical Service	(Ambulance)		911 or 505/746-2701	
Eddy County Emergency Ma	nagement (Harry Burg	gess)	505/887-9511	
State Emergency Response Center (SERC) 505/476-96				
Artesia Police Department Artesia Fire Department			505/746-5001 505/746-5001	
Carlsbad Police Department Carlsbad Fire Department			505/885-2111 505/885-3125	
Loco Hills Fire Department			505/677-2349	
(NMOCD) New Mexico Oil C District I (Lea, Roosevelt, Ch District II (Eddy, Chavez)	505/393-6161 505/748-1283			
American Safety Indian Fire & Safety Callaway Safety			505/746-1096 800/530-8693 505/392-2973	
BJ Services			502/746-3146	

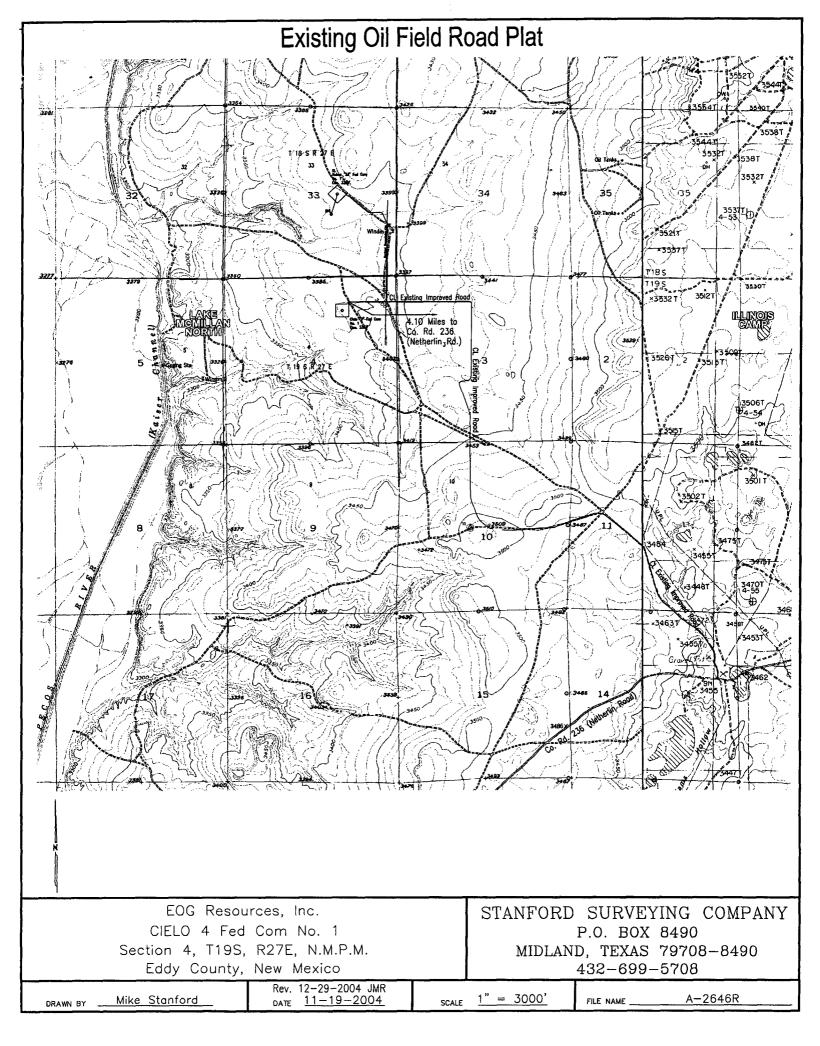

In the event greater than 100 ppm H2S is present, the ROE (Radius Of Exposure) calculations will be done to determine if the following is warranted:

- 100 ppm at any public area (any place not associated with this site)
- 500 ppm at any public road (any road which the general public may travel)
- 100 ppm radius of 3000' will be assumed if there is insufficient data to do the calculations, and there is a reasonable expectation that H2S could be present in concentrations greater than 100 ppm in the gas mixture.

Calculation for the 100 ppm ROE:

 $X = [(1.589)(concentration)(Q)]^{(0.6258)}$

Calculation for the 500 PPM ROE

 $X = [(0.4546)(concentration)(Q)]^{(.06258)}$

Q=Gas flow rate, SCFPD

concentration = decimal equivalent of the volume fraction of hydrogen sulfide in the gaseous mixture

PUBLIC EVACUATION PLAN:

(When the supervisor has determined that the General Public will be involved, the following plan will be implemented)

- 1) Notification of the emergency response agencies of the hazardous condition and Implement evacuation procedures.
- 2) A trained person in H2S safety shall monitor with detection equipment the H2S Concentration, wind and area of exposure (ROE). This person will determine the outer perimeter of the hazardous area. The extent of the evacuation area will be determined from the data being collected. Monitoring shall continue until the situation has been resolved. (All monitoring equipment shall be UL approved, for use in class I groups A, B, C & D, Division I, hazardous locations. All monitors will have a minimum capability of measuring H2S, oxygen, and flammable values).
- 3) Law enforcement shall be notified to set up necessary barriers and maintain such for the duration of the situation as well as aid in the evacuation procedure.
- 4) The company supervising personnel shall stay in communication with all agencies through out the duration of the situation and inform such agencies when the situation has been contained and the effected area(s) is safe to enter.

PROCEDURE FOR IGNITING AN UNCONTROLLABLE CONDITION:

The decision to ignite a well should be a last resort and one if not both of the following pertain.

- 1) Human life and/or property are in danger.
- 2) There is no hope of brining the situation under control with the prevailing conditions at the site.

INSTRUCTIONS FOR IGNITION:

- 1) Two people are required. They must be equipped with positive pressure; self contained breathing apparatus and a "D"-ring style, full body, OSHA approved safety harness. Non-flammable rope will be attached.
- 2) One of the people will be a qualified safety person who will test the atmosphere for H2S, Oxygen, and LFL. The other person will be the company supervisor; he is responsible for igniting the well.
- 3) Ignite up-wind from a distance no closer than necessary. Make sure that where you ignite from has the maximum escape avenue available. A 25 mm flare gun shall be used, with a ±500' range to ignite the gas.
- 4) Prior to ignition, make a final check for combustible gases.
- 5) Following ignition, continue with the emergency actions and procedures as before.

REQUIRED EMERGENCY EQUIPMENT

- 1) Breathing Apparatus:
 - Rescue Packs (SCBA) 1 unit shall be placed at each breathing area, 2 shall be stored in the safety trailer.
 - Work/Escape Packs 4 packs shall be stored on the rig floor with sufficient air hose not to restrict work activity.
 - Emergency Escape Packs 4 packs shall be stored in the doghouse for emergency evacuation.
- 2) Signage and Flagging:
 - One Color Code Condition Sign will be placed at the entrance to the site reflecting the possible conditions at the site.
 - A Colored Condition flag will be on display, reflecting the condition at the site at that time.
- 3) Briefing Area: Two, perpendicular areas will be designated by signs and readily accessible.

- 4) Wind Socks: Two windsocks will be placed in strategic locations, visible from all angles.
- 5) H2S Detectors and Alarm: The stationary detector with three (3) sensors will be placed in the upper dog house if equipped, set to visually alarm @ 10 ppm and audible @ 15 ppm. Calibrate a minimum of every 30 days or as needed. The 3 sensors will be placed in the following places: (Gas sample tubes will be stored in the safety trailer)
 - Rig Floor
 - Bell Nipple
 - End of Flow line or where well bore fluid are being discharged.
- 6) Auxiliary Rescue Equipment:
 - Stretcher
 - Two OSHA full body harness
 - 100' of 5/8" OSHA approved rope
 - 1-20# Class ABC fire extinguisher
 - Communication via cell phones on location and vehicles on location.

USING SELF-CONTAINED BREATHING AIR EQUIPMENT (SCBA):

SCBA should be worn when any of the following are performed:

- Working near the top or on top of a tank.
- Disconnecting any line where H2S can reasonably be expected.
- Sampling air in the area to determine if toxic concentrations of H2S exist
- Working in areas where over 10 ppm on H2S has been detected.
- At any time there is a doubt as the level of H2S in the area.

All personnel shall be trained in the use of SCBA prior to working in a potentially hazardous location.

Facial hair and standard eyeglasses are not allowed with SCBA.

Contact lenses are never allowed with SCBA.

Air quality shall continuously be checked during the entire operation.

After each use, the SCBA unit shall be cleaned, disinfected, serviced and inspected.

All SCBA shall be inspected monthly.

RESCUE & FIRST AID FOR VICTIMS OF HYDROGEN SULFIDE (H2S) POISONING:

Do not panic.

Remain calm & think.

Get on the breathing apparatus.

Remove the victim to the safe breathing area as quickly as possible. Upwind an uphill from source or cross wind to achieve upwind.

Notify emergency response personnel.

Provide artificial respiration and/or CPR, as necessary.

Remove all contaminated clothing to avoid further exposure.

A minimum of two (2) personnel on location shall be trained in CPR and First Aid.

H2S TOXIC EFFECTS:

H2S is extremely toxic. The acceptable ceiling for eight hours of exposure is 10 ppm, which is .001% by volume. H2S is approximately 20% heavier than air (SP.Gr=1.19/Air=1) and colorless. It forms an explosive mixture with air between 4.3% and 46.0%. By volume hydrogen sulfide (H2)) is almost as toxic as hydrogen cyanide and is 5-6 times more toxic than carbon monoxide.

Various Gasses

Common Name	Chemical Abbrev.	Sp. GR.	Threahold Limits	Hazardous Limits	Lethal Concentration
Hydrogen Sulfide	H2S	1.19	10 ppm 15 ppm	100 ppm/hr	600 ppm
Hydrogen Cyanide	HCN	0.94	10 ppm	150 ppm/hr	300 ppm
Sulfur Dioxide	SO2	2.21	2 ppm	N/A	1000 ppm
Chlorine	CL2	2.45	1 ppm	4 ppm/hr	1000 ppm
Carbon Monoxide	СО	0.97	50 ppm	400 ppm/hr	1000 ppm
Carbon Dioxide	CO2	1.52	5000 ppm	5%	10%
Methane	CH4	0.55	90,000	Combustible @ 5%	N/A

- 1 Threshold limit Concentrations at which it is believed that all workers may be repeatedly exposed, day after day without Adverse effects.
- 2 Hazardous limit Concentration that may cause death
- 3 Leathal concentration Concentration that will cause death with short-term exposure
- 4 Threshold limit 10 ppm NIOSH guide to chemical hazards
- 5 Short-term threshold limit

PHYSICAL EFFECTS OF HYDROGEN SULFIDE:

CONCENTRATIONS		PHYSICAL EFFECTS
.001%	10 ppm	Obvious and unpleasant odor. Safe for 8 hr exposure
.005%	50 ppm	Can cause some flu-like symptoms and can cause pneumonia
.01%	100 ppm	Kills the sense of smell in 3-15 minutes. May irritate eyes and throat.
.02%	200 ppm	Kills the sense of smell rapidly. Severely irritates eyes and throat. Severe flu-like symptoms after 4 or more hours. May cause lung damage and/or death.
.06%	600 ppm	Loss of consciousness quickly, death will result if not rescued promptly