#### Rec'd 06/25/2020 - NMOCD

Form 3160-3 (June 2015)		FORM APPROVE OMB No. 1004-013	37					
UNITED STATES		Expires: January 31, 2	2018					
DEPARTMENT OF THE IN BUREAU OF LAND MANA		5. Lease Serial No. NMNM057273						
APPLICATION FOR PERMIT TO DE		6. If Indian, Allotee or Tribe Na						
1a. Type of work: 🔽 DRILL 🗌 RE	ENTER	7. If Unit or CA Agreement, Name and No.						
1b. Type of Well: Oil Well Gas Well Oth	8. Lease Name and Well No.							
1c. Type of Completion: Hydraulic Fracturing Sin	gle Zone 🖌 Multiple Zone	JEFF SMITH MDP1 7-18 FE	DERAL COM					
		173H						
2. Name of Operator OXY USA INCORPORATED		9. API Well No. 30 015 47	247					
	3b. Phone No. (include area code) (713) 366-5716	10. Field and Pool, or Explorate COTTON DRAW BONE SPR	•					
4. Location of Well (Report location clearly and in accordance w	ith any State requirements.*)	11. Sec., T. R. M. or Blk. and S	urvey or Area					
At surface SESW / 275 FSL / 2256 FWL / LAT 32.2398	731 / LONG -103.8183596	SEC 6/T24S/R31E/NMP						
At proposed prod. zone SESW / 20 FSL / 2100 FWL / LA	T 32.2101223 / LONG -103.8188896							
<ul><li>14. Distance in miles and direction from nearest town or post office</li><li>15 miles</li></ul>	re*	5	13. State NM					
15. Distance from proposed* 20 feet location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any)	16. No of acres in lease         17. Space           607.16         655.0	ing Unit dedicated to this well						
18 Distance from proposed location*	19. Proposed Depth 20. BLM	I/BIA Bond No. in file						
to nearest well, drilling, completed, <b>35 feet</b>	11517 feet / 22270 feet FED: E	SB000226						
21. Elevations (Show whether DF, KDB, RT, GL, etc.) 3460 feet	22. Approximate date work will start* 12/07/2020	23. Estimated duration 45 days						
	24. Attachments							
The following, completed in accordance with the requirements of		Undraulia Eracturing rule nor 42 (	CED 2162 2 2					
(as applicable)	Onshore Off and Gas Order No. 1, and the	riyuraune Fracturing fule per 43 C	CFK 5102.5-5					
<ol> <li>Well plat certified by a registered surveyor.</li> <li>A Drilling Plan.</li> </ol>	4. Bond to cover the operation Item 20 above).	ons unless covered by an existing bo	ond on file (see					
3. A Surface Use Plan (if the location is on National Forest System SUPO must be filed with the appropriate Forest Service Office)		ormation and/or plans as may be req	uested by the					
25. Signature	Name (Printed/Typed) LESLIE REEVES / Ph: (713) 366	Date 02/11/201	20					
(Electronic Submission) Title	LESLIE REEVES / PII. (713) 360	S-5716 02/11/202	20					
Advisor Regulatory								
Approved by (Signature) (Electronic Submission)	Name (Printed/Typed) Cody Layton / Ph: (575) 234-5959	9 Date 9 06/17/202	20					
Title Assistant Field Manager Lands & Minerals	Office Carlsbad Field Office							
Application approval does not warrant or certify that the applicant		s in the subject lease which would	entitle the					
applicant to conduct operations thereon. Conditions of approval, if any, are attached.	<u> </u>		-					
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, ma of the United States any false, fictitious or fraudulent statements of			nent or agency					



\*(Instructions on page 2)

(Continued on page 2)

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone: (575) 393-6161 Fax: (575) 393-0720 <u>District II</u> 811 S. First St., Artesia, NM 88210

Phone: (575) 748-1283 Fax: (575) 748-9720 District III

Di000 Rio Brazos Road, Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170 District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3460 Fax: (505) 476-3462 State of New Mexico Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-102 Revised August 1, 2011 Submit one copy to appropriate District Office

AMENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT												
30-015 <sup>-</sup>	PI Number 47247	r	982	PURPLE SAGE; WOLFCAMP								
<sup>4</sup> Property C	ode				<sup>5</sup> Property	Name			<sup>6</sup> V	Vell Number		
328304				JEFF SN	AITH MDP1	7_18 FED CC	DМ		173H			
<sup>7</sup> OGRID N	lo.				<sup>8</sup> Operator	Name			9	Elevation		
16696	5				OXY USA	A INC.				3460'		
<sup>10</sup> Surface Location												
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East	t/West line	County		
Ν	6	24S	31E		275	SOUTH	2256	WE	ST	EDDY		
			и Bo	ttom Ho	le Location If	Different Fron	n Surface					
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East	t/West line	County		
Ν	18	24S	31E		20	SOUTH	2100	WE	ST	EDDY		
<sup>12</sup> Dedicated Acres	<sup>13</sup> Joint of	r Infill	<sup>4</sup> Consolidation	Code <sup>15</sup> Or	der No.				•			
655.04												

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

	CORNER COORDINATES		<sup>17</sup> OPERATOR CERTIFICATION
6 <del>7</del>	NAD 83, SPCS NM EAST A - X: 701001.66' / Y: 451107.73	NAD 27, SPCS NM EAST	I hereby certify that the information contained herein is true and complete
	B - X: 701025.74' / Y: 445824.06		to the best of my knowledge and belief, and that this organization either
SECTION SECTION T245 R3 T245 R3 SECTION	C - X: 701051.64' / Y: 440540.15 D - X: 698345.13' / Y: 440527.61	' C - X: 659867.40' / Y: 440481.35' D - X: 657160.90' / Y: 440468.81'	owns a working interest or unleased mineral interest in the land including
	E - X: 698324.01' / Y: 445811.29	' E - X: 657139.96' / Y: 445752.36'	the proposed bottom hole location or has a right to drill this well at this
	F - X: 698302.38' / Y: 451095.14	' F - X: 657118.51' / Y: 451036.10'	location pursuant to a contract with an owner of such a mineral or working
20.	<b></b>	SURFACE HOLE LOCATION 275' FSL 2256' FWL, SECTION 6	interest, or to a voluntary pooling agreement or a compulsory pooling
	SHL SECTION 5	NAD 83, SPCS NM EAST	order heretofore entered by the division.
2256' A	KOP	X:700557.11' / Y:451381.09' LAT:32.23987312N / LON:103.81835969W	Leslie T. Reeves 2/11/20
2100' F 0	<b>F001</b>	NAD 27, SPCS NM EAST	
2100	599'	X:659373.24' / Y:451322.04' LAT:32.23974999N / LON:103.81787456W	Signature Date
	599'	KICK OFF POINT	LESLIE REEVES
	2	50' FNL 2100' FWL, SECTION 7 NAD 83, SPCS NM EAST	Printed Name
	<u>1</u>	X:700402.57' / Y:451054.93'	
SECTION	00 -1	LAT:32.23897864N / LON:103.81886457W NAD 27, SPCS NM EAST	LESLIE_REEVES@OXY.COM
CTION	NONO	X:659218.69' / Y:450995.90'	E-mail Address
SEC SEC	SECT L SECT L	LAT:32.23885550N / LON:103.81837947W	
	R R	FIRST TAKE POINT 100' FNL 2100' FWL, SECTION 7	<sup>18</sup> SURVEYOR CERTIFICATION
	<b></b>	NAD 83, SPCS NM EAST	I hereby certify that the well location shown on this
N:445821.21		X:700402.78' / Y:451004.93' LAT:32.23884120N / LON:103.81886467W	plat was plotted from field notes of actual surveys
E:700423.86	CLION	NAD 27, SPCS NM EAST	
NO	SECTION	X:659218.90' / Y:450945.90' LAT:32.23871806N / LON:103.81837957W	made by me or under my supervision, and that the
CLION	0 00	LAST TAKE POINT	same is true and correct to the best of my belief.
LAST 🕅		100' FSL 2100' FWL, SECTION 18	Nº CON
		NAD 83, SPCS NM EAST X:700444.94' / Y:440637.34'	NOVEMBER 21, 2019
2100'		LAT:32.21034224N / LON:103.81888885W	Date of Survey
2100	606'	NAD 27, SPCS NM EAST X:659260.70' / Y:440578.54'	Signature and Seal of Professional Surveyor: 111000
2100' 0 C		LAT:32.21021883N / LON:103.81840506W	2 (1403) 8
	606'	BOTTOM HOLE LOCATION	101 2
		20' FSL 2100' FWL, SECTION 18	121
SECTION 24	HL e e	NAD 83, SPCS NM EAST X:700445.08' / Y:440557.34'	1000
	AL AND	LAT:32.21012234N / LON:103.81888965W	SIONAL SUP
SHEET 1 OF 3	SE C	NAD 27, SPCS NM EAST	
JOB No. R4041_006_J REV 0 JCS 11/20/2019		X:659260.84' / Y:440498.54' LAT:32.20999892N / LON:103.81840586W	Certificate Number DAVID W. MYERS 11403
REV 0 JCS 11/20/2019			DAVID W. MITEKS 11403

Distances/areas relative to NAD 83 Combined Scale Factor: 0.99977704 Convergence: 00°16'56.57999"

# PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

<b>OPERATOR'S NAME:</b>	OXY USA INCORPORATED
LEASE NO.:	NMNM057273
WELL NAME & NO.:	JEFF SMITH MDP1 7-18 FEDERAL COM 173H
SURFACE HOLE FOOTAGE:	275'/S & 2256'/W
<b>BOTTOM HOLE FOOTAGE</b>	20'/S & 2100'/W
LOCATION:	Section 6, T.24 S., R.31 E., NMP
COUNTY:	Eddy County, New Mexico

# COA

H2S	O Yes	No	
Potash	O None	Secretary	O R-111-P
Cave/Karst Potential	• Low	O Medium	O High
Cave/Karst Potential	Critical		
Variance	O None	Flex Hose	• Other
Wellhead	Conventional	Multibowl	O Both
Other	4 String Area	Capitan Reef	WIPP
Other	✓ Fluid Filled	Cement Squeeze	Pilot Hole
Special Requirements	U Water Disposal	COM	🗌 Unit
	<u></u>	<b>O</b>	

Break Testing	• Yes	○ No

# A. HYDROGEN SULFIDE

Hydrogen Sulfide (H2S) monitors shall be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the Hydrogen Sulfide area shall meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, provide measured values and formations to the BLM.

# **B.** CASING

#### **Casing Design**

- 1. The **10-3/4** inch surface casing shall be set at approximately **869** feet (a minimum of **70 feet (Eddy County)** into the Rustler Anhydrite and above the salt) and cemented to the surface.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run

Page 1 of 9

# Approval Date: 06/17/2020

to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.

- b. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>24 hours in the Potash Area</u> or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.

# Intermediate casing must be kept fluid filled to 1/3 to meet BLM minimum collapse requirement.

2. The **7-5/8** inch intermediate casing shall be set at approximately **10736** feet. The minimum required fill of cement behind the **7-5/8** inch intermediate casing is:

# **Option 1 (Single Stage):**

• Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash. Excess cement calculates to -60%, additional cement might be required.

# **Option 2:**

Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.

- a. First stage to DV tool: Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
  Excess cement calculates to 6.3%, additional cement might be required.
- b. Second stage above DV tool:
  - Cement to surface. If cement does not circulate, contact the appropriate BLM office. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

# Approval Date: 06/17/2020

# Excess cement calculates to 8.7%, additional cement might be required.

• Operator will perform bradenhead squeeze. Cement to surface. If cement does not circulate see B.1.a, c-d above.

Operator has proposed to pump down 9-5/8" X 7-5/8" annulus. <u>CBL will be</u> required on one well per pad. If the pumped volume of cement is less than permitted in the APD, BLM will be notified and a CBL may be run. Echometer will be used after bradenhead cement job to determine TOC before pumping top-out cement.

- In <u>Secretary Potash Areas</u> if cement does not circulate to surface on the first two casing strings, the cement on the 3rd casing string must come to surface.
- 3. The minimum required fill of cement behind the **5-1/2** inch production casing is:

### **Option 1 (Single Stage):**

Cement should tie-back at least **500 feet** into previous casing string. Operator shall provide method of verification. **Excess cement calculates to 20.13%, additional cement might be required.** 

# C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'

2.

# **Option 1:**

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **5000 (5M)** psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the intermediate casing shoe shall be **10,000 (10M)** psi.

# **Option 2:**

- Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 10,000 (10M) psi. Variance is approved to use a 5000 (5M) Annular which shall be tested to 5000 (5M) psi.
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
  - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
  - c. Manufacturer representative shall install the test plug for the initial BOP test.
  - d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
  - e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

# **D. SPECIAL REQUIREMENT (S)**

# **Communitization Agreement**

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. <u>When the Communitization Agreement number is known, it shall also be on the sign.</u>

#### **Offline Cementing**

• Contact the BLM prior to the commencement of any offline cementing procedure.

# Approval Date: 06/17/2020

# BOPE Break Testing Variance (Note: For 5M BOPE or less)

- BOPE Break Testing is ONLY permitted for 5M BOPE or less.
- BOPE Break Testing is NOT permitted to drilling the production hole section.
- While in transfer between wells, the BOPE shall be secured by the hydraulic carrier or cradle.
- Any well control event while drilling require notification to the BLM Petroleum Engineer prior to the commencement of any BOPE Break Testing operations.
- A full BOPE test is required prior to drilling the first deep intermediate hole section. If any subsequent hole interval is deeper than the first, a full BOPE test will be required.
- The BLM is to be contacted (575-361-2822 Eddy County) (575-393-3612 Lea County) 4 hours prior to BOPE tests.
- As a minimum, a full BOPE test shall be performed at 21-day intervals.
- In the event any repairs or replacement of the BOPE is required, the BOPE shall test as per Onshore Oil and Gas Order No. 2.

# <u>A separate sundry will be sent prior to spud that reflects the pad based break</u> <u>testing plan</u>

# GENERAL REQUIREMENTS

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)
  - Eddy County

Call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822

- Lea County Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575) 393-3612
- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
  - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
  - b. When the operator proposes to set surface casing with Spudder Rig

Page 5 of 9

# **Approval Date: 06/17/2020**

- Notify the BLM when moving in and removing the Spudder Rig.
- Notify the BLM when moving in the 2<sup>nd</sup> Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
- BOP/BOPE test to be conducted per Onshore Oil and Gas Order No. 2 as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

# A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- <u>Wait on cement (WOC) for Potash Areas:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends, 2) until cement has been in place at least <u>24 hours</u>. WOC time will be recorded in the driller's log. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. <u>Wait on cement (WOC) for Water Basin:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least <u>8 hours</u>. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.

- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.

# B. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.

Page 7 of 9

# **Approval Date: 06/17/2020**

- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.
- e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
  - b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the plug. However, **no tests** shall commence until the cement has had a minimum of 24 hours setup time, except the casing pressure test can be initiated immediately after bumping the plug (only applies to single stage cement jobs).
  - c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to Onshore Order 2 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (8 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
  - d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall

# **Approval Date: 06/17/2020**

have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.

- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.

### C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

#### D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

# RI05152020

Page 9 of 9



#### U.S. Department of the Interior BUREAU OF LAND MANAGEMENT



# **Operator Certification**

I hereby certify that I, or someone under my direct supervision, have inspected the drill site and access route proposed herein; that I am familiar with the conditions which currently exist; that I have full knowledge of state and Federal laws applicable to this operation; that the statements made in this APD package are, to the best of my knowledge, true and correct; and that the work associated with the operations proposed herein will be performed in conformity with this APD package and the terms and conditions under which it is approved. I also certify that I, or the company I represent, am responsible for the operations conducted under this application. These statements are subject to the provisions of 18 U.S.C. 1001 for the filing of false statements.

NAME: Leslie Reeves		Signed on: 02/11/2020										
Title: Advisor Regulatory												
Street Address: 5 Greenway Plaza, Suite 110												
City: Houston	State: TX	<b>Zip:</b> 77046										
Phone: (713)497-2492	Phone: (713)497-2492											
Email address: Leslie_Reeves@ox	Email address: Leslie_Reeves@oxy.com											
Field Representative												
Representative Name: Mike Wilso	n											
Street Address:												
City: S	tate:	Zip:										
Phone: (575)631-6618												

Email address: Michael\_Wilson@oxy.com

# **WAFMSS**

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

#### APD ID: 10400054090

Operator Name: OXY USA INCORPORATED Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM Well Type: OIL WELL

#### Submission Date: 02/11/2020

Well Number: 173H Well Work Type: Drill Highlighted data reflects the most recent changes

06/25/2020

Application Data Report

Show Final Text

## Section 1 - General

APD ID:	10400054090	Tie to previous NOS?	N	Submission Date: 02/11/2020					
BLM Office:	CARLSBAD	User: Leslie Reeves	Title:	Advisor Regulatory					
Federal/India	an APD: FED	Is the first lease penetrated for production Federal or Indian? FED							
Lease numb	er: NMNM057273	Lease Acres: 607.16							
Surface acce	ess agreement in place?	Allotted?	Reservation:						
Agreement i	n place? NO	Federal or Indian agreement:							
Agreement r	number:								
Agreement r	name:								
Keep applica	ation confidential? Y								
Permitting A	gent? NO	APD Operator: OXY USA INCORPORATED							
Operator let	ter of designation:								

# **Operator Info**

Operator Organization Name: OXY USA INCORPORATED							
Operator Address: 5 Greenway Plaza, Suite 110	<b>Zip:</b> 77046						
Operator PO Box:							
Operator City: Houston State: TX							
<b>Operator Phone:</b> (713)366-5716							

**Operator Internet Address:** 

# **Section 2 - Well Information**

Well in Master Development Plan? EXISTING	Master Development Plan name: Sand Dunes Area							
Well in Master SUPO?	Master SUPO name:							
Well in Master Drilling Plan?	Master Drilling Plan name:							
Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM	Well Number: 173H	Well API Number:						
Field/Pool or Exploratory? Field and Pool	Field Name: COTTON DRAWPool Name: COTTON DRAWBONE SPRINGBONE SPRING							
Is the proposed well in an area containing other mine	eral resources? USEABLE WATE	R,NATURAL GAS,OIL,POTASH						

#### Is the proposed well in an area containing other mineral resources? USEABLE WATER, NATURAL GAS, OIL, POTASH

Distance to nearest well: 35 FT

Is the proposed well in a Helium production area? N Use Existing Well Pad? N Type of Well Pad: MULTIPLE WELL Well Class: HORIZONTAL

New surface disturbance?

Multiple Well Pad Name: JEFF Number: 11H, 12H, 41H, 42H, SMITH MDP1 7-18 FEDERAL 173H, 174H & 11H, 12H, 41H, COM & NUGGET 6-31 FEDERAL42H COM Number of Legs: 1

Distance to lease line: 20 FT

Well Work Type: Drill

Well Type: OIL WELL

**Describe Well Type:** 

Well sub-Type: INFILL

Describe sub-type:

Distance to town: 15 Miles

Reservoir well spacing assigned acres Measurement: 655 Acres

Well plat: JeffSmithMDP17\_18FdCom173H\_C102\_20200211150025.pdf

JeffSmithMDP17\_18FdCom173H\_SitePlan\_20200211150031.pdf

Well work start Date: 12/07/2020

Duration: 45 DAYS

# **Section 3 - Well Location Table**

Survey Type: RECTANGULAR

**Describe Survey Type:** 

Datum: NAD83

Survey number:

### Vertical Datum: NAVD88


#### Reference Datum: GROUND LEVEL

Wellbore	NS-Foot	NS Indicator	EW-Foot	EW Indicator	Twsp	Range	Section	Aliquot/Lot/Tract	Latitude	Longitude	County	State	Meridian	-ease Type	Lease Number	Elevation	MD	TVD	Will this well produce from this lease?
SHL Leg #1	275	FSL	225 6		24S	31E	6	Aliquot SESW	32.23987 31	- 103.8183 596	EDD	NEW MEXI CO	NEW MEXI CO	F	NMNM 082904	346 0	0	0	N
KOP Leg #1	50	FNL	210 0	FW L	24S	31E	7	Aliquot NENW	32.23897 86	- 103.8188 645	EDD Y	NEW MEXI CO	NEW MEXI CO	F	NMNM 057273	- 735 8	108 36	108 18	N

# Operator Name: OXY USA INCORPORATED Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

#### Well Number: 173H

Wellbore	NS-Foot	NS Indicator	EW-Foot	EW Indicator	Twsp	Range	Section	Aliquot/Lot/Tract	Latitude	Longitude	County	State	Meridian	Lease Type	Lease Number	Elevation	MD	TVD	Will this well produce from this lease?
PPP	100	FNL	210 0	FW	24S	31E	7	Aliquot	32.23884	-	EDD	NEW MEXI	NEW	F	NMNM	-	118	114 77	Y
Leg #1-1			0	L				NENW	12	103.8188 646	ľ	CO	MEXI CO		057273	801 7	21	//	
PPP Leg #1-2	1	FSL	209 9	FW L	24S	31E	18	Aliquot NENW	32.22458 9	- 103.8188 77	EDD Y	NEW MEXI CO	NEW MEXI CO	F	NMNM 089819	- 803 6	170 06	114 96	Y
EXIT Leg #1	100	FSL	210 0	FW L	24S	31E	18	Aliquot SESW	32.21034 22	- 103.8188 888	EDD Y	NEW MEXI CO	NEW MEXI CO	F	NMNM 089819	- 805 6	221 90	115 16	Y
BHL Leg #1	20	FSL	210 0	FW L	24S	31E	18	Aliquot SESW	32.21012 23	- 103.8188 896	EDD Y	NEW MEXI CO	NEW MEXI CO	F	NMNM 089819	- 805 7	222 70	115 17	N

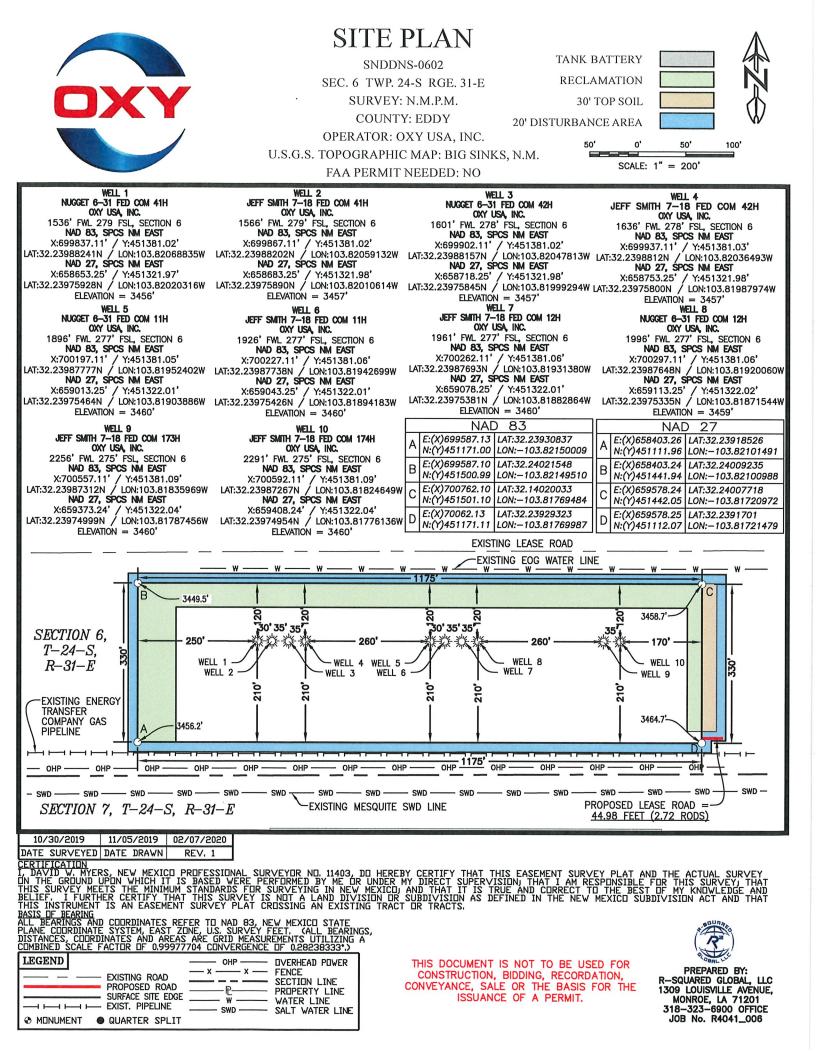

# ΔFMSS

#### U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

**Operator Name: OXY USA INCORPORATED** 

APD ID: 10400054090

Submission Date: 02/11/2020

Highlighted data reflects the most recent changes

06/25/2020

Drilling Plan Data Report

Show Final Text

# Well Number: 173H Well Work Type: Drill

Well Type: OIL WELL

# **Section 1 - Geologic Formations**

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Formation			True Vertical	Measured			Producing
ID	Formation Name	Elevation	Depth	Depth	Lithologies	Mineral Resources	Formation
656683	RUSTLER	3460	550	550	ANHYDRITE, DOLOMITE, SHALE	USEABLE WATER	N
656684	SALADO	2531	929	929	ANHYDRITE, DOLOMITE, HALITE, SHALE	OTHER : SALT	N
656681	CASTILE	663	2797	2797	ANHYDRITE	OTHER : salt	N
656685	DELAWARE	-725	4185	4185	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL, OTHER : BRINE	N
656686	BELL CANYON	-756	4216	4216	SANDSTONE, SILTSTONE	NATURAL GAS, OIL, OTHER, USEABLE WATER : BRINE	N
656687	CHERRY CANYON	-1652	5112	5112	SANDSTONE, SILTSTONE	NATURAL GAS, OIL, OTHER : BRINE	N
656688	BRUSHY CANYON	-2914	6374	6374	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL, OTHER : BRINE	N
656682	BONE SPRING	-4585	8045	8045	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL	N
659304	BONE SPRING 1ST	-5605	9065	9065	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL	Y
656692	BONE SPRING 2ND	-6324	9784	9784	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL	N
656693	BONE SPRING 3RD	-7559	11019	11039	LIMESTONE, SILTSTONE	NATURAL GAS, OIL	N
656694	WOLFCAMP	-8013	11473	11776	SANDSTONE, SILTSTONE	NATURAL GAS, OIL	Y

# **Section 2 - Blowout Prevention**

Pressure Rating (PSI): 5M

Rating Depth: 11517

Equipment: 13-5/8" 5M ANNULAR, 5M UPPER PIPE RAM, 5M BLIND RAM, 5M LOWER PIPE RAM

#### Requesting Variance? YES

Variance request: Request for the use of a flexible choke line from the BOP to Choke Manifold.

Testing Procedure: BOP/BOPE will be tested by an independent service company to 250 psi low and the high pressure indicated above per Onshore Order 2 requirements. The System may be upgraded to a higher pressure but still tested to the working pressure listed in the table above. If the system is upgraded all the components installed will be functional and

tested. Pipe rams will be operationally checked each 24 hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment will include a Kelly cock and floor safety valve (inside BOP) and choke lines and choke manifold. A multibowl wellhead or a unionized multibowl wellhead system will be employed. The wellhead and connection to the BOPE will meet all API 6A requirements. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system will be tested. We will test the flange connection of the wellhead with a test port that is directly in the flange. BOP Break Testing Request OXY requests permission to adjust the BOP break testing requirements as per the agreement reached in the OXY/BLM meeting on September 5, 2019. A separate sundry will be sent prior to spud that reflects the pad based break testing plan. BOP break test under the following conditions: After a full BOP test is conducted When skidding to drill an intermediate section where ICP is set into the third Bone Spring or shallower. When skidding to drill a production section that does not penetrate into the third Bone Spring or deeper. If the kill line is broken prior to skid, two tests will be performed. 1. Wellhead flange, co-flex hose, kill line connections and upper pipe rams 2. Wellhead flange, HCR valve, check valve, upper pipe rams If the kill line is not broken prior to skid, only one test will be performed. 1. Wellhead flange, co-flex hose, kill line is not broken prior to skid, only one test will be performed. 1. Wellhead flange, co-flex hose, check valve, upper pipe rams

#### Choke Diagram Attachment:

JeffSmithMDP17\_18FdCom173H\_ChokeManifold\_20200211151223.pdf

#### **BOP Diagram Attachment:**

JeffSmithMDP17\_18FdCom173H\_BOP\_20200211151232.PDF

JeffSmithMDP17\_18FdCom173H\_FlexHoseCert\_20200211151238.pdf

JeffSmithMDP17\_18FdCom173H\_WellControlPlan\_20200211151249.pdf

Casing ID	String Type	Hole Size	Csg Size	Condition	Standard	Tapered String	Top Set MD	Bottom Set MD	Top Set TVD	Bottom Set TVD	Top Set MSL	Bottom Set MSL	Calculated casing length MD	Grade	Weight	Joint Type	Collapse SF	Burst SF	Joint SF Type	Joint SF	Body SF Type	Body SF
1			-	NEW	API	N	0		•	869						-	1.12 5		BUOY	1.4	BUOY	1.4
2	INTERMED IATE	9.87 5	7.625	NEW	API	N	0	10736	0	10720	3471	-7260	10736	L-80	26.4	BUTT	1.12 5	1.2	BUOY	1.4	BUOY	1.4
3	PRODUCTI ON	6.75	5.5	NEW	API	N	0	22270	0	11517		-8057	22270	P- 110	-	OTHER - DQX	1.12 5	1.2	BUOY	1.4	BUOY	1.4

#### Section 3 - Casing

#### **Casing Attachments**

Well Number: 173H

#### **Casing Attachments**

Casing ID: 1 String Type: SURFACE

**Inspection Document:** 

Spec Document:

**Tapered String Spec:** 

#### Casing Design Assumptions and Worksheet(s):

JeffSmithMDP17\_18FdCom173H\_CsgCriteria\_20200211151335.pdf

Casing ID: 2 String Type:INTERMEDIATE

**Inspection Document:** 

Spec Document:

**Tapered String Spec:** 

#### Casing Design Assumptions and Worksheet(s):

JeffSmithMDP17\_18FdCom173H\_CsgCriteria\_20200211151420.pdf

Casing ID: 3 String Type: PRODUCTION

Inspection Document:

Spec Document:

#### **Tapered String Spec:**

# Casing Design Assumptions and Worksheet(s):

 $JeffSmithMDP17\_18FdCom173H\_CsgCriteria\_20200211151448.pdf$ 

 $JeffSmithMDP17\_18FdCom173H\_5.500in\_x\_20\_20200211151452.00$ 

 $JeffSmithMDP17\_18FdCom173H\_5.500in\_x\_20\_20200211151456.00$ 

Well Number: 173H

<b>Section</b>	4 -	Cement
----------------	-----	--------

String Type	Lead/Tail	Stage Tool Depth	Top MD	Bottom MD	Quantity(sx)	Yield	Density	Cu Ft	Excess%	Cement type	Additives
SURFACE	Lead		0	869	714	1.33	14.8	949	100	CLASS C	ACCELERATOR

INTERMEDIATE	Lead	2	0	6624	815	1.92	12.9	1565	10	Class C	Accelerator

INTERMEDIATE Lead 2	6624 1073 569 6		CLASS H RETARDER, CEMENT DISPERSANT, SALT
---------------------	--------------------	--	--

PRODUCTION	Lead	1023	2227	882	1.38	13.2	1217	20	CLASS H	RETARDER,
		6	0						CEMENT	DISPERSANT, SALT

# **Section 5 - Circulating Medium**

Mud System Type: Closed

Will an air or gas system be Used? NO

Description of the equipment for the circulating system in accordance with Onshore Order #2:

Diagram of the equipment for the circulating system in accordance with Onshore Order #2:

**Describe what will be on location to control well or mitigate other conditions:** Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements. The following is a general list of products: Barite, Bentonite, Gypsum, Lime, Soda Ash, Caustic Soda, Nut Plug, Cedar Fiber, Cotton Seed Hulls, Drilling Paper, Salt Water Clay, CaCl2.

Describe the mud monitoring system utilized: PVT/MD Totco/Visual Monitoring

**Circulating Medium Table** 

# Operator Name: OXY USA INCORPORATED

#### Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

#### Well Number: 173H

Top Depth	Bottom Depth	Mud Type	Min Weight (lbs/gal)	Max Weight (Ibs/gal)	Density (Ibs/cu ft)	Gel Strength (lbs/100 sqft)	НА	Viscosity (CP)	Salinity (ppm)	Filtration (cc)	Additional Characteristics
1073 6	2227 0	OTHER : Water- Based and/or Oil-Based Mud	9.5	12							
0	869	WATER-BASED MUD	8.6	8.8							
869	1073 6	OTHER : Saturated Brine Based Mud or Oil-Based Mud	8	10							

# Section 6 - Test, Logging, Coring

#### List of production tests including testing procedures, equipment and safety measures:

GR from TD to surface (horizontal well - vertical portion of hole). Mud Log from intermediate shoe to TD.

List of open and cased hole logs run in the well:

GAMMA RAY LOG, MUD LOG/GEOLOGIC LITHOLOGY LOG, MUD LOG/GEOLOGICAL LITHOLOGY LOG,

Coring operation description for the well:

No coring is planned at this time.

# **Section 7 - Pressure**

 Anticipated Bottom Hole Pressure: 7187
 Anticipated Surface Pressure: 4653

 Anticipated Bottom Hole Temperature(F): 173

 Anticipated abnormal pressures, temperatures, or potential geologic hazards? NO

 Describe:

 Contingency Plans geohazards description:

 Contingency Plans geohazards attachment:

Hydrogen Sulfide drilling operations plan required? YES

Hydrogen sulfide drilling operations plan:

JeffSmithMDP17\_18FdCom173H\_H2S1\_20200211151852.pdf JeffSmithMDP17\_18FdCom173H\_H2S2\_20200211151857.pdf JeffSmithMDP17\_18FdCom173H\_H2SEmerCont\_20200211151903.pdf Operator Name: OXY USA INCORPORATED

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

# **Section 8 - Other Information**

#### Proposed horizontal/directional/multi-lateral plan submission:

JeffSmithMDP17\_18FdCom173H\_DirectPlot\_20200211151919.pdf

JeffSmithMDP17\_18FdCom173H\_DirectPlan\_20200211151923.pdf

#### Other proposed operations facets description:

OXY requests the option to set casing shallower yet still below the salts if losses or hole conditions require this. Cement volumes may be adjusted if casing is set shallower and a DV tool will be run in case a contingency second stage is required for cement to reach surface. If cement circulated to surface during first stage we will drop a cancelation cone and not pump the second stage.

OXY requests the option to run production casing with DQX and/or SF TORQ connections to accommodate hole conditions or drilling operations.

OXY requests to pump a two stage cement job on the intermediate II casing string with the first stage being pumped conventionally with the calculated TOC @ the Bone Spring and the second stage performed as a bradenhead squeeze with planned cement from the Bone Spring to surface.

Annular Clearance Variance Request - As per the agreement reached in the OXY/BLM meeting on Feb 22, 2018, Oxy requests permission to allow deviation from the 0.422 annular clearance requirement from Onshore Order #2 under the following conditions:

1. Annular clearance to meet or exceed 0.422 between intermediate casing ID and production casing coupling only on the first 500 overlap between both casings.

2. Annular clearance less than 0.422 is acceptable for the curve and lateral portions of the production open hole section.

Well will be drilled with a walking/skidding operation. Plan to drill the multiple well pad in batch by section: all surface sections, intermediate sections and production sections. The wellhead will be secured with a night cap whenever the rig is not over the well.

OXY requests the option to contract a Surface Rig to drill, set surface casing, and cement for this well. If the timing between rigs is such that OXY would not be able to preset surface, the Primary Rig will MIRU and drill the well in its entirety per the APD. Please see the attached document for information on the spudder rig.

OXY respectfully requests a variance to cement the 9-5/8 and/or 7-5/8 intermediate casing strings offline. The summarized operational sequence will be as follows:

1. Run casing as per normal operations. While running casing, conduct negative pressure test and confirm integrity of the float equipment (float collar and shoe).

2. Land casing.

- 3. Fill pipe with kill weight fluid, and confirm well is static.
- a. If well is not static notify BLM and kill well.
- b. Once well is static notify BLM with intent to proceed with nipple down and offline cementing.
- 4. Set and pressure test annular packoff.

5. After confirmation of both annular barriers and internal barriers, nipple down BOP and install cap flange. If any barrier fails to test, the BOP stack will not be nippled down until after the cement job is completed.

6. Skid rig to next well on pad.

- 7. Confirm well is static before removing cap flange.
- 8. If well is not static notify BLM and kill well prior to cementing or nippling up for further remediation.
- 9. Install offline cement tool.
- 10. Rig up cement equipment.
- a. Notify BLM prior to cement job.

11. Perform cement job.

12. Confirm well is static and floats are holding after cement job.

13. Remove cement equipment, offline cement tools and install night cap with pressure gauge for monitoring.

Oxy requests permission to adjust the CBL requirement after bradenhead cement jobs, on 7-5/8 intermediate casings, as per the agreement reached in the OXY/BLM meeting on September 5, 2019. Three string wells:

CBL will be required on one well per pad

If the pumped volume of cement is less than permitted in the APD, BLM will be notified and a CBL may be run

Echometer will be used after bradenhead cement job to determine TOC before pumping top-out cement

#### Other proposed operations facets attachment:

JeffSmithMDP17\_18FdCom173H\_DrillPlan\_20200211152029.pdf

JeffSmithMDP17\_18FdCom173H\_SpudRigData\_20200211152036.pdf

#### Other Variance attachment:

# OXY USA Inc - Well Control Plan -

# A. Component and Preventer Compatibility Table

The table below, which covers the drilling and casing of the >5M MASP portion of the well, outlines the tubulars and the compatible preventers in use. This table, combined with the mud program, documents that two barriers to flow can be maintained at all times, independent of the rating of the annular preventer.

Component	OD	Preventer	RWP
Drillpipe	4-1/2"-5"	Lower 3-1/2 - 5-1/2" VBR	10M
		Upper 3-1/2 - 5-1/2" VBR	
HWDP	4-1/2"-5"	Lower 3-1/2 - 5-1/2" VBR	10M
		Upper 3-1/2 - 5-1/2" VBR	
Drill collars and MWD tools	4-3/4" - 5-1/2"	Lower 3-1/2 - 5-1/2" VBR	10M
		Upper 3-1/2 - 5-1/2" VBR	
Mud Motor	4-3/4"	Lower 3-1/2 - 5-1/2" VBR	10M
		Upper 3-1/2 - 5-1/2" VBR	
Production casing	5-1/2"	Lower 3-1/2 - 5-1/2" VBR	10M
		Upper 3-1/2 - 5-1/2" VBR	
ALL	0" - 13-5/8"	Annular	5M
Open-hole	6-3/4"	Blind Rams	10M

Pilot Hole and/or Lateral Sections, 10M requirement

VBR = Variable Bore Ram. Compatible range listed in chart.

HWDP = Heavy Weight Drill Pipe

MWD = Measurement While Drilling

# **B.** Well Control Procedures

Well control procedures are specific to the rig equipment and the operation at the time the kick occurs. Below are the minimal high-level tasks prescribed to assure a proper shut-in while drilling, tripping, running casing, pipe out of the hole (open hole), and moving the Bottom Hole Assembly (BHA) through the Blowout Preventers (BOP). The pressure at which control is swapped from the annular to another compatible ram will occur when the anticipated pressure is approaching or envisioned to exceed 70% of the 5M annular Rated Working Pressure (RWP) or 3500 PSI.

General Procedure While Drilling

- 1. Sound alarm (alert crew)
- 2. Space out drill string
- 3. Shut down pumps (stop pumps and rotary)
- 4. Shut-in Well (uppermost applicable BOP, typically annular preventer first. The Hydraulic Control Remote (HCR) valve and choke will already be in the closed position).
- 5. Confirm shut-in
- 6. Notify tool pusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or expected to reach 70% of the annular RWP during kill operations, crew will reconfirm spacing and swap to the upper pipe ram

# **OXY USA Inc - Well Control Plan -**

### General Procedure While Tripping

- 1. Sound alarm (alert crew)
- 2. Stab full opening safety valve and close
- 3. Space out drill string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. The HCR and choke will already be in the closed position)
- 5. Confirm shut-in
- 6. Notify tool pusher/company representative
- 7. Read and record the following
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
  - d. Regroup and identify forward plan
  - e. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to the upper pipe ram

General Procedure While Running Casing

- 1. Sound alarm (alert crew)
- 2. Stab crossover and full opening safety valve and close
- 3. Space out string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. The HCR and choke will already be in the closed position).
- 5. Confirm shut-in
- 6. Notify tool pusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
  - d. Regroup and identify forward plan.
  - e. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to compatible pipe ram.

# General Procedure With No Pipe In Hole (Open Hole)

- 1. Sound alarm (alert crew)
- 2. Shut-in with blind rams or BSR. (The HCR and choke will already be in the closed position)
- 3. Confirm shut-in
- 4. Notify tool pusher/company representative
- 5. Read and record the following:
  - a. SICP
  - b. Pit gain
  - c. Time
- 6. Regroup and identify forward plan

# **OXY USA Inc - Well Control Plan -**

General Procedures While Pulling BHA thru Stack

- 1. PRIOR to pulling last joint of drill pipe thru the stack.
  - a. Perform flow check, if flowing:
  - b. Sound alarm (alert crew)
  - c. Stab full opening safety valve and close
  - d. Space out drill string with tool joint just beneath the upper pipe ram
  - e. Shut-in using upper pipe ram. (The HCR and choke will already be in the closed position)
  - f. Confirm shut-in
  - g. Notify tool pusher/company representative
  - h. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
    - iv. Regroup and identify forward plan
- 2. With BHA in the stack and compatible ram preventer and pipe combo immediately available.
  - a. Sound alarm (alert crew)
  - b. Stab crossover and full opening safety valve and close
  - c. Space out drill string with upset just beneath the compatible pipe ram
  - d. Shut-in using compatible pipe ram. (The HCR and choke will already be in the closed position.)
  - e. Confirm shut-in
  - f. Notify tool pusher/company representative
  - g. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
    - iv. Regroup and identify forward plan
- 3. With BHA in the stack and NO compatible ram preventer and pipe combo immediately available.
  - a. Sound alarm (alert crew)
  - b. If possible to pick up high enough, pull string clear of the stack and follow "Open Hole" scenario
  - c. If impossible to pick up high enough to pull the string clear of the stack
  - d. Stab crossover, make up one joint/stand of drill pipe, and full opening safety valve and close
  - e. Space out drill string with tool joint just beneath the upper pipe ram
  - f. Shut-in using upper pipe ram. (The HCR and choke will already be in the closed position)
  - g. Confirm shut-in
  - h. Notify tool pusher/company representative
  - i. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
- j. Regroup and identify forward plan




# Permian Drilling Hydrogen Sulfide Drilling Operations Plan Jeff Smith MDP1 7\_18 Fed Com 173H

Open drill site. No homes or buildings are near the proposed location.

1. Escape

Personnel shall escape upwind of wellbore in the event of an emergency gas release. Escape can take place through the lease road on the Southeast side of the location. Personnel need to move to a safe distance and block the entrance to location. If the primary route is not an option due to the wind direction, then a secondary egress route should be taken.

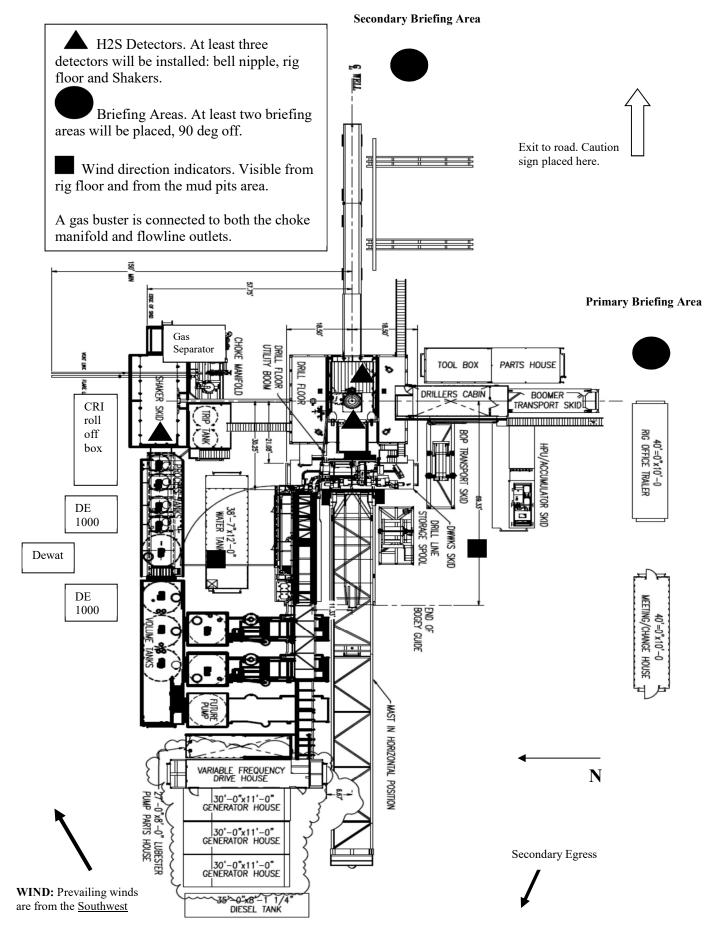



# Permian Drilling Hydrogen Sulfide Drilling Operations Plan New Mexico

# <u>Scope</u>

This contingency plan establishes guidelines for the public, all company employees, and contract employees who's work activities may involve exposure to hydrogen sulfide (H2S) gas.

While drilling this well, it is possible to encounter H2S bearing formations. At all times, the first barrier to control H2S emissions will be the drilling fluid, which will have a density high enough to control influx.

# **Objective**

- 1. Provide an immediate and predetermined response plan to any condition when H2S is detected. All H2S detections in excess of 10 parts per million (ppm) concentration are considered an Emergency.
- 2. Prevent any and all accidents, and prevent the uncontrolled release of hydrogen sulfide into the atmosphere.
- 3. Provide proper evacuation procedures to cope with emergencies.
- 4. Provide immediate and adequate medical attention should an injury occur.

# **Discussion**

Implementation:	This plan with all details is to be fully implemented before drilling to <u>commence</u> .
Emergency response Procedure:	This section outlines the conditions and denotes steps to be taken in the event of an emergency.
Emergency equipment Procedure:	This section outlines the safety and emergency equipment that will be required for the drilling of this well.
Training provisions:	This section outlines the training provisions that must be adhered to prior to drilling.
Drilling emergency call lists:	Included are the telephone numbers of all persons to be contacted should an emergency exist.
Briefing:	This section deals with the briefing of all people involved in the drilling operation.
Public safety:	Public safety personnel will be made aware of any potential evacuation and any additional support needed.
Check lists:	Status check lists and procedural check lists have been included to insure adherence to the plan.
General information:	A general information section has been included to supply support information.

# **<u>Hydrogen Sulfide Training</u>**

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on the well:

- 1. The hazards and characteristics of H2S.
- 2. Proper use and maintenance of personal protective equipment and life support systems.
- 3. H2S detection.
- 4. Proper use of H2S detectors, alarms, warning systems, briefing areas, evacuation procedures and prevailing winds.
- 5. Proper techniques for first aid and rescue procedures.
- 6. Physical effects of hydrogen sulfide on the human body.
- 7. Toxicity of hydrogen sulfide and sulfur dioxide.
- 8. Use of SCBA and supplied air equipment.
- 9. First aid and artificial respiration.
- 10. Emergency rescue.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H2S on metal components. If high tensile strength tubular is to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling a well, blowout prevention and well control procedures.
- 3. The contents and requirements of the H2S Drilling Operations Plan.

H2S training refresher must have been taken within one year prior to drilling the well. Specifics on the well to be drilled will be discussed during the pre-spud meeting. H2S and well control (choke) drills will be performed while drilling the well, at least on a weekly basis. This plan shall be available in the well site. All personnel will be required to carry the documentation proving that the H2S training has been taken.

Service company and visiting personnel

- A. Each service company that will be on this well will be notified if the zone contains H2S.
- B. Each service company must provide for the training and equipment of their employees before they arrive at the well site.
- C. Each service company will be expected to attend a well site briefing

# **Emergency Equipment Requirements**

#### 1. <u>Well control equipment</u>

The well shall have hydraulic BOP equipment for the anticipated pressures. Equipment is to be tested on installation and follow Oxy Well Control standard, as well as BLM Onshore Order #2.

Special control equipment:

- A. Hydraulic BOP equipment with remote control on ground. Remotely operated choke.
- B. Rotating head
- C. Gas buster equipment shall be installed before drilling out of surface pipe.

#### 2. <u>Protective equipment for personnel</u>

- A. Four (4) 30-minute positive pressure air packs (2 at each briefing area) on location.
- B. Adequate fire extinguishers shall be located at strategic locations.
- C. Radio / cell telephone communication will be available at the rig.
  - Rig floor and trailers.
  - Vehicle.

#### 3. <u>Hydrogen sulfide sensors and alarms</u>

- A. H2S sensor with alarms will be located on the rig floor, at the bell nipple, and at the flow line. These monitors will be set to alarm at 10 ppm with strobe light, and audible alarm.
- B. Hand operated detectors with tubes.
- C. H2S monitor tester (to be provided by contract Safety Company.)
- D. There shall be one combustible gas detector on location at all times.

#### 4. <u>Visual Warning Systems</u>

A. One sign located at each location entrance with the following language:

Caution – potential poison gas Hydrogen sulfide No admittance without authorization

#### *Wind sock – wind streamers:*

- A. One 36" (in length) wind sock located at protection center, at height visible from rig floor.
- B. One 36" (in length) wind sock located at height visible from pit areas.

# Condition flags

A. One each condition flag to be displayed to denote conditions.

green – normal conditions yellow – potential danger red – danger, H2S present

B. Condition flag shall be posted at each location sign entrance.

### 5. <u>Mud Program</u>

The mud program is designed to minimize the risk of having H2S and other formation fluids at surface. Proper mud weight and safe drilling practices will be applied. H2S scavengers will be used to minimize the hazards while drilling. Below is a summary of the drilling program.

#### Mud inspection devices:

Garrett gas train or hatch tester for inspection of sulfide concentration in mud system.

#### 6. <u>Metallurgy</u>

- A. Drill string, casing, tubing, wellhead, blowout preventers, drilling spools or adapters, kill lines, choke manifold, lines and valves shall be suitable for the H2S service.
- B. All the elastomers, packing, seals and ring gaskets shall be suitable for H2S service.

# 7. <u>Well Testing</u>

No drill stem test will be performed on this well.

8. <u>Evacuation plan</u>

Evacuation routes should be established prior to well spud for each well and discussed with all rig personnel.

- 9. <u>Designated area</u>
  - A. Parking and visitor area: all vehicles are to be parked at a predetermined safe distance from the wellhead.
  - B. There will be a designated smoking area.
  - C. Two briefing areas on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds perpendicularly, or at a 45-degree angle if wind direction tends to shift in the area.

### **Emergency procedures**

- A. In the event of any evidence of H2S level above 10 ppm, take the following steps:
  - 1. The Driller will pick up off bottom, shut down the pumps, slow down the pipe rotation.
  - 2. Secure and don escape breathing equipment, report to the upwind designated safe briefing / muster area.
  - 3. All personnel on location will be accounted for and emergency search should begin for any missing, the Buddy System will be implemented.
  - 4. Order non-essential personnel to leave the well site, order all essential personnel out of the danger zone and upwind to the nearest designated safe briefing / muster area.
  - 5. Entrance to the location will be secured to a higher level than our usual "Meet and Greet" requirement, and the proper condition flag will be displayed at the entrance to the location.
  - 6. Take steps to determine if the H2S level can be corrected or suppressed and, if so, proceed as required.
- B. If uncontrollable conditions occur:
  - 1. Take steps to protect and/or remove any public in the down-wind area from the rig – partial evacuation and isolation. Notify necessary public safety personnel and appropriate regulatory entities (i.e. BLM) of the situation.

- 2. Remove all personnel to the nearest upwind designated safe briefing / muster area or off location.
- 3. Notify public safety personnel of safe briefing / muster area.
- 4. An assigned crew member will blockade the entrance to the location. No unauthorized personnel will be allowed entry to the location.
- 5. Proceed with best plan (at the time) to regain control of the well. Maintain tight security and safety procedures.
- C. Responsibility:
  - 1. Designated personnel.
    - a. Shall be responsible for the total implementation of this plan.
    - b. Shall be in complete command during any emergency.
    - c. Shall designate a back-up.

All personnel:	1.	On alarm, don escape unit and report to the nearest upwind designated safe briefing / muster area upw
	2.	Check status of personnel (buddy system).
	3.	Secure breathing equipment.
	4.	Await orders from supervisor.
Drill site manager:	1.	Don escape unit if necessary and report to nearest upwind designated safe briefing / muster area.
	2.	Coordinate preparations of individuals to return to point of release with tool pusher and driller (using the buddy system).
	3.	Determine H2S concentrations.
	4.	Assess situation and take control measures.
Tool pusher:	1.	Don escape unit Report to up nearest upwind designated safe briefing / muster area.
	2.	Coordinate preparation of individuals to return to point of release with tool pusher drill site manager (using the buddy system).
	3.	Determine H2S concentration.
	4.	Assess situation and take control measures.
Driller:	1.	Don escape unit, shut down pumps, continue

	<ol> <li>2.</li> <li>3.</li> <li>4.</li> <li>5.</li> <li>6.</li> </ol>	rotating DP. Check monitor for point of release. Report to nearest upwind designated safe briefing / muster area. Check status of personnel (in an attempt to rescue, use the buddy system). Assigns least essential person to notify Drill Site Manager and tool pusher by quickest means in case of their absence. Assumes the responsibilities of the Drill Site Manager and tool pusher until they arrive should they be absent.
Derrick man Floor man #1 Floor man #2	1.	Will remain in briefing / muster area until instructed by supervisor.
Mud engineer:	1. 2.	Report to nearest upwind designated safe briefing / muster area. When instructed, begin check of mud for ph and H2S level. (Garett gas train.)
Safety personnel:	1.	Mask up and check status of all personnel and secure operations as instructed by drill site manager.

# Taking a kick

When taking a kick during an H2S emergency, all personnel will follow standard Well control procedures after reporting to briefing area and masking up.

# **Open-hole logging**

All unnecessary personnel off floor. Drill Site Manager and safety personnel should monitor condition, advise status and determine need for use of air equipment.

# Running casing or plugging

Following the same "tripping" procedure as above. Drill Site Manager and safety personnel should determine if all personnel have access to protective equipment.

#### **Ignition procedures**

The decision to ignite the well is the responsibility of the operator (Oxy Drilling Management). The decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope controlling the blowout under the prevailing conditions at the well.

#### Instructions for igniting the well

- 1. Two people are required for the actual igniting operation. They must wear self-contained breathing units and have a safety rope attached. One man (tool pusher or safety engineer) will check the atmosphere for explosive gases with the gas monitor. The other man is responsible for igniting the well.
- 2. Primary method to ignite: 25 mm flare gun with range of approximately 500 feet.
- 3. Ignite upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best for protection, and which offers an easy escape route.
- 5. Before firing, check for presence of combustible gas.
- 6. After lighting, continue emergency action and procedure as before.
- 7. All unassigned personnel will remain in briefing area until instructed by supervisor or directed by the Drill Site Manager.

**<u>Remember</u>**: After well is ignited, burning hydrogen sulfide will convert to sulfur dioxide, which is also highly toxic. **<u>Do not assume the area is safe after the well is ignited.</u>** 

#### Status check list

Note: All items on this list must be completed before drilling to production casing point.

- 1. H2S sign at location entrance.
- 2. Two (2) wind socks located as required.
- 3. Four (4) 30-minute positive pressure air packs (2 at each Briefing area) on location for all rig personnel and mud loggers.
- 4. Air packs inspected and ready for use.
- 5. Cascade system and hose line hook-up as needed.
- 6. Cascade system for refilling air bottles as needed.
- 7. Condition flag on location and ready for use.
- 8. H2S detection system hooked up and tested.
- 9. H2S alarm system hooked up and tested.
- 10. Hand operated H2S detector with tubes on location.
- 11. 1 100' length of nylon rope on location.
- 12. All rig crew and supervisors trained as required.
- 13. All outside service contractors advised of potential H2S hazard on well.
- 14. No smoking sign posted and a designated smoking area identified.
- 15. Calibration of all H2S equipment shall be noted on the IADC report.

# Procedural check list during H2S events

#### **Perform each tour:**

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to ensure that it in proper working order.
- 3. Make sure all the H2S detection system is operative.

#### Perform each week:

- 1. Check each piece of breathing equipment to make sure that demand or forced air regulator is working. This requires that the bottle be opened and the mask assembly be put on tight enough so that when you inhale, you receive air or feel air flow.
- 2. BOP skills (well control drills).
- 3. Check supply pressure on BOP accumulator stand by source.
- 4. Check breathing equipment mask assembly to see that straps are loosened and turned back, ready to put on.
- 5. Check pressure on breathing equipment air bottles to make sure they are charged to full volume. ( Air quality checked for proper air grade "D" before bringing to location)
- 6. Confirm pressure on all supply air bottles.
- 7. Perform breathing equipment drills with on-site personnel.
- 8. Check the following supplies for availability.
  - A. Emergency telephone list.
  - B. Hand operated H2S detectors and tubes.

# General evacuation plan

- 1. When the company approved supervisor (Drill Site Manager, consultant, rig pusher, or driller) determines the H2S gas cannot be limited to the well location and the public will be involved, he will activate the evacuation plan.
- 2. Drill Site Manager or designee will notify local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company or contractor safety personnel that have been trained in the use of H2S detection equipment and self-contained breathing equipment will monitor H2S concentrations, wind directions, and area of exposure. They will delineate the outer perimeter of the hazardous gas area. Extension to the evacuation area will be determined from information gathered.
- 4. Law enforcement personnel (state police, police dept., fire dept., and sheriff's dept.) Will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.
- 5. After the discharge of gas has been controlled, company safety personnel will determine when the area is safe for re-entry.

<u>Important:</u> Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.

#### **Emergency actions**

#### Well blowout – if emergency

- 1. Evacuate all personnel to "Safe Briefing / Muster Areas" or off location if needed.
- 2. If sour gas evacuate rig personnel.
- 3. If sour gas evacuate public within 3000 ft radius of exposure.
- 4. Don SCBA and shut well in if possible using the buddy system.
- 5. Notify Drilling Superintendent and call 911 for emergency help (fire dept and ambulance) if needed.
- 6. Implement the Blowout Contingency Plan, and Drilling Emergency Action Plan.
- 6. Give first aid as needed.

#### Person down location/facility

- 1. If immediately possible, contact 911. Give location and wait for confirmation.
- 2. Don SCBA and perform rescue operation using buddy system.

#### Toxic effects of hydrogen sulfide

Hydrogen sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 ppm, which is .001% by volume. Hydrogen sulfide is heavier than air (specific gravity -1.192) and colorless. It forms an explosive mixture with air between 4.3 and 46.0 percent by volume. Hydrogen sulfide is almost as toxic as hydrogen cyanide and is between five and six times more toxic than carbon monoxide. Toxicity data for hydrogen sulfide and various other gases are compared in table i. Physical effects at various hydrogen sulfide exposure levels are shown in table ii.

Common	Chemical	Specific	Threshold	Hazardous	Lethal concentration
name	formula	gravity (sc=1)	limit (1)	limit (2)	(3)
Hydrogen Cyanide	Hcn	0.94	10 ppm	150 ppm/hr	300 ppm
Hydrogen Sulfide	H2S	1.18	10 ppm	250 ppm/hr	600 ppm
Sulfur Dioxide	So2	2.21	5 ppm	-	1000 ppm
Chlorine	Cl2	2.45	1 ppm	4 ppm/hr	1000 ppm
Carbon Monoxide	Co	0.97	50 ppm	400 ppm/hr	1000 ppm
Carbon Dioxide	Co2	1.52	5000 ppm	5%	10%
Methane	Ch4	0.55	90,000 ppm	Combustibl	e above 5% in air

#### Table i <u>Toxicity of various gases</u>

1) threshold limit – concentration at which it is believed that all workers may be repeatedly exposed day after day without adverse effects.

- 2) hazardous limit concentration that will cause death with short-term exposure.
- 3) lethal concentration concentration that will cause death with short-term exposure.

#### Toxic effects of hydrogen sulfide

#### Table ii Physical effects of hydrogen sulfide

		<b>Concentration</b>	Physical effects
Percent (%)	<u>Ppm</u>	Grains	
		100 std. Ft3*	
0.001	<10	00.65	Obvious and unpleasant odor.

0.002	10	01.30	Safe for 8 hours of exposure.
0.010	100	06.48	Kill smell in 3 – 15 minutes. May sting eyes and throat.
0.020	200	12.96	Kills smell shortly; stings eyes and throat.
0.050	500	32.96	Dizziness; breathing ceases in a few minutes; needs prompt artificial respiration.
0.070	700	45.36	Unconscious quickly; death will result if not rescued promptly.
0.100	1000	64.30	Unconscious at once; followed by death within minutes.

\*at 15.00 psia and 60'f.

#### Use of self-contained breathing equipment (SCBA)

- 1. Written procedures shall be prepared covering safe use of SCBA's in dangerous atmosphere, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available SCBA.
- 2 SCBA's shall be inspected frequently at random to insure that they are properly used, cleaned, and maintained.
- 3. Anyone who may use the SCBA's shall be trained in how to insure proper facepiece to face seal. They shall wear SCBA's in normal air and then wear them in a test atmosphere. (note: such items as facial hair {beard or sideburns} and eyeglasses will not allow proper seal.) Anyone that may be reasonably expected to wear SCBA's should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses or contact lenses.
- 4. Maintenance and care of SCBA's:
  - a. A program for maintenance and care of SCBA's shall include the following:
    - 1. Inspection for defects, including leak checks.
    - 2. Cleaning and disinfecting.
    - 3. Repair.
    - 4. Storage.
  - b. Inspection, self-contained breathing apparatus for emergency use shall be inspected monthly.
    - 1. Fully charged cylinders.
    - 2. Regulator and warning device operation.
    - 3. Condition of face piece and connections.
    - 4. Rubber parts shall be maintained to keep them pliable and prevent deterioration.
  - c. Routinely used SCBA's shall be collected, cleaned and disinfected as frequently as necessary to insure proper protection is provided.
- 5. Persons assigned tasks that requires use of self-contained breathing equipment shall be certified physically fit (medically cleared) for breathing equipment usage at least annually.
- 6. SCBA's should be worn when:
  - A. Any employee works near the top or on top of any tank unless test reveals less than 10 ppm of H2S.

- B. When breaking out any line where H2S can reasonably be expected.
- C. When sampling air in areas to determine if toxic concentrations of H2S exists.
- D. When working in areas where over 10 ppm H2S has been detected.
- E. At any time there is a doubt as to the H2S level in the area to be entered.

#### <u>Rescue</u> First aid for H2S poisoning

Do not panic!

Remain calm – think!

- 1. Don SCBA breathing equipment.
- 2. Remove victim(s) utilizing buddy system to fresh air as quickly as possible. (go up-wind from source or at right angle to the wind. Not down wind.)
- 3. Briefly apply chest pressure arm lift method of artificial respiration to clean the victim's lungs and to avoid inhaling any toxic gas directly from the victim's lungs.
- 4. Provide for prompt transportation to the hospital, and continue giving artificial respiration if needed.
- 5. Hospital(s) or medical facilities need to be informed, before-hand, of the possibility of H2S gas poisoning no matter how remote the possibility is.
- 6. Notify emergency room personnel that the victim(s) has been exposed to H2S gas.

Besides basic first aid, everyone on location should have a good working knowledge of artificial respiration.

Revised CM 6/27/2012

#### OXY Permian Delaware NM Basin Drilling & Completions Incident Reporting OXY Permian Crisis Team Hotline Notification

Person	Location Office Phone		Cell/Mobile Phone	Home Phone	Pager Number	
Drilling & Completions Department						
Drilling & Completions Manager: John Willis	Houston	(713) 366-5556	(713) 259-1417			
Drilling Superintendent: Simon Benavides	Houston	(713) 215-7403	(832) 528-3547			
Completions Superintendent: Chris Winter	Houston	(713) 366-5212	(806) 239-8774			
Drilling Eng. Supervisor: Diego Tellez	Houston	(713) 350-4602	(713) 303-4932			
Drilling Eng. Supervisor: Randy Neel	Houston	(713) 215-7987	(713) 517-5544			
Completions Eng. Supervisor: Evan Hinkel	Houston	(713) 366-5436	(281) 236-6153			
Drilling & Completions HES Lead. Ryan Green	Houston	713-336-5753	281-520-5216			
Drilling & Completions HES Advisor:Kenny Williams	Carlsbad	(432) 686-1434	(337) 208-0911			
Drilling & Completions HES Advisor:Kyle Holden	Carlsbad	(432) 686-1435	(661) 369-5328			
Drilling & Completions HES Advisor Sr:Dave Schmidt	Carlsbad		(559) 310-8572			
Drilling & Completions HES Advisor Clibate Commut Drilling & Completions HES Advisor. :Seth Doyle	Carlsbad		(337) 499-0756			
HES / Enviromental & Regulatory	1					
Department	Location	Office	Cell Phone			
Jon Hamil-HES Manager	Houston	(713) 497-2494	(832) 537-9885			
Mark Birk-HES Manager	Houston	(713) 350-4615	(949) 413-3127			
Austin Tramell	Midland	(432) 699-4208	(575) 499-4919			
Rico Munoz	Midland	(432) 699-8366	(432) 803-4116			
Amber DuckWorth	Midland		(832) 966-1879			
Kelley Montgomery- Regulatory Manager	Houston	(713) 366-5716	(832) 454-8137			
Sandra Musallam -Regulatory Lead	Houston	+1 (713) 366-5106	+1 (713) 504-8577			
Bishop, Steve-DOT Pipeline Coordinator	Midland	432-685-5614				
Wilson, Dusty-Safety Advisor	Midland	432-685-5771	(432) 254-2336			
John W Dittrich Eniromental Advisor	Midland		(575) 390-2828			
William (Jack) Calhoun-Environmental Lead	Houston	+713 (350) 4906	(281) 917-8571			
Robert Barrow-Risk Engineer Manager	Houston	(713) 366-5611	(832) 867-5336			
Sarah Holmes-HSE Cordinator	Midland	432-685-5758				
Administrative	Location	Office				
Sarah Holmes	Midland	432-685-5830				
Robertson, Debbie	Midland	432-685-5812				
Laci Hollaway	Midland	(432) 685-5716	(432) 631-6341			
Administrative	Location	Office				
Rosalinda Escajeda	Midland	432-685-5831				
Moreno, Leslie (contract)	Hobbs	575-397-8247				
Sehon, Angela (contractor)	Levelland	806-894-8347				
Vasquez, Claudia (contractor)	North Cowden	432-385-3120				
XstremeMD	Location	Office				
Medical Case Management	Orla, TX	(337) 205-9314				
Axiom Medical Consulting	Location	Office				
Medical Case Management		(877) 502-9466				
Populatory Aganaias						
Regulatory Agencies	Collect ND4	(505) 007 (544				
Bureau of Land Management	Carlsbad, NM	(505) 887-6544				
Bureau of Land Management	Hobbs, NM	(505) 393-3612				
Bureau of Land Management	Roswell, NM	(505) 393-3612				
Bureau of Land Management	Santa Fe, NM	(505) 988-6030				

[			1		
DOT Juisdictional Pipelines-Incident Reporting New		(505) 827-3549			
Mexico Public Regulaion Commission	Santa Fe, NM	(505) 490-2375			
DOT Juisdictional Pipelines-Incident Reporting Texas Railroad Commission	Austin, TX	(512) 463-6788			
		. ,			
EPA Hot Line	Dallas, Texas	(214) 665-6444			
Federal OSHA, Area Office	Lubbock, Texas	(806) 472-7681			
National Response Center	Washington, D. C.	(800) 424-8802			
National Infrastructure Coordinator Center		(202) 282-9201			
New Mexico Air Quality Bureau	Santa Fe, NM	(505) 827-1494	After Hours (505) 370-		
New Mexico Oil Conservation Division	Artesia, NM	(505) 748-1283	7545		
New Mexico Oil Conservation Division	Hobbs, NM	(505) 393-6161			
New Mexico Oil Conservation Division	Santa Fe, NM	(505) 471-1068			
New Mexico OCD Environmental Bureau	Santa Fe, NM	(505) 476-3470			
New Mexico Environmental Department	Hobbs, NM	(505) 827-9329			
NM State Emergency Response Center	Santa Fe, NM	(505) 827-9222			
Railroad Commission of TX	District 1 San Antonio,	(210) 227-1313			
Railroad Commission of TX	District 7C San Angelo	(325) 657-7450			
Railroad Commission of TX	District 8, 8A Midland	(432) 684-5581			
Texas Emergency Response Center	Austin, TX	(512) 463-7727			
TCEQ Air	· · · ·	. ,			
TCEQ Air TCEQ Water/Waste/Air	Region 2 Lubbock, TX Region 3 Abilene, TX	(806) 796-3494			
		(325) 698-9674			
TCEQ Water/Waste/Air	Region 7 Midland, TX	(432) 570-1359			
TCEQ Water/Waste/Air	Region 9 San Antonio,	(512) 734-7981			
TCEQ Water/Waste/Air	Region 8 San Angelo	(325) 655-9479			
Medical Facilities					
Abernathy Medical Clinic	Abernathy, TX	(806) 298-2524			
Alliance Hospital	Odessa, TX	(432) 550-1000			
Artesia General Hospital	Artesia, NM	(505) 748-3333			
Brownfield Regional Medical Center	Brownfield, TX	(806) 637-3551			
Cogdell Memorial Hospital	Snyder, TX	(325) 573-6374			
Covenant Hospital Levelland	Levelland, TX	(806) 894-4963			
Covenant Medical Center	Lubbock, TX	(806) 725-1011			
Covenant Medical Center Lakeside	Lubbock, TX	(806) 725-6000			
Covenant Family Health	Synder, TX	(325) 573-1300			
Crockett County Hospital	Ozona, TX	(325) 392-2671			
Guadalupe Medical Center	Carlsbad, NM	(505) 887-6633			
Lea Regional Hospital	Hobbs, NM	(505) 492-5000			
McCamey Hospital	McCamey, TX	(432) 652-8626			
Medical Arts Hospital	Lamesa, TX	(806) 872-2183			
Medical Center Hospital	Odessa, TX	(432) 640-4000			
Medi Center Hospital	San Angelo, TX	(325) 653-6741			
Memorial Hospital	Ft. Stockton	(432) 336-2241			
Memorial Hospital	Seminole, TX	(432) 758-5811			
Midland Memorial Hospital	Midland, TX	(432) 685-1111			
Nor-Lea General Hospital	Lovington, NM	(505) 396-6611			
Odessa Regional Hospital	Odessa, TX	(432) 334-8200			
Permian General Hospital	Andrews, TX	(432) 523-2200			
Reagan County Hospital	Big Lake, TX	(325) 884-2561			
	Pecos, TX				
Reeves County Hospital		(432) 447-3551			
Shannon Medical Center	San Angelo, TX	(325) 653-6741			
Union County General Hospital	Clayton, NM	(505) 374-2585			
University Medical Center	Lubbock, TX	(806) 725-8200			
Val Verde Regional Medical Center	Del Rio, TX	(830) 775-8566			
Ward Memorial Hospital	Monahans, TX	(432) 943-2511			
Yoakum County Hospital	Denver City, TX	(806) 592-5484			

Law Enforcement - Sheriff				
Andrews Cty Sheriff's Department	Andrews County(Andr	(432) 523-5545		
Crane Cty Sheriff's Department	Crane, County (Crane)	(432) 558-3571		
Crockett Cty Sheriff's Department	Crockett County (Ozor	(325) 392-2661		
	Dawson County (Lame	(806) 872-7560		
Dawson Cty Sheriff's Department				
Ector Cty Sheriff's Department	Ector County (Odessa)	(432) 335-3050		
Eddy Cty Sheriff's Department	Eddy County (Artesia) Eddy County (Carlsbac	(505) 746-2704		
Eddy Cty Sheriff's Department	Gaines County (Semin	(505) 887-7551		
Gaines Cty Sheriff's Department	,	(432) 758-9871		
Hockley Cty Sheriff's Department	Hockley County(Levell	(806) 894-3126		
Kent Cty (Jayton City Sheriff's Dept.)	Kent County(Jayton)	(806) 237-3801		
Lea Cty Sheriff's Department	Lea County (Eunice)	(505) 384-2020		
Lea Cty Sheriff's Department	Lea County (Hobbs)	(505) 393-2515		
Lea Cty Sheriff's Department	Lea County (Lovington	(505) 396-3611		
Lubbock Cty Sheriff's Department	Lubbock Cty (Abernatl	(806) 296-2724		
Midland Cty Sheriff's Department	Midland County (Midla	(432) 688-1277		
Pecos Cty Sheriff's Department	Pecos County (Iraan)	(432) 639-2251		
Reeves Cty Sheriff's Department	Reeves County (Pecos)	(432) 445-4901		
Scurry Cty Sheriff's Department	Scurry County (Snyder	(325) 573-3551		
Terry Cty Sheriff's Department	Terry County (Brownfi	(806) 637-2212		
Union Cty Sheriff's Department	Union County (Claytor	(505) 374-2583		
Upton Cty Sheriff's Department	Upton County (Rankin	(432) 693-2422		
Ward Cty Sheriff's Department	Ward County (Monaha	(432) 943-3254		
Yoakum City Sheriff's Department	Yoakum Co. (Denever	(806) 456-2377		
Law Enforcement - Police				
Abernathy City Police	Abernathy, TX	(806) 298-2545		
Andrews City Police	Andrews, TX	(432) 523-5675		
Artesia City Police	Artesia, NM	(505) 746-2704		
Brownfield City Police	Brownfield, TX	(806) 637-2544		
Carlsbad City Police	Carlsbad, NM	(505) 885-2111		
Clayton City Police	Clayton, NM	(505) 374-2504		
Denver City Police	Denver City, TX	(806) 592-3516		
Eunice City Police	Eunice, NM	(505) 394-2112		
Hobbs City Police	Hobbs, NM	393-2677		
Jal City Police	Jal, NM	(505) 395-2501		
Jayton City Police	Jayton, TX	(806) 237-3801		
Lamesa City Police	Lamesa, TX	(806) 872-2121		
Levelland City Police	Levelland, TX	(806) 894-6164		
Lovington City Police	Lovington, NM	(505) 396-2811		
Midland City Police	Midland, TX	(432) 685-7113		
Monahans City Police	Monahans, TX	(432) 943-3254		
Odessa City Police	Odessa, TX	(432) 335-3378		
Seminole City Police	Seminole, TX	(432) 758-9871		
Snyder City Police	Snyder, TX	(325) 573-2611		
Sundown City Police	Sundown, TX	(806) 229-8241		
Law Enforcement - FBI				
FBI	Alburqueque, NM	(505) 224-2000		
FBI	Midland, TX	(432) 570-0255		
Law Enforcement - DPS				
NM State Police	Artesia, NM	(505) 746-2704		
NM State Police	Carlsbad, NM	(505) 885-3137		
NM State Police	Eunice, NM	(505) 392-5588		

NM State Police	Hobbs, NM	(505) 392-5588		
NM State Police NM State Police	Clayton, NM	(505) 392-5588		
	Andrews, TX	(432) 524-1443		
TX Dept of Public Safety	Big Lake, TX			
TX Dept of Public Safety	<u> </u>	(325) 884-2301		
TX Dept of Public Safety	Brownfield, TX	(806) 637-2312		
TX Dept of Public Safety	Iraan, TX	(432) 639-3232		
TX Dept of Public Safety	Lamesa, TX	(806) 872-8675		
TX Dept of Public Safety	Levelland, TX	(806) 894-4385		
TX Dept of Public Safety	Lubbock, TX	(806) 747-4491		
TX Dept of Public Safety	Midland, TX	(432) 697-2211		
TX Dept of Public Safety	Monahans, TX	(432) 943-5857		
TX Dept of Public Safety	Odessa, TX	(432) 332-6100		
TX Dept of Public Safety	Ozona, TX	(325) 392-2621		
TX Dept of Public Safety	Pecos, TX	(432) 447-3533		
TX Dept of Public Safety	Seminole, TX	(432) 758-4041		
TX Dept of Public Safety	Snyder, TX	(325) 573-0113		
TX Dept of Public Safety	Terry County TX	(806) 637-8913		
TX Dept of Public Safety	Yoakum County TX	(806) 456-2377		
Firefighting & Rescue				
Abernathy	Abernathy, TX	(806) 298-2022		
Amistad/Rosebud	Amistad/Rosebud, NM	(505) 633-9113		
Andrews	Andrews, TX	523-3111		
Artesia	Artesia, NM	(505) 746-5051		
Big Lake	Big Lake, TX	(325) 884-3650		
Brownfield-Administrative & other calls	Brownfield, TX	(816) 637-4547		
Brownfield emergency only	Brownfield, TX	-911		
Carlsbad	Carlsbad, NM	(505) 885-3125		
Clayton	Clayton, NM	(505) 374-2435		
Cotton Center	Cotton Center, TX	(806) 879-2157		
Crane	Crane, TX	(432) 558-2361		
Del Rio	Del Rio, TX	(830) 774-8650		
Denver City	Denver City, TX	(806) 592-3516		
Eldorado	Eldorado, TX	(325) 853-2691		
Eunice	Eunice, NM	(505) 394-2111		
Garden City	Garden City, TX	(432) 354-2404		
Goldsmith	Goldsmith, TX	(432) 827-3445		
Hale Center	Hale Center, TX	(806) 839-2411		
Halfway	Halfway, TX			
Hobbs	Hobbs, NM	(505) 397-9308		
Jal	Jal, NM	(505) 395-2221		
Jayton	Jayton, TX	(806) 237-3801		
Kermit	Kermit, TX	(432) 586-3468		
Lamesa	Lamesa, TX	(806) 872-4352		
Levelland	Levelland, TX	(806) 894-3154		
Lovington	Lovington, NM	(505) 396-2359		
Maljamar	Maljamar, NM	(505) 676-4100		
McCamey	McCamey, TX	(432) 652-8232		
Midland	Midland, TX	(432) 685-7346		
Monahans	Monahans, TX	(432) 943-4343		
Nara Visa	Nara Visa, NM	(505) 461-3300		
Notrees	Notress, TX	(432) 827-3445		
Odessa	Odessa, TX	(432) 335-4659		
Ozona	Ozona, TX	(325) 392-2626		
Pecos	Pecos, TX	(432) 445-2421		
Petersburg	Petersburg, TX	(806) 667-3461		
renersourg	reactioning, IA	(000) 007-3401		

Dia in a	Dising TV	(800) 450 8007		
Plains	Plains, TX	(806) 456-8067		
Plainview	Plainview, TX	(806) 296-1170		
Rankin	Rankin, TX	(432) 693-2252		
San Angelo	San Angelo, TX	(325) 657-4355		
Sanderson	Sanderson, TX	(432) 345-2525		
Seminole	Seminole, TX	758-9871		
Smyer	Smyer, TX	(806) 234-3861		
Snyder	Snyder, TX	(325) 573-6215		
Sundown	Sundown, TX	911		
Tucumcari	Tucumcari, NM	911		
West Odessa	Odessa, TX	(432) 381-3033		
A shi ha sa				
Ambulance		(80.0) 208 22.41		
Abernathy Ambulance	Abernathy, TX	(806) 298-2241		
Amistad/Rosebud	Amistad/Rosebud, NM	(505) 633-9113		
Andrews Ambulance	Andrews, TX	(432) 523-5675		
Artesia Ambulance	Artesia, NM	(505) 746-2701		
Big Lake Ambulance	Big Lake, TX	(325) 884-2423		
Big Spring Ambulance	Big Spring, TX	(432) 264-2550		
Brownfield Ambulance	Brownfield, TX	(806) 637-2511		
Carlsbad Ambulance	Carlsbad, NM	(505) 885-2111; 911		
Clayton, NM	Clayton, NM	(505) 374-2501		
Denver City Ambulance	Denver City, TX	(806) 592-3516		
Eldorado Ambulance	Eldorado, TX	(325) 853-3456		
Eunice Ambulance	Eunice, NM	(505) 394-3258		
Goldsmith Ambulance	Goldsmith, TX	(432) 827-3445		
Hobbs, NM	Hobbs, NM	(505) 397-9308		
Jal, NM	Jal, NM	(505) 395-2501		
Jayton Ambulance	Jayton, TX	(806) 237-3801		
Lamesa Ambulance	Lamesa, TX	(806) 872-3464		
Levelland Ambulance	Levelland, TX	(806) 894-8855		
Lovington Ambulance	Lovington, NM	(505) 396-2811		
McCamey Hospital	McCamey, TX	(432) 652-8626		
Midland Ambulance	Midland, TX	(432) 685-7499		
Monahans Ambulance	Monahans, TX	3731		
Nara Visa, NM	Nara Visa, NM	(505) 461-3300		
Odessa Ambulance	Odessa, TX	(432) 335-3378		
Ozona Ambulance	Ozona, TX	(325) 392-2671		
Pecos Ambulance	Pecos, TX	(432) 445-4444		
Rankin Ambulance	Rankin, TX	(432) 693-2443		
San Angelo Ambulance	San Angelo, TX	(325) 657-4357		
Seminole Ambulance	Seminole, TX	758-9871		
Snyder Ambulance	Snyder, TX	(325) 573-1911		
Stanton Ambulance	Stanton, TX	(432) 756-2211		
Sundown Ambulance	Sundown, TX	911		
Tucumcari, NM	Tucumcari, NM	911		
Medical Air Ambulance Service				
AEROCARE - Methodist Hospital	Lubbock, TX	(800) 627-2376		
San Angelo Med-Vac Air Ambulance	San Angelo, TX	(800) 277-4354		
Southwest Air Ambulance Service	Stanford, TX	(800) 242-6199		
Southwest MediVac	Snyder, TX	(800) 242-6199		
Southwest MediVac	Hobbs, NM	(800) 242-6199		
Odessa Care Star	Odessa, TX	(888) 624-3571		
NWTH Medivac	Amarillo, TX	(800) 692-1331		

PROJECT DETAILS: NM DIRECTIONAL PLANS (NAD 1983)

Datum: North American Datum 1983

Geodetic System: US State Plane 1983

Ellipsoid: GRS 1980

Project: PRD NM DIRECTIONAL PLANS (NAD 1983) Site: Jeff Smith MDP1 7\_18 Well: Jeff Smith MDP1 7\_18 Fed Com 173H Wellbore: Wellbore #1

Design: Permitting Plan

Latittude

VSect

0.00

-38.02

-187.00 377.76

10825.02

32° 14' 23.543289 N

TFace

0.00

331.54

0.00

0.00

WELL DETAILS: Jeff Smith MDP1 7\_18 Fed Com 173H

700557.11

+E/-W

0.00

-20.73

-101.95 -154.34

-112.04

Build 2°/100'

Hold 10° Tangent

Landing Point

2000

3000

FTP

1000

Ó

-1000

KOP, Build & Turn 10°/100'

4000

Vertical Section at 180.59° (2000 ft/in)

SECTION DETAILS

Dleo

0.00

0.00

2.00

0.00


10.00

0.00

G м

т

3460.00 Easting

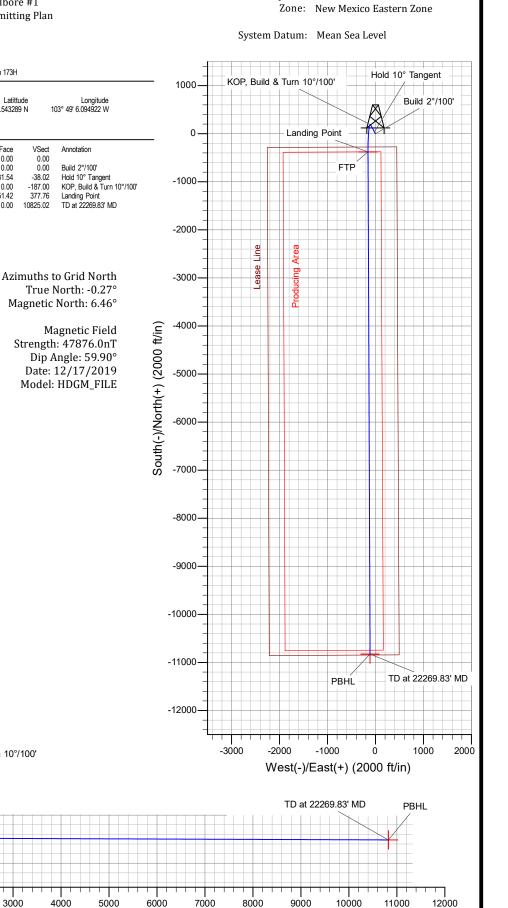

9000

10000

11000



+E/-W

0.00

Azi

0.00

0.00

331.54

331.54 179.77

179.77

Northina

451381.09

+N/-S

0.00

38.24

188.06

-376.18

-10824.44

TVD

0.00 9354.00

9851.29

10818.18

11476.50

11516.50

+N/-S

MD

0.00 9354.00

9853.82

10835.62 11821.41

22269.83

0

1000

2000-

3000

4000-

5000-

6000

7000

8000

9000

10000

11000-

12000

-2000

Frue Vertical Depth (2000 ft/in)

0.00

Inc

0.00

10.00

10.00 89.78

89.78

# 

PRD NM DIRECTIONAL PLANS (NAD 1983) Jeff Smith MDP1 7\_18 Jeff Smith MDP1 7\_18 Fed Com 173H

Wellbore #1

**Plan: Permitting Plan** 

# **Standard Planning Report**

17 December, 2019

Database: Company: Project: Site: Well: Well: Wellbore: Design:	PRD NM Jeff Smi	ERING DES 1 DIRECTIO th MDP1 7_ th MDP1 7_ e #1	NAL PLANS	· · · ·	TVD Refe MD Refer North Ref	ence:		RKB=26.5' @ 3486.50ft RKB=26.5' @ 3486.50ft Grid		
Project	PRD NM	DIRECTION	NAL PLANS (	NAD 1983)						
Map System: Geo Datum: Map Zone:	North Ame	Plane 1983 erican Datum co Eastern Z			System Da	tum:		ean Sea Level sing geodetic sc	ale factor	
Site	Jeff Smit	h MDP1 7_1	8							
Site Position: From: Position Uncertaint	Мар <b>у:</b>	1.	North Easti .00 ft Slot F	•		054.46 usft	Latitude: Longitude: Grid Conver	gence:	1	32° 14' 28.042208 N 03° 49' 11.922256 W 0.27 °
Well	Jeff Smith	1 MDP1 7_1	8 Fed Com 1	73H						
Well Position Position Uncertaint	+N/-S +E/-W	502	2.68 ft Ea	orthing: asting: /ellhead Elev	ation	451,381.09 700,557.11	usft Loi	itude: ngitude: ound Level:		32° 14' 23.543290 N 103° 49' 6.094922 W 3,460.00 ft
	y		1.00 11 VV				GIG			5,400.00 ft
Wellbore	Wellbore	÷#1								
Magnetics	Mode	el Name	Sampl	e Date	Declina (°)	tion	Dip A (*			Strength ıT)
	Н	DGM_FILE	1	2/17/2019		6.73		59.90	47,8	76.0000000
Design	Permittin	q Plan								
Audit Notes:		<b>,</b>								
Version:			Phas	e:	PROTOTYPE	Tie	On Depth:		0.00	
Vertical Section:		De	epth From (T (ft)	VD)	+N/-S (ft)		/-W it)		ection (°)	
			0.00		0.00	0.	00	18	30.59	
Plan Survey Tool P Depth From (ft)	Depth 1 (ft)	Го Survey	12/17/2019 (Wellbore)		Tool Name		Remarks			
1 0.00	22,269.	83 Permitti	ing Plan (Wel	lbore #1)	B001Mb_MW OWSG MWD					
Plan Sections										
	nation A °)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)	TFO (°)	Target
0.00 9,354.00 9,853.82	0.00 0.00 10.00	0.00 0.00 331.54	0.00 9,354.00 9,851.29	0.00 0.00 38.24	0.00 -20.73	0.00 0.00 2.00	0.00 0.00 2.00	0.00 0.00 0.00	0.00 0.00 331.54	
10,835.62 11,821.41	10.00 89.78	331.54 179.77	10,818.18 11,476.50	188.06 -376.18		0.00 10.00	0.00 8.09	0.00 -15.40	0.00	FTP (Jeff Smith

Database: Company:	HOPSPP ENGINEERING DESIGNS	Local Co-ordinate Reference: TVD Reference:	Well Jeff Smith MDP1 7_18 Fed Com 173H RKB=26.5' @ 3486.50ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=26.5' @ 3486.50ft
Site:	Jeff Smith MDP1 7_18	North Reference:	Grid
Well:	Jeff Smith MDP1 7_18 Fed Com 173H	Survey Calculation Method:	Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
100.00	0.00	0.00	100.00	0.00	0.00	0.00	0.00	0.00	0.00
200.00	0.00	0.00	200.00	0.00	0.00	0.00	0.00	0.00	0.00
300.00	0.00	0.00	300.00	0.00	0.00	0.00	0.00	0.00	0.00
400.00	0.00	0.00	400.00	0.00	0.00	0.00	0.00	0.00	0.00
500.00		0.00	500.00	0.00	0.00	0.00	0.00	0.00	0.00
600.00	0.00	0.00	600.00	0.00	0.00	0.00	0.00	0.00	0.00
700.00		0.00	700.00	0.00	0.00	0.00	0.00	0.00	0.00
800.00		0.00	800.00	0.00	0.00	0.00	0.00	0.00	0.00
900.00	0.00	0.00	900.00	0.00	0.00	0.00	0.00	0.00	0.00
1,000.00		0.00	1,000.00	0.00	0.00	0.00	0.00	0.00	0.00
1,100.00		0.00	1,100.00	0.00	0.00	0.00	0.00	0.00	0.00
1,200.00		0.00	1,200.00	0.00	0.00	0.00	0.00	0.00	0.00
1,300.00		0.00	1,300.00	0.00	0.00	0.00	0.00	0.00	0.00
1,400.00		0.00	1,400.00	0.00	0.00	0.00	0.00	0.00	0.00
1,500.00		0.00	1,500.00	0.00	0.00	0.00	0.00	0.00	0.00
1,600.00		0.00	1,600.00	0.00	0.00	0.00	0.00	0.00	0.00
1,700.00		0.00	1,700.00	0.00	0.00	0.00	0.00	0.00	0.00
1,800.00		0.00	1,800.00	0.00	0.00	0.00	0.00	0.00	0.00
1,900.00		0.00	1,900.00	0.00	0.00	0.00	0.00	0.00	0.00
2,000.00		0.00	2,000.00	0.00	0.00	0.00	0.00	0.00	0.00
2,100.00		0.00	2,100.00	0.00	0.00	0.00	0.00	0.00	0.00
2,200.00		0.00	2,200.00	0.00	0.00	0.00	0.00	0.00	0.00
2,300.00		0.00	2,300.00	0.00	0.00	0.00	0.00	0.00	0.00
2,400.00		0.00	2,400.00	0.00	0.00	0.00	0.00	0.00	0.00
2,500.00		0.00	2,500.00	0.00	0.00	0.00	0.00	0.00	0.00
2,600.00		0.00	2,600.00	0.00	0.00	0.00	0.00	0.00	0.00
2,700.00		0.00	2,700.00	0.00	0.00	0.00	0.00	0.00	0.00
2,800.00		0.00	2,800.00	0.00	0.00	0.00	0.00	0.00	0.00
2,900.00		0.00	2,900.00	0.00	0.00	0.00	0.00	0.00	0.00
3,000.00		0.00	3,000.00	0.00	0.00	0.00	0.00	0.00	0.00
3,100.00		0.00	3,100.00	0.00	0.00	0.00	0.00	0.00	0.00
3,200.00		0.00	3,200.00	0.00	0.00	0.00	0.00	0.00	0.00
3,300.00		0.00	3,300.00	0.00	0.00	0.00	0.00	0.00	0.00
3,400.00		0.00	3,400.00	0.00	0.00	0.00	0.00	0.00	0.00
3,500.00		0.00	3,500.00	0.00	0.00	0.00	0.00	0.00	0.00
3,600.00		0.00	3,600.00	0.00	0.00	0.00	0.00	0.00	0.00
3,700.00		0.00	3,700.00	0.00	0.00	0.00	0.00	0.00	0.00
3,800.00		0.00	3,800.00	0.00	0.00	0.00	0.00	0.00	0.00
3,900.00		0.00	3,900.00	0.00	0.00	0.00	0.00	0.00	0.00
4,000.00		0.00	4,000.00	0.00	0.00	0.00	0.00	0.00	0.00
4,100.00		0.00	4,100.00	0.00	0.00	0.00	0.00	0.00	0.00
4,200.00		0.00	4,200.00	0.00	0.00	0.00	0.00	0.00	0.00
4,300.00		0.00	4,300.00	0.00	0.00	0.00	0.00	0.00	0.00
4,400.00		0.00	4,400.00	0.00	0.00	0.00	0.00	0.00	0.00
4,500.00		0.00	4,500.00	0.00	0.00	0.00	0.00	0.00	0.00
4,600.00		0.00	4,600.00	0.00	0.00	0.00	0.00	0.00	0.00
4,700.00		0.00	4,700.00	0.00	0.00	0.00	0.00	0.00	0.00
4,800.00		0.00	4,800.00	0.00	0.00	0.00	0.00	0.00	0.00
4,900.00		0.00	4,900.00	0.00	0.00	0.00	0.00	0.00	0.00
5,000.00		0.00	5,000.00	0.00	0.00	0.00	0.00	0.00	0.00
5,100.00		0.00	5,100.00	0.00	0.00	0.00	0.00	0.00	0.00
5,200.00 5,300.00		0.00	5,200.00	0.00	0.00	0.00	0.00	0.00	0.00
5 300 00	0.00	0.00	5,300.00	0.00	0.00	0.00	0.00	0.00	0.00

Database: Company:	HOPSPP ENGINEERING DESIGNS	Local Co-ordinate Reference: TVD Reference:	Well Jeff Smith MDP1 7_18 Fed Com 173H RKB=26.5' @ 3486.50ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=26.5' @ 3486.50ft
Site:	Jeff Smith MDP1 7_18	North Reference:	Grid
Well:	Jeff Smith MDP1 7_18 Fed Com 173H	Survey Calculation Method:	Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
5,400.00	0.00	0.00	5,400.00	0.00	0.00	0.00	0.00	0.00	0.00
5,500.00	0.00	0.00	5,500.00	0.00	0.00	0.00	0.00	0.00	0.00
5,600.00	0.00	0.00	5,600.00	0.00	0.00	0.00	0.00	0.00	0.00
5,700.00	0.00	0.00	5,700.00	0.00	0.00	0.00	0.00	0.00	0.00
5,800.00	0.00	0.00	5,800.00	0.00	0.00	0.00	0.00	0.00	0.00
5,900.00	0.00	0.00	5,900.00	0.00	0.00	0.00	0.00	0.00	0.00
6,000.00	0.00	0.00	6,000.00	0.00	0.00	0.00	0.00	0.00	0.00
6,100.00	0.00	0.00	6,100.00	0.00	0.00	0.00	0.00	0.00	0.00
6,200.00	0.00	0.00	6,200.00	0.00	0.00	0.00	0.00	0.00	0.00
6,300.00	0.00	0.00	6,300.00	0.00	0.00	0.00	0.00	0.00	0.00
6,400.00	0.00	0.00	6,400.00	0.00	0.00	0.00	0.00	0.00	0.00
6,500.00	0.00	0.00	6,500.00	0.00	0.00	0.00	0.00	0.00	0.00
6,600.00	0.00	0.00	6,600.00	0.00	0.00	0.00	0.00	0.00	0.00
6,700.00	0.00	0.00	6,700.00	0.00	0.00	0.00	0.00	0.00	0.00
6,800.00	0.00	0.00	6,800.00	0.00	0.00	0.00	0.00	0.00	0.00
6,900.00	0.00	0.00	6,900.00	0.00	0.00	0.00	0.00	0.00	0.00
7,000.00	0.00	0.00	7,000.00	0.00	0.00	0.00	0.00	0.00	0.00
7,100.00	0.00	0.00	7,100.00	0.00	0.00	0.00	0.00	0.00	0.00
7,200.00	0.00	0.00	7,200.00	0.00	0.00	0.00	0.00	0.00	0.00
7,300.00	0.00	0.00	7,300.00	0.00	0.00	0.00	0.00	0.00	0.00
7,400.00	0.00	0.00	7,400.00	0.00	0.00	0.00	0.00	0.00	0.00
7,500.00	0.00	0.00	7,500.00	0.00	0.00	0.00	0.00	0.00	0.00
7,600.00	0.00	0.00	7,600.00	0.00	0.00	0.00	0.00	0.00	0.00
7,700.00	0.00	0.00	7,700.00	0.00	0.00	0.00	0.00	0.00	0.00
7,800.00	0.00	0.00	7,800.00	0.00	0.00	0.00	0.00	0.00	0.00
7,900.00	0.00	0.00	7,900.00	0.00	0.00	0.00	0.00	0.00	0.00
8,000.00	0.00	0.00	8,000.00	0.00	0.00	0.00	0.00	0.00	0.00
8,100.00	0.00	0.00	8,100.00	0.00	0.00	0.00	0.00	0.00	0.00
8,200.00	0.00	0.00	8,200.00	0.00	0.00	0.00	0.00	0.00	0.00
8,300.00	0.00	0.00	8,300.00	0.00	0.00	0.00	0.00	0.00	0.00
8,400.00	0.00	0.00	8,400.00	0.00	0.00	0.00	0.00	0.00	0.00
8,500.00	0.00	0.00	8,500.00	0.00	0.00	0.00	0.00	0.00	0.00
8,600.00	0.00	0.00	8,600.00	0.00	0.00	0.00	0.00	0.00	0.00
8,700.00	0.00	0.00	8,700.00	0.00	0.00	0.00	0.00	0.00	0.00
8,800.00	0.00	0.00	8,800.00	0.00	0.00	0.00	0.00	0.00	0.00
8,900.00	0.00	0.00	8,900.00	0.00	0.00	0.00	0.00	0.00	0.00
9,000.00	0.00	0.00	9,000.00	0.00	0.00	0.00	0.00	0.00	0.00
9,100.00	0.00	0.00	9,100.00	0.00	0.00	0.00	0.00	0.00	0.00
9,200.00	0.00	0.00	9,200.00	0.00	0.00	0.00	0.00	0.00	0.00
9,300.00 9,354.00	0.00 0.00	0.00 0.00	9,300.00 9.354.00	0.00 0.00	0.00 0.00	0.00 0.00	0.00 0.00	0.00 0.00	0.00 0.00
			-,						
9,400.00	0.92	331.54	9,400.00	0.32	-0.18	-0.32	2.00	2.00	0.00
9,500.00	2.92	331.54	9,499.94	3.27	-1.77	-3.25	2.00	2.00	0.00
9,600.00 9,700.00	4.92 6.92	331.54 331.54	9,599.70 9,699.16	9.28	-5.03 -9.95	-9.23 -18.24	2.00 2.00	2.00 2.00	0.00 0.00
9,700.00 9,800.00	6.92 8.92	331.54 331.54	9,699.16 9,798.20	18.35 30.46	-9.95 -16.51	-18.24 -30.29	2.00	2.00	0.00
			9,851.29						
9,853.82 9,900.00	10.00 10.00	331.54 331.54	9,851.29 9,896.77	38.24 45.28	-20.73 -24.55	-38.02 -45.03	2.00 0.00	2.00 0.00	0.00 0.00
10,000.00	10.00	331.54	9,995.25	45.28 60.54	-24.55	-45.05	0.00	0.00	0.00
10,000.00	10.00	331.54	10,093.73	75.80	-32.82	-00.20 -75.37	0.00	0.00	0.00
10,100.00	10.00	331.54	10,093.73	91.06	-49.37	-90.55	0.00	0.00	0.00
10.300.00	10.00	331.54	10.290.69	106.32	-57.64	-105.72	0.00	0.00	0.00
10,300.00	10.00	331.54	10,389.18	121.59	-65.91	-120.90	0.00	0.00	0.00
10,400.00	10.00	331.54	10,487.66	136.85	-74.18	-136.07	0.00	0.00	0.00

Database: Company:	HOPSPP ENGINEERING DESIGNS	Local Co-ordinate Reference: TVD Reference:	Well Jeff Smith MDP1 7_18 Fed Com 173H RKB=26.5' @ 3486.50ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=26.5' @ 3486.50ft
Site: Well:	Jeff Smith MDP1 7_18 Jeff Smith MDP1 7_18 Fed Com 173H	North Reference: Survey Calculation Method:	Grid Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
10,600.00	10.00	331.54	10,586.14	152.11	-82.46	-151.24	0.00	0.00	0.00
10,700.00	10.00	331.54	10,684.62	167.37	-90.73	-166.42	0.00	0.00	0.00
10,800.00	10.00	331.54	10.783.10	182.63	-99.00	-181.59	0.00	0.00	0.00
10,835.62	10.00	331.54	10,818.18	188.06	-101.95	-187.00	0.00	0.00	0.00
10,900.00	5.32	296.16	10,882.00	194.30	-107.29	-193.18	10.00	-7.27	-54.96
11,000.00	8.99	211.51	10,981.43	189.66	-115.56	-188.46	10.00	3.68	-84.64
11,100.00	18.25	194.39	11,078.54	167.77	-123.56	-166.49	10.00	9.26	-17.13
11,200.00	28.01	188.76	11,170.40	129.30	-131.04	-127.94	10.00	9.76	-5.63
11,300.00	37.89	185.90	11,254.21	75.40	-137.79	-73.97	10.00	9.88	-2.86
11,400.00	47.82	184.08	11,327.43	7.72	-143.60	-6.24	10.00	9.92	-1.82
11,500.00	57.76	182.76	11,387.83	-71.68	-148.28	73.21	10.00	9.95	-1.32
11,600.00	67.72	181.71	11,433.57	-160.39	-151.71	161.96	10.00	9.96	-1.06
11,700.00	77.68	180.79	11,463.27	-255.73	-153.76	257.31	10.00	9.96	-0.91
11,800.00	87.65	179.95	11,476.02	-354.78	-154.39	356.36	10.00	9.96	-0.85
11,821.41	89.78	179.77	11,476.50	-376.18	-154.34	377.76	10.00	9.97	-0.83
11,900.00	89.78	179.77	11,476.80	-454.77	-154.02	456.34	0.00	0.00	0.00
12,000.00	89.78	179.77	11,477.18	-554.77	-153.62	556.33	0.00	0.00	0.00
12,100.00 12,200.00	89.78 89.78	179.77 179.77	11,477.57 11,477.95	-654.77 -754.77	-153.21 -152.81	656.32 756.31	0.00 0.00	0.00 0.00	0.00 0.00
12,200.00	89.78	179.77	11,478.33	-854.77	-152.61	856.30	0.00	0.00	0.00
12,400.00 12,500.00	89.78 89.78	179.77 179.77	11,478.72 11,479.10	-954.77 -1,054.76	-152.00 -151.59	956.29	0.00	0.00 0.00	0.00 0.00
						1,056.28	0.00		
12,600.00	89.78	179.77	11,479.48	-1,154.76	-151.19	1,156.27	0.00	0.00	0.00
12,700.00	89.78	179.77	11,479.86	-1,254.76	-150.78	1,256.25	0.00	0.00	0.00
12,800.00	89.78	179.77	11,480.25	-1,354.76	-150.38	1,356.24	0.00	0.00	0.00
12,900.00	89.78	179.77	11,480.63	-1,454.76	-149.97	1,456.23	0.00	0.00	0.00
13,000.00	89.78	179.77	11,481.01	-1,554.76	-149.57	1,556.22	0.00	0.00	0.00
13,100.00	89.78	179.77	11,481.40	-1,654.75	-149.16	1,656.21	0.00	0.00	0.00
13,200.00	89.78	179.77	11,481.78	-1,754.75	-148.76	1,756.20	0.00	0.00	0.00
13,300.00	89.78	179.77	11,482.16	-1,854.75	-148.35	1,856.19	0.00	0.00	0.00
13,400.00	89.78	179.77	11,482.54	-1,954.75	-147.95	1,956.18	0.00	0.00	0.00
13,500.00	89.78	179.77	11,482.93	-2,054.75	-147.54	2,056.17	0.00	0.00	0.00
13,600.00	89.78	179.77	11,483.31	-2,154.75	-147.14	2,156.15	0.00	0.00	0.00
13,700.00	89.78	179.77	11,483.69	-2,254.75	-146.73	2,256.14	0.00	0.00	0.00
13,800.00	89.78	179.77	11,484.07	-2,354.74	-146.33	2,356.13	0.00	0.00	0.00
13,900.00	89.78	179.77	11,484.46	-2,454.74	-145.92	2,456.12	0.00	0.00	0.00
14,000.00	89.78	179.77	11,484.84	-2,554.74	-145.52	2,556.11	0.00	0.00	0.00
						,			
14,100.00	89.78	179.77	11,485.22	-2,654.74	-145.11	2,656.10	0.00	0.00	0.00
14,200.00	89.78	179.77	11,485.61	-2,754.74	-144.71	2,756.09	0.00	0.00	0.00
14,300.00	89.78	179.77	11,485.99	-2,854.74	-144.30	2,856.08	0.00	0.00	0.00
14,400.00	89.78 80.78	179.77 179.77	11,486.37 11,486,75	-2,954.73	-143.90	2,956.07 3,056.05	0.00 0.00	0.00	0.00 0.00
14,500.00	89.78	179.77	11,486.75	-3,054.73	-143.50			0.00	
14,600.00	89.78	179.77	11,487.14	-3,154.73	-143.09	3,156.04	0.00	0.00	0.00
14,700.00	89.78	179.77	11,487.52	-3,254.73	-142.69	3,256.03	0.00	0.00	0.00
14,800.00	89.78	179.77	11,487.90	-3,354.73	-142.28	3,356.02	0.00	0.00	0.00
14,900.00	89.78	179.77	11,488.29	-3,454.73	-141.88	3,456.01	0.00	0.00	0.00
15,000.00	89.78	179.77	11,488.67	-3,554.73	-141.47	3,556.00	0.00	0.00	0.00
15,100.00	89.78	179.77	11,489.05	-3,654.72	-141.07	3,655.99	0.00	0.00	0.00
15,200.00	89.78	179.77	11,489.43	-3,754.72	-140.66	3,755.98	0.00	0.00	0.00
15,300.00	89.78	179.77	11,489.82	-3,854.72	-140.26	3,855.97	0.00	0.00	0.00
15,400.00	89.78	179.77	11,490.20	-3,954.72	-139.85	3,955.95	0.00	0.00	0.00
15,500.00	89.78	179.77	11,490.58	-4,054.72	-139.45	4,055.94	0.00	0.00	0.00
15,600.00	89.78	179.77	11,490.97	-4,154.72	-139.04	4,155.93	0.00	0.00	0.00
15,700.00	89.78	179.77	11,491.35	-4,254.71	-138.64	4,255.92	0.00	0.00	0.00

Database:	HOPSPP	Local Co-ordinate Reference:	Well Jeff Smith MDP1 7_18 Fed Com 173H
Company:	ENGINEERING DESIGNS	TVD Reference:	RKB=26.5' @ 3486.50ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=26.5' @ 3486.50ft
Site:	Jeff Smith MDP1 7_18	North Reference:	Grid
Well:	Jeff Smith MDP1 7_18 Fed Com 173H	Survey Calculation Method:	Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
15,800.00 15,900.00 16,000.00	89.78 89.78 89.78	179.77 179.77 179.77	11,491.73 11,492.11 11,492.50	-4,354.71 -4,454.71 -4,554.71	-138.23 -137.83 -137.42	4,355.91 4,455.90 4,555.89	0.00 0.00 0.00	0.00 0.00 0.00	0.00 0.00 0.00
16,100.00 16,200.00 16,300.00 16,400.00 16,500.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,492.88 11,493.26 11,493.65 11,494.03 11,494.41	-4,654.71 -4,754.71 -4,854.71 -4,954.70 -5,054.70	-137.02 -136.61 -136.21 -135.80 -135.40	4,655.88 4,755.87 4,855.85 4,955.84 5,055.83	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
16,600.00 16,700.00 16,800.00 16,900.00 17,000.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,494.79 11,495.18 11,495.56 11,495.94 11,496.33	-5,154.70 -5,254.70 -5,354.70 -5,454.70 -5,554.69	-134.99 -134.59 -134.18 -133.78 -133.37	5,155.82 5,255.81 5,355.80 5,455.79 5,555.78	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
17,100.00 17,200.00 17,300.00 17,400.00 17,500.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,496.71 11,497.09 11,497.47 11,497.86 11,498.24	-5,654.69 -5,754.69 -5,854.69 -5,954.69 -6,054.69	-132.97 -132.56 -132.16 -131.75 -131.35	5,655.77 5,755.75 5,855.74 5,955.73 6,055.72	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
17,600.00 17,700.00 17,800.00 17,900.00 18,000.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,498.62 11,499.01 11,499.39 11,499.77 11,500.15	-6,154.68 -6,254.68 -6,354.68 -6,454.68 -6,554.68	-130.94 -130.54 -130.13 -129.73 -129.32	6,155.71 6,255.70 6,355.69 6,455.68 6,555.67	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
18,100.00 18,200.00 18,300.00 18,400.00 18,500.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,500.54 11,500.92 11,501.30 11,501.69 11,502.07	-6,654.68 -6,754.68 -6,854.67 -6,954.67 -7,054.67	-128.92 -128.51 -128.11 -127.71 -127.30	6,655.66 6,755.64 6,855.63 6,955.62 7,055.61	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
18,600.00 18,700.00 18,800.00 18,900.00 19,000.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,502.45 11,502.83 11,503.22 11,503.60 11,503.98	-7,154.67 -7,254.67 -7,354.67 -7,454.66 -7,554.66	-126.90 -126.49 -126.09 -125.68 -125.28	7,155.60 7,255.59 7,355.58 7,455.57 7,555.56	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
19,100.00 19,200.00 19,300.00 19,400.00 19,500.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,504.37 11,504.75 11,505.13 11,505.51 11,505.90	-7,654.66 -7,754.66 -7,854.66 -7,954.66 -8,054.66	-124.87 -124.47 -124.06 -123.66 -123.25	7,655.54 7,755.53 7,855.52 7,955.51 8,055.50	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
19,600.00 19,700.00 19,800.00 19,900.00 20,000.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,506.28 11,506.66 11,507.04 11,507.43 11,507.81	-8,154.65 -8,254.65 -8,354.65 -8,454.65 -8,554.65	-122.85 -122.44 -122.04 -121.63 -121.23	8,155.49 8,255.48 8,355.47 8,455.46 8,555.44	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
20,100.00 20,200.00 20,300.00 20,400.00 20,500.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,508.19 11,508.58 11,508.96 11,509.34 11,509.72	-8,654.65 -8,754.64 -8,854.64 -8,954.64 -9,054.64	-120.82 -120.42 -120.01 -119.61 -119.20	8,655.43 8,755.42 8,855.41 8,955.40 9,055.39	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
20,600.00 20,700.00 20,800.00 20,900.00 21,000.00	89.78 89.78 89.78 89.78 89.78 89.78	179.77 179.77 179.77 179.77 179.77 179.77	11,510.11 11,510.49 11,510.87 11,511.26 11,511.64	-9,154.64 -9,254.64 -9,354.64 -9,454.63 -9,554.63	-118.80 -118.39 -117.99 -117.58 -117.18	9,155.38 9,255.37 9,355.36 9,455.34 9,555.33	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00	0.00 0.00 0.00 0.00 0.00 0.00
21,100.00	89.78	179.77	11,512.02	-9,654.63	-116.77	9,655.32	0.00	0.00	0.00

Database:	HOPSPP	Local Co-ordinate Reference:	Well Jeff Smith MDP1 7_18 Fed Com 173H
Company:	ENGINEERING DESIGNS	TVD Reference:	RKB=26.5' @ 3486.50ft
Project:	PRD NM DIRECTIONAL PLANS (NAD 1983)	MD Reference:	RKB=26.5' @ 3486.50ft
Site:	Jeff Smith MDP1 7_18	North Reference:	Grid
Well:	Jeff Smith MDP1 7_18 Fed Com 173H	Survey Calculation Method:	Minimum Curvature
Wellbore:	Wellbore #1		
Design:	Permitting Plan		

#### Planned Survey

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
21,200.00	89.78	179.77	11,512.40	-9,754.63	-116.37	9,755.31	0.00	0.00	0.00
21,300.00	89.78	179.77	11,512.79	-9,854.63	-115.96	9,855.30	0.00	0.00	0.00
21,400.00	89.78	179.77	11,513.17	-9,954.63	-115.56	9,955.29	0.00	0.00	0.00
21,500.00	89.78	179.77	11,513.55	-10,054.62	-115.15	10,055.28	0.00	0.00	0.00
21,600.00	89.78	179.77	11,513.94	-10,154.62	-114.75	10,155.27	0.00	0.00	0.00
21,700.00	89.78	179.77	11,514.32	-10,254.62	-114.34	10,255.26	0.00	0.00	0.00
21,800.00	89.78	179.77	11,514.70	-10,354.62	-113.94	10,355.24	0.00	0.00	0.00
21,900.00	89.78	179.77	11,515.08	-10,454.62	-113.53	10,455.23	0.00	0.00	0.00
22,000.00	89.78	179.77	11,515.47	-10,554.62	-113.13	10,555.22	0.00	0.00	0.00
22,100.00	89.78	179.77	11,515.85	-10,654.62	-112.72	10,655.21	0.00	0.00	0.00
22,200.00	89.78	179.77	11,516.23	-10,754.61	-112.32	10,755.20	0.00	0.00	0.00
22,269.83	89.78	179.77	11,516.50	-10,824.44	-112.04	10,825.02	0.00	0.00	0.00

#### **Design Targets**

Target Name - hit/miss target - Shape	Dip Angle (°)	Dip Dir. (°)	TVD (ft)	+N/-S (ft)	+E/-W (ft)	Northing (usft)	Easting (usft)	Latitude	Longitude
FTP (Jeff Smith MDP1 - plan hits target cer - Point	0.00 nter	0.00	11,476.50	-376.18	-154.34	451,004.93	700,402.78	32° 14' 19.828265 N	103° 49' 7.912811
PBHL (Jeff Smith - plan hits target cer - Point	0.00 nter	0.00	11,516.50	-10,824.44	-112.04	440,557.34	700,445.08	32° 12' 36.440419 N	103° 49' 8.002723

#### Plan Annotations

Measured	Vertical	Local Coordinates		
Depth (ft)	Depth (ft)	+N/-S (ft)	+E/-W (ft)	Comment
9,354.00	9,354.00	0.00	0.00	Build 2°/100'
9,853.82	9,851.29	38.24	-20.73	Hold 10° Tangent
10,835.62	10,818.18	188.06	-101.95	KOP, Build & Turn 10°/100'
11,821.41	11,476.50	-376.18	-154.34	Landing Point
22,269.83	11,516.50	-10,824.44	-112.04	TD at 22269.83' MD

#### 1. Geologic Formations

TVD of target	11517'	Pilot Hole Depth	N/A
MD at TD:	22270'	Deepest Expected fresh water:	532'

**Delaware Basin** 

Formation	TVD - RKB	<b>Expected Fluids</b>
Rustler	550	Brine
Salado	929	Brine
Castile	2,797	Brine
Lamar/Delaware	4,185	Brine
Bell Canyon	4,216	Oil/Gas
Cherry Canyon	5,112	Oil/Gas
Brushy Canyon	6,374	Losses
Bone Spring	8,045	Oil/Gas
1st Bone Spring	9,065	Oil/Gas
2nd Bone Spring	9,784	Oil/Gas
3rd Bone Spring	11,019	Oil/Gas
Wolfcamp	11,473	Oil/Gas

\*H2S, water flows, loss of circulation, abnormal pressures, etc.

#### 2. Casing Program

									Buoyant	Buoyant
Hala Sina (in)	Casing	Interval	Csg. Size	Weight	Grade	Com	SF	SE Darme	Body SF	Joint SF
Hole Size (in)	From (ft)	To (ft)	(in)	(lbs)	Grade	Conn.	Collapse	SF Burst	Tension	Tension
14.75	0	869	10.75	40.5	J-55	BTC	1.125	1.2	1.4	1.4
9.875	0	10736	7.625	26.4	L-80 HC	BTC	1.125	1.2	1.4	1.4
6.75	0	22270	5.5	20	P-110	DQX	1.125	1.2	1.4	1.4
								SF Values will	meet or Exceed	i

All casing strings will be tested in accordance with Onshore Oil and Gas Order #2 III.B.1.h

\*Oxy requests the option to set casing shallower yet still below the salts if losses or hole conditions require this. Cement volumes may be adjusted if casing is set shallower and a DV tool may be run in case hole conditions merit pumping a second stage cement job to comply with permitted top of cement. If cement circulated to surface during first stage, we will drop a cancelation cone and not pump the second stage.

\*Oxy requests the option to run production casing with DQX, SF TORQ, and/or DQW TORQ connections to accommodate hole conditions or drilling operations.

#### **Annular Clearance Variance Request**

As per the agreement reached in the Oxy/BLM meeting on Feb 22, 2018, Oxy requests permission to allow deviation from the 0.422" annular clearance requirement from Onshore Order #2 under the following conditions:

- 1. Annular clearance to meet or exceed 0.422" between intermediate casing ID and production casing coupling only on the first 500' overlap between both casings.
- 2. Annular clearance less than 0.422" is acceptable for the curve and lateral portions of the production open hole section.

	Y or N
Is casing new? If used, attach certification as required in Onshore Order #1	Y
Does casing meet API specifications? If no, attach casing specification sheet.	Y
Is premium or uncommon casing planned? If yes attach casing specification sheet.	Y

1

Does the above casing design meet or exceed BLM's minimum standards? If not provide justification (loading assumptions, casing design criteria).	
	Y
Will the intermediate pipe be kept at a minimum 1/3 fluid filled to avoid approaching the collapse pressure rating of the casing?	Y
Is well located within Capitan Reef?	Ν
If yes, does production casing cement tie back a minimum of 50' above the Reef?	
Is well within the designated 4 string boundary.	
Is well located in SOPA but not in R-111-P?	Y
If yes, are the first 2 strings cemented to surface and 3 <sup>rd</sup> string cement tied back 500' into previous casing?	Y
Is well located in R-111-P and SOPA?	Ν
If yes, are the first three strings cemented to surface?	
Is 2 <sup>nd</sup> string set 100' to 600' below the base of salt?	
Is well located in high Cave/Karst?	N
If yes, are there two strings cemented to surface?	
(For 2 string wells) If yes, is there a contingency casing if lost circulation occurs?	
Is well located in critical Cave/Karst?	Ν
If yes, are there three strings cemented to surface?	

# 3. Cementing Program

Casing String	# Sks	Wt. (lb/gal)	Yld (ft3/sack)	H20 (gal/sk)	500# Comp. Strength (hours)	Slurry Description
Surface (Lead)	N/A	N/A	N/A	N/A	N/A	N/A
Surface (Tail)	714	14.8	1.33	6.365	5:26	Class C Cement, Accelerator
Intermediate 1st Stage (Lead)	N/A	N/A	N/A	N/A	N/A	N/A
Intermediate 1st Stage (Tail)	569	13.2	1.65	8.640	11:54	Class H Cement, Retarder, Dispersant, Salt
Intermediate 2nd Sta	ge (Tail Slurry	y) to be pumpe	ed as Bradenh	ead Squeeze f	rom surface,	down the Intermediate annulus
Intermediate 2nd Stage (Lead)	N/A	N/A	N/A	N/A	N/A	N/A
Intermediate 2nd Stage (Tail)	815	12.9	1.92	10.41	23:10	Class C Cement, Accelerator
Production (Lead)	N/A	N/A	N/A	N/A	N/A	N/A
Production (Tail)	882	13.2	1.38	6.686	3:39	Class H Cement, Retarder, Dispersant, Salt

Casing String	Top (ft)	Bottom (ft)	% Excess
Surface (Lead)	N/A	N/A	N/A
Surface (Tail)	0	869	100%
Intermediate 1st Stage (Lead)	N/A	N/A	N/A
Intermediate 1st Stage (Tail)	6624	10736	5%
Intermediate 2nd Stage (Lead)	N/A	N/A	N/A
Intermediate 2nd Stage (Tail)	0	6624	10%
Production (Lead)	N/A	N/A	N/A
Production (Tail)	10236	22270	20%

Oxy requests a variance to cement the 9.625" and/or 7.625" intermediate casing strings offline in accordance to the approved variance, EC Tran 461365.

The summarized operational sequence will be as follows:

- 1. Run casing as per normal operations. While running casing, conduct negative pressure test and confirm integrity of the float equipment (float collar and shoe).
- 2. Land casing.
- 3. Fill pipe with kill weight fluid, and confirm well is static.
  - a. If well is not static notify BLM and kill well.
    - b. Once well is static notify BLM with intent to proceed with nipple down and offline cementing.
- 4. Set and pressure test annular packoff.
- 5. After confirmation of both annular barriers and internal barriers, nipple down BOP and install cap flange. If any barrier fails to test, the BOP stack will not be nippled down until after the cement job is completed.
- 6. Skid rig to next well on pad.
- 7. Confirm well is static before removing cap flange.
- 8. If well is not static notify BLM and kill well prior to cementing or nippling up for further remediation.
- 9. Install offline cement tool.
- 10. Rig up cement equipment.
  - a. Notify BLM prior to cement job.
- 11. Perform cement job.
- 12. Confirm well is static and floats are holding after cement job.
- 13. Remove cement equipment, offline cement tools and install night cap with pressure gauge for monitoring.

Oxy requests permission to adjust the CBL requirement after bradenhead cement jobs, on 7-5/8" intermediate casings, as per the agreement reached in the OXY/BLM meeting on September 5, 2019.

#### Three string wells:

- CBL will be required on one well per pad
- If the pumped volume of cement is less than permitted in the APD, BLM will be notified and a CBL may be run
- Echometer will be used after bradenhead cement job to determine TOC before pumping top-out cement
- 4. Pressure Control Equipment

BOP installed and tested before drilling which hole?	Size?	Min. Required WP	Туре		✓	Tested to:		
		5M	Annula	ır	~	70% of working pressure		
0.975" 11-1-	13-5/8"		Blind Ra	am	✓			
9.875" Hole	13-3/8		Pipe Ram			250		
		5M	Double F	Ram	1	e		
			Other*			70% of working pressure 250 psi / 5000 psi 70% of working		
		5M	Annula	ır	~	ũ		
6.75" Hole	13-5/8"		Blind Ra	am	~	Ũ		
0.75 Hole	13-3/8	5M	Pipe Ram			250 ngi / 5000 ngi		
		5101	Double R	Ram	✓	250 psi / 5000 psi		
			Other*					

\*Specify if additional ram is utilized.

Oxy will utilize a 5M annular with a 10M BOPE stack. The BOP/BOPE will be tested by an independent service company to 250 psi low and the high pressure indicated above per Onshore Order 2 requirements. The System may be upgraded to a higher pressure but still tested to the working pressure listed in the table above. If the system is upgraded all the components installed will be functional and tested.

Pipe rams will be operationally checked each 24 hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment will include a Kelly cock and floor safety valve (inside BOP) and choke lines and choke manifold. See attached schematics.

		Forma	tion integrity test will be performed per Onshore Order #2.					
	On Exploratory wells or on that portion of any well approved for a 5M BOPE system of							
		greater, a pressure integrity test of each casing shoe shall be performed. Will be tested in						
		accord	lance with Onshore Oil and Gas Order #2 III.B.1.i.					
		A vari	ance is requested for the use of a flexible choke line from the BOP to Choke					
		Manif	old. See attached for specs and hydrostatic test chart.					
		Y	Are anchors required by manufacturer?					
Ī		A multibowl or a unionized multibowl wellhead system will be employed. The wellhead						
		and co	onnection to the BOPE will meet all API 6A requirements. The BOP will be tested					
		per Or	shore Order #2 after installation on the surface casing which will cover testing					
		requir	ements for a maximum of 30 days. If any seal subject to test pressure is broken the					
		system must be tested. We will test the flange connection of the wellhead with a test port						
		that is directly in the flange. We are proposing that we will run the wellhead through the						
		rotary	prior to cementing surface casing as discussed with the BLM on October 8, 2015.					
		~						

See attached schematics.

# **BOP Break Testing Request**

Oxy requests permission to adjust the BOP break testing requirements as per the agreement reached in the OXY/BLM meeting on September 5, 2019. A separate sundry will be sent prior to spud that reflects the pad based break testing plan.

BOP break test under the following conditions:

- After a full BOP test is conducted
- When skidding to drill an intermediate section where ICP is set into the third Bone Spring or shallower.

• When skidding to drill a production section that does not penetrate into the third Bone Spring or deeper. If the kill line is broken prior to skid, two tests will be performed.

- 1) Wellhead flange, co-flex hose, kill line connections and upper pipe rams
- 2) Wellhead flange, HCR valve, check valve, upper pipe rams

If the kill line is not broken prior to skid, only one test will be performed.

1) Wellhead flange, co-flex hose, check valve, upper pipe rams

# 5. Mud Program

Depth		Trime	Weight	Viacosity	Watan Laga	
From (ft)	To (ft)	Туре	(ppg)	Viscosity	Water Loss	
0	869	Water-Based Mud	8.6-8.8	40-60	N/C	
869	10736	Saturated Brine- Based or Oil-Based Mud	8.0-10.0	35-45	N/C	
10736	22270	Water-Based or Oil- Based Mud	9.5-12.0	38-50	N/C	

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times. The following is a general list of products: Barite, Bentonite, Gypsum, Lime, Soda Ash, Caustic Soda, Nut Plug, Cedar Fiber, Cotton Seed Hulls, Drilling Paper, Salt Water Clay, CACL2. Oxy will use a closed mud system.

What will be used to monitor the loss or gain of fluid? PVT/MD Totco/Visual Monitoring

#### 6. Logging and Testing Procedures

Logg	ing, Coring and Testing.
Yes	Will run GR from TD to surface (horizontal well – vertical portion of hole). Stated logs
	run will be in the Completion Report and submitted to the BLM.
No	Logs are planned based on well control or offset log information.
No	Drill stem test? If yes, explain
No	Coring? If yes, explain

Addi	tional logs planned	Interval
No	Resistivity	
No	Density	
No	CBL	
Yes	Mud log	ICP - TD
No	PEX	

#### 7. Drilling Conditions

Condition	Specify what type and where?
BH Pressure at deepest TVD	7187 psi
Abnormal Temperature	No
BH Temperature at deepest TVD	173°F

Pump high viscosity sweeps as needed for hole cleaning. The mud system will be monitored visually/manually as well as with an electronic PVT. The necessary mud products for additional weight and fluid loss control will be on location at all times. Appropriately weighted mud will be used to isolate potential gas, oil, and water zones until such time as casing can be cemented into place for zonal isolation.

Hydrogen Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. IfH2S is detected in concentrations greater than 100 ppm, the operator will comply with theprovisions of Onshore Oil and Gas Order #6. If Hydrogen Sulfide is encountered, measuredvalues and formations will be provided to the BLM.NH2S is present

Y H2S Plan attached

8. Other facets of operation	Yes/No
Will the well be drilled with a walking/skidding operation? If yes, describe.	Yes
• We plan to drill the two well pad in batch by section: all surface sections,	
intermediate sections and production sections. The wellhead will be secured	
with a night cap whenever the rig is not over the well.	
Will more than one drilling rig be used for drilling operations? If yes, describe.	Yes
• Oxy requests the option to contract a Surface Rig to drill, set surface casing,	
and cement for this well. If the timing between rigs is such that Oxy would	

5

Oxy USA Inc. - JEFF SMITH MDP1 7\_18 FED COM 173Hnot be able to preset surface, the Primary Rig will MIRU and drill the well in its entirety per the APD. Please see the attached document for information on the spudder rig.

# Total estimated cuttings volume: <u>1628.9 bbls</u>.

#### 9. Company Personnel

Name	<u>Title</u>	<b>Office Phone</b>	<b>Mobile Phone</b>
Linsay Earle	Drilling Engineer		832-596-5507
William Turner	Drilling Engineer Supervisor	713-350-4951	661-817-4586
Simon Benavides	Drilling Superintendent	713-522-8652	281-684-6897
Diego Tellez	Drilling Manager	713-350-4602	713-303-4932

# **WAFMSS**

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

APD ID: 10400054090

Operator Name: OXY USA INCORPORATED

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Type: OIL WELL

# Section 1 - Existing Roads

Will existing roads be used? YES

Existing Road Map:

JeffSmithMDP17\_18FdCom173H\_ExistRoads\_20200211152100.pdf

Existing Road Purpose: ACCESS, FLUID TRANSPORT

Row(s) Exist? NO

Submission Date: 02/11/2020

Well Number: 173H

Well Work Type: Drill

ROW ID(s)

ID:

Do the existing roads need to be improved? NO

**Existing Road Improvement Description:** 

**Existing Road Improvement Attachment:** 

Section 2	- New or Recon	structed Access Roads
Will new roads be nee	ded? YES	
New Road Map:		
JeffSmithMDP17_18Fd0	Com173H_NewRoads	_20200211152242.pdf
New road type: LOCAL		
Length: 11230	Feet	Width (ft.): 30
Max slope (%): 0		<b>Max grade (%):</b> 0
Army Corp of Enginee	rs (ACOE) permit rec	quired? N
ACOE Permit Number(	s):	
New road travel width:	14	
New road access eros	ion control: Watershe	ed Diversion every 200' if needed.
New road access plan	or profile prepared?	Y
New road access plan	attachment:	
JeffSmithMDP17_18Fd	Com173H_NewRoads	_20200211152330.pdf
Access road engineeri	ng design? N	

Highlighted data reflects the most recent changes

06/25/2020

SUPO Data Report

Show Final Text

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Number: 173H

Access road engineering design attachment:

Turnout? N

Access surfacing type: OTHER

Access topsoil source: ONSITE

Access surfacing type description: Caliche

Access onsite topsoil source depth: 0

Offsite topsoil source description:

Onsite topsoil removal process: If available

Access other construction information: None

Access miscellaneous information: A new access road to the well pad will be constructed running 44.98 west through pasture to the southeast corner of the proposed pad. A new access road will be constructed to the proposed surface site (CGL) in section 8 T24S R31E NMPM, Eddy County, NM and will followed the surveyed route. The length described as 30 wide and 252.86 in length across section 8 & 9, T24S R31E, NMPM, Eddy County, NM. See the attached plat showing multiple well pads and proposed roads being 30 and a total of 11,230.32 in length across sections 5, 6, 7 & 8, T24S, R31E, NMPM, Eddy County, NM.

Number of access turnouts:

Access turnout map:

Drainage Control

New road drainage crossing: CULVERT

Drainage Control comments: Watershed Diversion every 200' if needed.

Road Drainage Control Structures (DCS) description: Watershed Diversion every 200' if needed.

Road Drainage Control Structures (DCS) attachment:

**Access Additional Attachments** 

Section 3 - Location of Existing Wells

Existing Wells Map? YES

#### Attach Well map:

JeffSmithMDP17\_18FdCom173H\_ExistWells\_20200211152814.pdf

# Section 4 - Location of Existing and/or Proposed Production Facilities

#### Submit or defer a Proposed Production Facilities plan? SUBMIT

**Production Facilities description:** a. In the event the well is found productive, it will flow to an existing CPF. Two new Central Gas Lift pads will be constructed in the NE of Section 8 and/or the SE Section 6 CGL. The necessary production equipment will be installed at the well site. See proposed facilities layout diagrams. b. All flow lines will adhere to API standards. They will consist of (3- 4) surface flowlines per well operating 75% MAWP, lines to follow surveyed route. Survey of a strip of land 30 ft wide and 20,970.12 ft in length crossing USA Land in Sections 6, 7, & 18 of T24S R31E, NMPM Lea County, NM, and being 15 ft left and 15 ft right of the centerline survey, see attached. The CGLs will have two (2) 20-in buried

Operator Name: OXY USA INCORPORATED	
-------------------------------------	--

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Number: 173H

steel suctions lines operating at 250 PSIG and (2) 8- inch buried steel gas lift injection trunk lines operating at 1500psig. Each well pad will have (2) 6-inch buried steel gas lift supply lines operating at 1500psig branching off the 2 common 12-inch main lines. These will all follow the surveyed route. Survey of a strip of land 30 ft wide and 26,373.88 ft in length crossing USA land in Sections 5, 6, 7 and 8, T24S, R31E, NMPM, Eddy County, NM and being 15 ft left and 15 ft right of the centerline survey, see attached. c. Electric lines (overhead) will follow a route approved by the BLM to the well pads and CGLs. Survey of a strip of land 30 ft wide and 9,023.17 ft in length crossing USA land in Sections 5, 8 & 9, T24S R31E NMPM, Eddy County, NM and being 15 ft left and 15 ft right of the centerline survey, see attached. Survey of a strip of land 30 ft wide and 17,277.65 ft in length crossing USA land in Sections 6 & 7, T24S R31E NMPM, Eddy County, NM and being 15 ft left and 15 ft right of the centerline survey, see attached.

#### Production Facilities map:

Section 5 - Location ar	nd Types of	Water Supply	1	
Water Source Tab	le			
Water source type: GW WELL				
Water source use type:	SURFACE C	SING		
	INTERMEDIA CASING	TE/PRODUCTION		
	OTHER		Descril	be use ty
Source latitude:			Source	e longitu
Source datum:				
Water source permit type:	WATER WEL	L		
Water source transport method:	TRUC	KING		
	PIPEL	NE		
Source land ownership: COMMER	CIAL			
Source transportation land owner	ship: COMME	RCIAL		
Water source volume (barrels): 20	00		Source	e volume
Source volume (gal): 84000				

#### Water source and transportation map:

JeffSmithMDP17\_18FdCom173H\_GRRWtrSrc\_20200211153014.pdf JeffSmithMDP17\_18FdCom173H\_MesqWtrSrc\_20200211153019.pdf

Water source comments: This well will be drilled using a combination of water mud systems. It will be obtained from commercial water stations (Gregory Rockhouse, Mesquite) in the area and will be hauled to location by transport truck using existing and proposed roads. New water well? N

New Water Well Info

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Number: 173H

Well latitude:	Well Longitude:	Well datum:
	Ton Longhado.	
Well target aquifer:		
Est. depth to top of aquifer(ft):	Est thickness of aquifer:	
Aquifer comments:		
Aquifer documentation:		
Well depth (ft):	Well casing type:	
Well casing outside diameter (in.):	Well casing inside diamete	r (in.):
New water well casing?	Used casing source:	
Drilling method:	Drill material:	
Grout material:	Grout depth:	
Casing length (ft.):	Casing top depth (ft.):	
Well Production type:	<b>Completion Method:</b>	
Water well additional information:		
State appropriation permit:		
Additional information attachment:		

#### **Section 6 - Construction Materials**

Using any construction materials: YES

**Construction Materials description:** Primary - All caliche utilized for the drilling pad and proposed access road will be obtained from an existing BLM/State/Fee approved pit or from prevailing deposits found on the location. Will use BLM recommended extra caliche from other locations close by for roads, if available. Secondary - The secondary way of obtaining caliche to build locations and roads will be by "turning over" the location. This means, caliche will be obtained from the actual well site. A caliche permit will be obtained from BLM prior to pushing up any caliche. 2400 cubic yards is max amount of caliche needed for pad and roads. Amount will vary for each pad. The procedure below has been approved by BLM personnel: a. The top 6" of topsoil is pushed off and stockpiled along the side of the location. b. An approximate 120' X 120' area is used within the proposed well site to remove caliche. c. Subsoil is removed and piled alongside the 120' X 120' within the pad site. d. When caliche is found, material will be stockpiled within the pad site to build the location and road. e. Then subsoil is pushed back in the hole and caliche is spread accordingly across entire location and road. f. Once the well is drilled the stockpiled top soil will be used for interim reclamation and spread along areas where caliche is picked up and the location size is reduced. Neither caliche nor subsoil will be stockpiled outside of the well pad. Topsoil will be stockpiled along the edge of the pad. Caliche will be provided from a pit located in Section 7 T24S R31E. Water will be provided from a frac pond located in Sections 7 T24S R31E.

**Construction Materials source location attachment:** 

# Section 7 - Methods for Handling Waste

Waste type: DRILLING

Waste content description: Water-Based Cuttings, Water-Based Mud, Oil-Based Cuttings, Oil-Based Mud, Produced Water

Amount of waste: 1628.9 barrels

Waste disposal frequency : Daily

Safe containment description: Haul-Off Bins

Safe containmant attachment:

Operator Name: OXY USA INCORPORATED
Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Number: 173H

**Waste disposal type:** HAUL TO COMMERCIAL **Disposal location ownership:** COMMERCIAL FACILITY

#### Disposal type description:

**Disposal location description:** An approved facility that can process drill cuttings, drill fluids, flowback water, produced water, contaminated soils, and other non-hazardous wastes.

#### **Reserve Pit**

Reserve Pit being used? NO

Temporary disposal of produced water into reserve pit? NO

Reserve pit length (ft.) Reserve pit width (ft.)

Reserve pit depth (ft.)

Reserve pit volume (cu. yd.)

Is at least 50% of the reserve pit in cut?

Reserve pit liner

Reserve pit liner specifications and installation description

#### **Cuttings Area**

Cuttings Area being used? NO

Are you storing cuttings on location? Y

**Description of cuttings location** A closed loop system will be utilized consisting of above ground steel tanks and haul-off bins. Disposal of liquids, drilling fluids and cuttings will be disposed of at an approved facility. **Cuttings area length (ft.) Cuttings area width (ft.)** 

Cuttings area depth (ft.)

Cuttings area volume (cu. yd.)

Is at least 50% of the cuttings area in cut?

WCuttings area liner

Cuttings area liner specifications and installation description

**Section 8 - Ancillary Facilities** 

Are you requesting any Ancillary Facilities?: N

Ancillary Facilities attachment:

Comments:

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Number: 173H

#### Section 9 - Well Site Layout

#### Well Site Layout Diagram:

JeffSmithMDP17\_18FdCom173H\_WellSiteCL\_20200211153106.pdf

Comments: V-Door-East CL Tanks - North 330' X 1175' 10 Well Pad

### **Section 10 - Plans for Surface Reclamation**

Type of disturbance: New Surface Disturbance

Multiple Well Pad Name: JEFF SMITH MDP1 7-18 FEDERAL COM & NUGGET 6-31 FEDERAL COM Multiple Well Pad Number: 11H, 12H, 41H, 42H, 173H, 174H & 11H, 12H, 41H, 42H

Recontouring attachment:

Drainage/Erosion control construction: Reclamation to be wind rowed as needed to control erosion

Drainage/Erosion control reclamation: Reclamation to be wind rowed as needed to control erosion

Well pad proposed disturbance (acres): 8.9 Road proposed disturbance (acres): 7.73 Powerline proposed disturbance (acres): 18.11 Pipeline proposed disturbance (acres): 32.59	Powerline interim reclamation (acres): 18.11 Pipeline interim reclamation (acres): 21.72	(acres): 6.85 Road long term disturbance (acres):	
Other proposed disturbance (acres): (		Other long term disturbance (acres): 0	
Total proposed disturbance: 67.3300000000001	Total interim reclamation: 46.01	Total long term disturbance: 21.32	

Disturbance Comments: See Below

**Reconstruction method:** If the well is deemed commercially productive, caliche from the areas of the pad site not required for operations will be reclaimed. The original topsoil will be returned to the area of the drill pad not necessary to operate the well. These unused areas of the drill pad will be contoured, as close as possible, to match the original topography, and the area will be seeded with an approved BLM mixture to re-establish vegetation. After concluding the drilling and/or completion operations, if the well is found non-commercial, the caliche will be removed from the pad and transported to the original caliche pit or used for other drilling locations. The road will be reclaimed as directed by the BLM. The original topsoil will again be returned to the pad and contoured, as close as possible, to the original topography, and the area will be seeded with an approved BLM mixture to re-establish vegetation.

Topsoil redistribution: The original topsoil will be returned to the area of the drill pad not necessary to operate the well.

Soil treatment: To be determined by the BLM.

Existing Vegetation at the well pad: To be determined by the BLM at Onsite.

Existing Vegetation at the well pad attachment:

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Number: 173H

**Existing Vegetation Community at the road attachment:** Existing Vegetation Community at the pipeline: To be determined by the BLM at Onsite. Existing Vegetation Community at the pipeline attachment:

Existing Vegetation Community at other disturbances: To be determined by the BLM at Onsite. **Existing Vegetation Community at other disturbances attachment:** 

Non native seed used? N Non native seed description: Seedling transplant description: Will seedlings be transplanted for this project? N

Seedling transplant description attachment:

Will seed be harvested for use in site reclamation? N Seed harvest description:

Seed harvest description attachment:

Seed Management

**Seed Table** 

	Seed Summary		Total pounds/Acre:			
	Seed Type	Pounds/Acre				
See	Seed reclamation attachment:					
Operator Contact/Responsible Official Contact Info						
First Name: Michael		Last Name: Wilson				
Phone: (575)631-6618		Email: Michael_Wilson@oxy.com				
See	dbed prep:					

Seed BMP:

Seed method:

Existing invasive species? N

Existing invasive species treatment description:

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Number: 173H

Existing invasive species treatment attachment: Weed treatment plan description: To be determined by the BLM. Weed treatment plan attachment: Monitoring plan description: To be determined by the BLM. Monitoring plan attachment: Success standards: To be determined by the BLM. Pit closure description: NA

Pit closure attachment:

# Section 11 - Surface Ownership

Disturbance type: WELL PAD Describe: Surface Owner: BUREAU OF LAND MANAGEMENT Other surface owner description: BIA Local Office: BOR Local Office: COE Local Office: DOD Local Office: NPS Local Office: State Local Office: Military Local Office: USFWS Local Office: Other Local Office: USFS Region: USFS Forest/Grassland:

**USFS Ranger District:** 

Disturbance type: PIPELINE Describe: Surface Owner: BUREAU OF LAND MANAGEMENT Other surface owner description: BIA Local Office: Well Number: 173H

- **BOR Local Office:**
- **COE Local Office:**
- **DOD Local Office:**
- **NPS Local Office:**
- State Local Office:
- Military Local Office:
- **USFWS Local Office:**
- Other Local Office:
- **USFS Region:**
- USFS Forest/Grassland:

**USFS** Ranger District:

Disturbance type: OTHER Describe: Electric Line Surface Owner: BUREAU OF LAND MANAGEMENT Other surface owner description: BIA Local Office: BOR Local Office: COE Local Office: DOD Local Office: NPS Local Office: State Local Office: USFWS Local Office: USFWS Local Office: USFS Region: USFS Forest/Grassland:

**USFS** Ranger District:

Operator Name: OXY USA INCORPORATED						
Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM						

Well Number: 173H

Disturbance type: NEW ACCESS ROAD
Describe:
Surface Owner: BUREAU OF LAND MANAGEMENT
Other surface owner description:
BIA Local Office:
BOR Local Office:
COE Local Office:
DOD Local Office:
NPS Local Office:
State Local Office:
Military Local Office:
USFWS Local Office:
Other Local Office:
USFS Region:
USFS Forest/Grassland: USFS Ranger District:

Disturbance type: OTHER	
Describe: CGLs	
Surface Owner: BUREAU OF LAND MANAGEMENT	
Other surface owner description:	
BIA Local Office:	
BOR Local Office:	
COE Local Office:	
DOD Local Office:	
NPS Local Office:	
State Local Office:	
Military Local Office:	
USFWS Local Office:	
Other Local Office:	
USFS Region:	
USFS Forest/Grassland:	USFS Ranger District:

## Section 12 - Other Information

**Right of Way needed?** Y

#### Use APD as ROW? Y

**ROW Type(s):** 281001 ROW - ROADS,285003 ROW – POWER TRANS,288100 ROW – O&G Pipeline,288101 ROW – O&G Facility Sites,289001 ROW- O&G Well Pad


**ROW Applications** 

**SUPO Additional Information:** Permian Basin MOA - To be submitted after APD acceptance. GIS Shapefiles available for BLM download from shared FTP site after APD submittal. **Use a previously conducted onsite?** N

#### **Previous Onsite information:**


# **Other SUPO Attachment**


JeffSmithMDP17\_18FdCom173H\_AM\_20200211153902.pdf JeffSmithMDP17\_18FdCom173H\_GasCapPlan\_20200211153911.pdf JeffSmithMDP17\_18FdCom173H\_Loc\_20200211153919.pdf JeffSmithMDP17\_18FdCom173H\_LVM\_20200211153926.pdf JeffSmithMDP17\_18FdCom173H\_StakeForm\_20200211153940.pdf JeffSmithMDP17\_18FdCom173H\_SUPO\_20200211153946.pdf JeffSmithMDP17\_18FdCom173H\_VM\_20200211153953.pdf

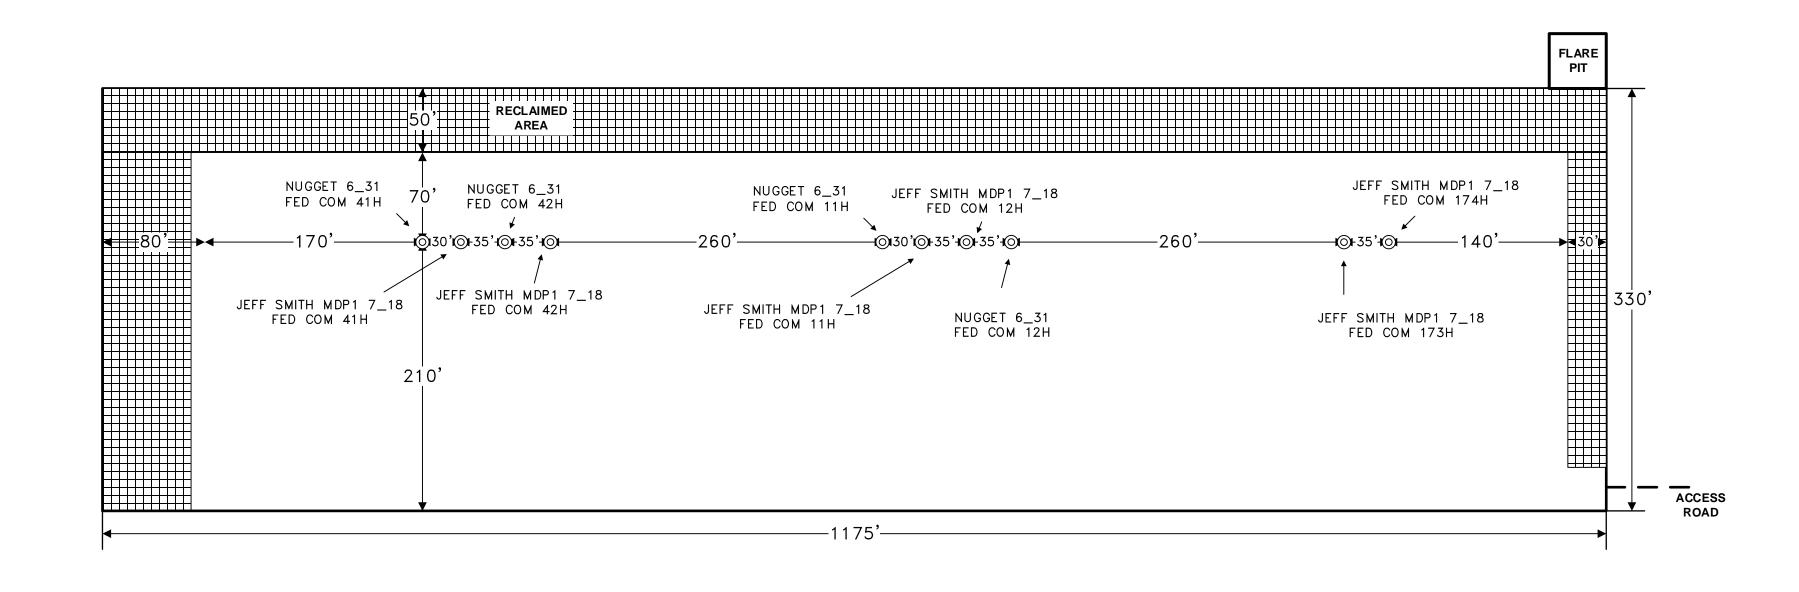

NORTH

REVISION BLOCK						ENGINEE	RING RECORD	PAD_SNDDNS_0602_RIG_DIAGRAM_V-DOOR_EAST JEFF_SMITH_MDP1_7_18_FED_COM_41H_42H_11H_12H_173H_174H	
NO.	DATE	DESCRIPTION	BY	СНК	APP	BY	DATE	NUGGET 6_31 FED COM 41H 42H 11H 12H	
						LJP	12/16/2019	SECTION 6, TOWNSHP 24S, RANGE 31E EDDY COUNTY, NEW MEXICO	

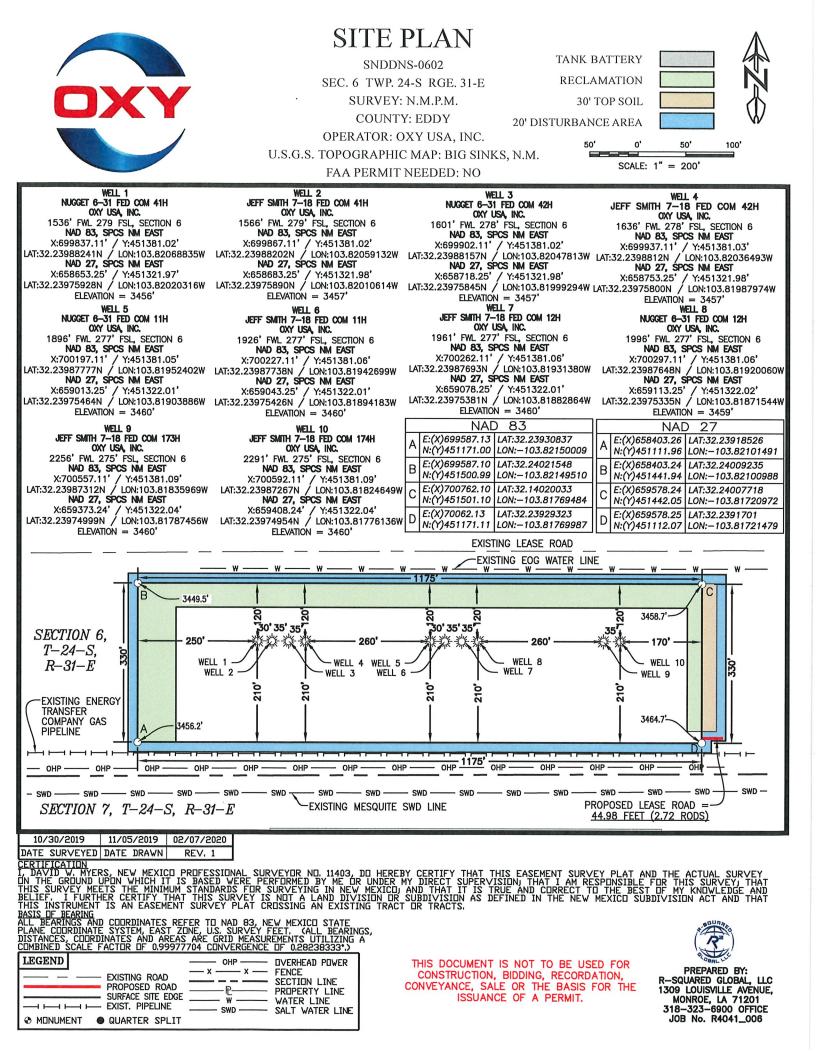

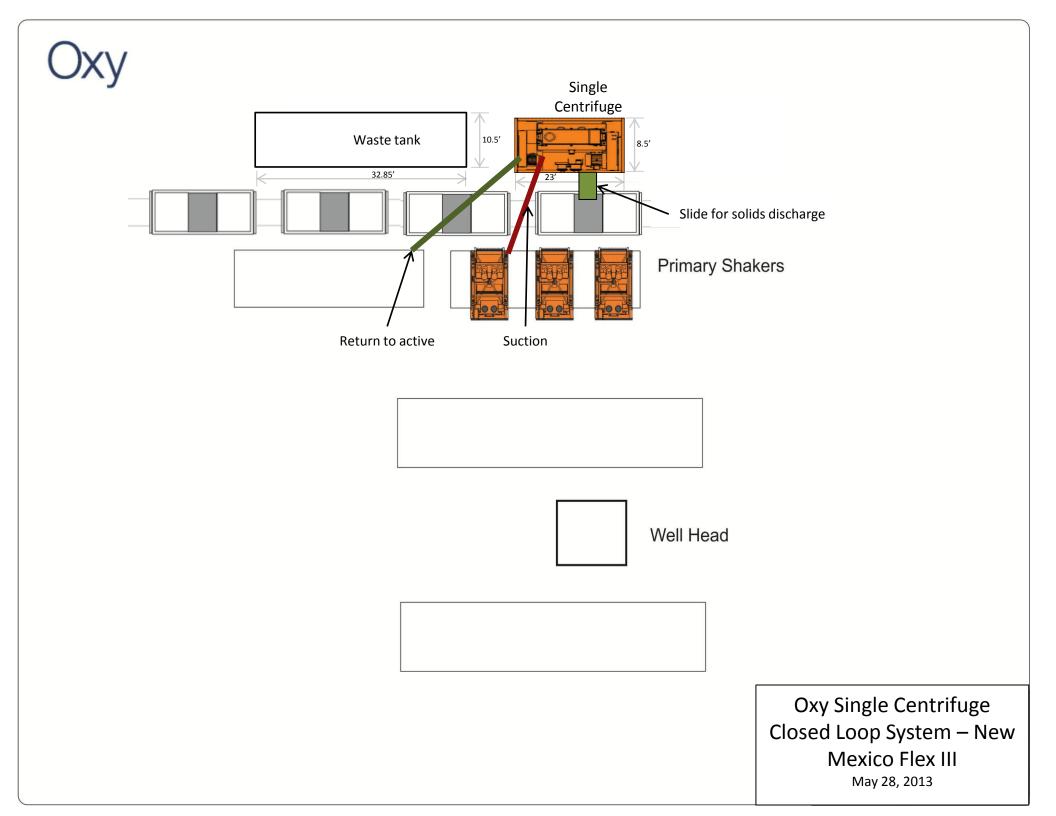

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

### GAS CAPTURE PLAN

Date: 02-11-2020

 $\boxtimes$  Original

Operator & OGRID No.: OXY USA INC. - 16696

□ Amended - Reason for Amendment:

This Gas Capture Plan outlines actions to be taken by the Operator to reduce well/production facility flaring/venting for new completion (new drill, recomplete to new zone, re-frac) activity.

Note: Form C-129 must be submitted and approved prior to exceeding 60 days allowed by Rule (Subsection A of 19.15.18.12 NMAC).

#### Well(s)/Production Facility – Name of facility

The well(s) that will be located at the production facility are shown in the table below.

Well Name	API	Well Location (ULSTR)	Footages	Expected MCF/D	Flared orVent	Comments
JEFF SMITH MDP1 7 FED COM 175H	Pending	P-6-T24S-R-31E	331 FSL 565 FEL	2,800	0	
JEFF SMITH MDP1 7 FED COM 176H	Pending	P-6-T24S-R31E	331 FSL 530 FEL	2,800	0	
JEFF SMITH MDP1 7 FED COM 25H	Pending	P-6-T24S-R31E	330 FSL 240 FEL	3,700	0	
JEFF SMITH MDP1 7_18 FED COM 11H	Pending	N-6-T24S-R31E	277 FSL 1926 FWL	2,500	0	
JEFF SMITH MDP1 7_18 FED COM 12H	Pending	N-6-T24S-31E	277 FSL 1961 FWL	2,500	0	
JEFF SMITH MDP1 7_18 FED COM 13H	Pending	P-6-T24S-R31E	418 FSL 994 FEL	2,500	0	
JEFF SMITH MDP1 7_18 FED COM 14H	Pending	P-6-T24S-R31E	348 FSL 994 FEL	2,500	0	
JEFF SMITH MDP1 7_18 FED COM 171H	Pending	M-7-T24S-R31E	779 FSL 705 FWL	4,200	0	
JEFF SMITH MDP1 7_18 FED COM 172H	Pending	M-6-T24S-R31E	779 FSL 740 FWL	4,200	0	
JEFF SMITH MDP1 7_18 FED COM 173H	Pending	N-6-T24S-R31E	275 FSL 2256 FWL	4,200	0	
JEFF SMITH MDP1 7_18 FED COM 174H	Pending	N-6-T23S-R31E	275 FSL 2291 FWL	4,200	0	
JEFF SMITH MDP1 7_18 FED COM 1H	Pending	N-6-T24S-R31E	730 FSL 1755 FWL	3,800	0	
JEFF SMITH MDP1 7_18 FED COM 21H	Pending	D-7-T24S-R31E	198 FNL 321 FWL	5,500	0	
JEFF SMITH MDP1 7_18 FED COM 22H	Pending	D-7-T24S-R31E	198 FNL 421 FWL	5,500	0	
JEFF SMITH MDP1 7_18 FED COM 23H	Pending	C-7-T24S-R31E	233 FNL 2136 FWL	5,500	0	
JEFF SMITH MDP1 7_18 FED COM 24H	Pending	C-7-T24S-R31E	233 FNL 2206 FWL	5,500	0	

JEFF SMITH MDP1 7_18 FED COM 26H	Pending	P-6-T24S-R31E	329 FSL 170 FEL	5,500	0
JEFF SMITH MDP1 7_18 FED COM 2H	Pending	A-7-T24S-R31E	248 FNL 1200 FEL	3,800	0
JEFF SMITH MDP1 7_18 FED COM 31H	Pending	N-6-T24S-R31E	730 FSL 1690 FWL	3,000	0
JEFF SMITH MDP1 7_18 FED COM 32H	Pending	N-6-T24S-R31E	730 FSL 1790 FWL	3,000	0
JEFF SMITH MDP1 7_18 FED COM 33H	Pending	P-6-T24S-R31E	518 FSL 994 FEL	3,000	0
JEFF SMITH MDP1 7_18 FED COM 34H	Pending	P-6-T24S-R31E	488 FSL 994 FEL	3,000	0
JEFF SMITH MDP1 7_18 FED COM 3H	Pending	A-7-T24S-R31E	248 FNL 1100 FEL	3,800	0
JEFF SMITH MDP1 7_18 FED COM 41H	Pending	N-6-T24S-R31E	279 FSL 1566 FWL	7,200	0
JEFF SMITH MDP1 7_18 FED COM 42H	Pending	N-6-T24S-R31E	278 FSL 1636 FWL	7,200	0
JEFF SMITH MDP1 7_18 FED COM 43H	Pending	N-6-T24S-R31E	730 FSL 2020 FWL	7,200	0
JEFF SMITH MDP1 7_18 FED COM 44H	Pending	N-6-T24S-R31E	730 FSL 2090 FWL	7,200	0
JEFF SMITH MDP1 7_18 FED COM 45H	Pending	P-6-T24S-R31E	1225 FSL 1200 FEL	7,200	0
JEFF SMITH MDP1 7_18 FED COM 46H	Pending	P-6-T24S-R31E	1295 FSL 1200 FEL	7,200	0
NUGGET 6_31 FED COM 11H	Pending	N-6-T24S-31E	277 FSL 1896 FWL	2,500	0
NUGGET 6_31 FED COM 12H	Pending	N-6-T24S-R31E	277 FSL 1996 FWL	2,500	0
NUGGET 6_31 FED COM 13H	Pending	P-6-T24S-R31E	453 FSL 994 FEL	2,500	0
NUGGET 6_31 FED COM 14H	Pending	P-6-T24S-R31E	383 FSL 994 FEL	2,500	0
NUGGET 6_31 FED COM 171H	Pending	D-7-T24S-R31E	198 FNL 456 FWL	4,200	0
NUGGET 6_31 FED COM 172H	Pending	D-7-T24S-R31E	198 FNL 491 FWL	4,200	0
NUGGET 6_31 FED COM 173H	Pending	C-7-T24S-R31E	620 FNL 1994 FWL	4,200	0
NUGGET 6_31 FED COM 174H	Pending	C-7-T24S-R31E	620 FNL 2029 FWL	4,200	0
NUGGET 6_31 FED COM 175H	Pending	P-6-T24S-R31E	1089 FSL 300 FEL	4,200	0
NUGGET 6_31 FED COM 176H	Pending	P-6-T24S-R31E	1089 FSL 265 FEL	4,200	0
NUGGET 6_31 FED COM 1H	Pending	N-6-T24S-R31E	730 FSL 1720 FWL	3,800	0
NUGGET 6_31 FED COM 21H	Pending	D-7-T24S-R31E	198 FNL 351 FWL	5,500	0
NUGGET 6_31 FED COM 22H	Pending	D-7-T24S-R31E	198 FNL 386 FWL	5,500	0

NUGGET 6_31 FED COM 23H	Pending	C-7-T24S-R31E	233 FNL 2106 FWL	5,500	0
NUGGET 6_31 FED COM 24H	Pending	C-7-T24S-R31E	233 FNL 2171 FWL	5,500	0
NUGGET 6_31 FED COM 25H	Pending	P-6-T24S-R31E	330 FSL 270 FEL	5,500	0
NUGGET 6_31 FED COM 26H	Pending	P-6-T24S-R31E	329 FSL 205 FEL	5,500	0
NUGGET 6_31 FED COM 2H	Pending	A-7-T24S-R31E	248 FNL 1170 FEL	3,800	0
NUGGET 6_31 FED COM 31H	Pending	C-7-T24S-R31E	231 FNL 1811 FWL	3,000	0
NUGGET 6_31 FED COM 32H	Pending	C-7-T24S-R31E	231 FNL 1846 FWL	3,000	0
NUGGET 6_31 FED COM 33H	Pending	P-6-T24S-R31E	1090 FSL 515 FEL	3,000	0
NUGGET 6_31 FED COM 34H	Pending	P-6-T24S-R31E	1090 FSL 480 FEL	3,000	0
NUGGET 6_31 FED COM 3H	Pending	A-7-T24S-R31E	248 FNL 1135 FEL	3,800	0
NUGGET 6_31 FED COM 41H	Pending	N-6-T24S-R31E	279 FSL 1536 FWL	7,200	0
NUGGET 6_31 FED COM 42H	Pending	N-6-T24S-R31E	278 FSNL 1601 FWL	7,200	0
NUGGET 6_31 FED COM 43H	Pending	N-6-T24S-R31E	730 FSL 1990 FWL	7,200	0
NUGGET 6_31 FED COM 44H	Pending	N-6-T24S-R31E	730 FSL 2055 FWL	7,200	0
NUGGET 6_31 FED COM 45H	Pending	P-6-T24S-R31E	1195 FSL 1200 FEL	7,200	0
NUGGET 6_31 FED COM 46H	Pending	P-6-T24S-R31E	1260 FSL 1200 FEL	7,200	0

## **Gathering System and Pipeline Notification**

Well(s) will be connected to a production facility after flowback operations are complete, where a gas transporter system is in place. The gas produced from production facility is dedicated to <u>Enterprise Field Services, LLC ("Enterprise"</u>) and is connected to <u>Enterprise</u> low/high pressure gathering system located in Eddy County, New Mexico. <u>OXY USA INC.("OXY"</u>) provides (periodically) to <u>Enterprise</u> a drilling, completion and estimated first production date for wells that are scheduled to be drilled in the foreseeable future. In addition, <u>OXY</u> and <u>Enterprise</u> have periodic conference calls to discuss changes to drilling and completion schedules. Gas from these wells will be processed at Enterprise's Processing Plant located in Sec. 36, Twn. 24S, Rng. 30E, Eddy County, New Mexico. The actual flow of the gas will be based on compression operating parameters and gathering system pressures.

#### **Flowback Strategy**

After the fracture treatment/completion operations, well(s) will be produced to temporary production tanks and gas will be flared or vented. During flowback, the fluids and sand content will be monitored. When the produced fluids contain minimal sand, the wells will be turned to production facilities. Gas sales should start as soon as the wells start flowing through the production facilities, unless there are operational issues on <u>Enterprise</u> system at that time. Based on current information, it is <u>OXY's</u> belief the system can take this gas upon completion of the well(s).

Safety requirements during cleanout operations from the use of underbalanced air cleanout systems may necessitate that sand and non-pipeline quality gas be vented and/or flared rather than sold on a temporary basis.

#### **Alternatives to Reduce Flaring**

Below are alternatives considered from a conceptual standpoint to reduce the amount of gas flared.

- Power Generation On lease
  - Only a portion of gas is consumed operating the generator, remainder of gas will be flared

- Compressed Natural Gas On lease
  - Gas flared would be minimal, but might be uneconomical to operate when gas volume declines
- NGL Removal On lease
  - o Plants are expensive, residue gas is still flared, and uneconomical to operate when gas volume declines



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT PWD Data Report

APD ID: 10400054090

Operator Name: OXY USA INCORPORATED

Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Type: OIL WELL

Submission Date: 02/11/2020

Well Number: 173H Well Work Type: Drill

**Section 1 - General** 

Would you like to address long-term produced water disposal? NO

# Section 2 - Lined Pits

Would you like to utilize Lined Pit PWD options? N Produced Water Disposal (PWD) Location: **PWD surface owner:** Lined pit PWD on or off channel: Lined pit PWD discharge volume (bbl/day): Lined pit specifications: Pit liner description: Pit liner manufacturers information: Precipitated solids disposal: Decribe precipitated solids disposal: Precipitated solids disposal permit: Lined pit precipitated solids disposal schedule: Lined pit precipitated solids disposal schedule attachment: Lined pit reclamation description: Lined pit reclamation attachment: Leak detection system description: Leak detection system attachment:

**PWD disturbance (acres):** 

Operator Name: OXY USA INCORPORATED Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Number: 173H

Lined pit Monitor description: Lined pit Monitor attachment: Lined pit: do you have a reclamation bond for the pit? Is the reclamation bond a rider under the BLM bond? Lined pit bond number: Lined pit bond amount: Additional bond information attachment:

# **Section 3 - Unlined Pits**

Would you like to utilize Unlined Pit PWD options? N

Produced Water Disposal (PWD) Location:

PWD disturbance (acres): PWD surface owner:

Unlined pit PWD on or off channel:

Unlined pit PWD discharge volume (bbl/day):

Unlined pit specifications:

Precipitated solids disposal:

Decribe precipitated solids disposal:

Precipitated solids disposal permit:

Unlined pit precipitated solids disposal schedule:

Unlined pit precipitated solids disposal schedule attachment:

Unlined pit reclamation description:

Unlined pit reclamation attachment:

Unlined pit Monitor description:

**Unlined pit Monitor attachment:** 

Do you propose to put the produced water to beneficial use?

Beneficial use user confirmation:

Estimated depth of the shallowest aquifer (feet):

Does the produced water have an annual average Total Dissolved Solids (TDS) concentration equal to or less than that of the existing water to be protected?

TDS lab results:

Geologic and hydrologic evidence:

State authorization:

**Unlined Produced Water Pit Estimated percolation:** 

Unlined pit: do you have a reclamation bond for the pit?

Well Number: 173H

Is the reclamation bond a rider under the BLM bond?	
Unlined pit bond number:	
Unlined pit bond amount:	
Additional bond information attachment:	
Section 4 - Injection	
Would you like to utilize Injection PWD options? N	
Produced Water Disposal (PWD) Location:	
PWD surface owner:	PWD disturbance (acres):
Injection PWD discharge volume (bbl/day):	
Injection well mineral owner:	
Injection well type:	
Injection well number:	Injection well name:
Assigned injection well API number?	Injection well API number:
Injection well new surface disturbance (acres):	
Minerals protection information:	
Mineral protection attachment:	
Underground Injection Control (UIC) Permit?	
UIC Permit attachment:	
Section 5 - Surface Discharge	
Would you like to utilize Surface Discharge PWD options? N	
Produced Water Disposal (PWD) Location:	
PWD surface owner:	PWD disturbance (acres):
Surface discharge PWD discharge volume (bbl/day):	
Surface Discharge NPDES Permit?	
Surface Discharge NPDES Permit attachment:	
Surface Discharge site facilities information:	
Surface discharge site facilities map:	
Section 6 - Other	
Would you like to utilize Other PWD options? N	

Would you like to utilize Other PWD options?  $\ensuremath{\mathbb{N}}$ 

Produced Water Disposal (PWD) Location: PWD surface owner:

Other PWD discharge volume (bbl/day):

PWD disturbance (acres):

Operator Name: OXY USA INCORPORATED Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM

Well Number: 173H

Other PWD type description:

Other PWD type attachment:

Have other regulatory requirements been met?

Other regulatory requirements attachment:



Bond Info Data Report

A MARTIN THE

06/25/2020

APD ID: 10400054090	Submission Date: 02/11/2020	Highlighted data
Operator Name: OXY USA INCORPORATED		reflects the most recent changes
Well Name: JEFF SMITH MDP1 7-18 FEDERAL COM	Well Number: 173H	Show Final Text
Well Type: OIL WELL	Well Work Type: Drill	

# **Bond Information**

Federal/Indian APD: FED BLM Bond number: ESB000226 **BIA Bond number:** Do you have a reclamation bond? NO Is the reclamation bond a rider under the BLM bond? Is the reclamation bond BLM or Forest Service? **BLM** reclamation bond number: Forest Service reclamation bond number: Forest Service reclamation bond attachment: **Reclamation bond number: Reclamation bond amount: Reclamation bond rider amount:** Additional reclamation bond information attachment: