

Submit 1 Copy To Appropriate District Office  
District I - (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II - (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III - (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV - (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised August 1, 2011

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-015-40303
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Wyatt Draw 13 NC
8. Well Number 1H
9. OGRID Number 14744
10. Pool name or Wildcat North Seven Rivers Glorieta Yeso 97565

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other

2. Name of Operator  
Mewbourne Oil Company

3. Address of Operator  
PO Box 5270, Hobbs, NM 88240

4. Well Location

Unit Letter C : 225 feet from the North line and 1670 feet from the West line  
Section 24 Township 19S Range 25E NMPM Eddy County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3416'

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☒  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☐  
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Drilled 12 1/4" hole to 785'. POOH & run 9 5/8" 36# J55 csg. While running csg, became stuck @ 704' (shoe depth). Unable to move pipe or circulate. Called T.C. Shapard to discuss options. Approved options as follows:


Plans for 9 5/8" casing (End of casing @ 704').

Run 1" pipe to 555' (Tagging up @ that depth). Cement 9 5/8" to surface thru 1".  
WOC. NU Well head. RIH & drill out float shoe and clean out to 785' (TD of 12 1/4" OH)

Drill 8 3/4" hole to KOP @ 2161'. Run 7" casing & cement to surface.

Drill out curve & horizontal with 6 1/8" & run packers & ports.

Will set Isolation Packer at Producing Hardline in Section 13.

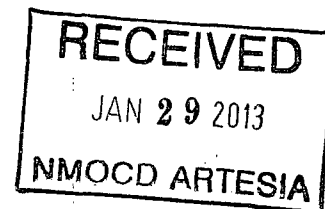

Spud Date: 01/26/13

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jackie Lathan TITLE Hobbs Regulatory DATE 01/28/13

Type or print name Jackie Lathan E-mail address: jlathan@mewbourne.com PHONE: 575-393-5905

For State Use Only

APPROVED BY: T.C. Shapard TITLE Geologist DATE 1/29/2013

Conditions of Approval (if any):