· •	OCD Artesia				
Dor	UNITED STAT DEPARTMENT OF TH BUREAU OF LAND MA SUNDRY NOTICES AND REI not use this form for proposals doned well. Use form 3160-3 (J	E INTERIOR NAGEMENT PORTS ON WELLS to drill or to re-enter an	OMF Expir 5. Lease Serial No NMNM2507	FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010 5. Lease Serial No. NMNM2507 6. If Indian, Allottee or Tribe Name	
	AIT IN TRIPLICATE - Other inst				
1. Type of Well Oil Well Gas	Well   Other	,		8. Well Name and No. TRIGG 5 FEDERAL COM 001H	
2. Name of Operator COG OPERATING	Contac	TE DAVID A EYLER R@MILAGRO-RES.COM	9. API Well No. 30-015-3979	9. API Well No. 30-015-39798	
3a. Address 600 W. ILLINOIS AVE. MIDLAND, TX: 79701		3b. Phone No. (include area code Ph: 432-687-3033	) 10. Field and Pool. WILDCAT	10. Field and Pool, or Exploratory WILDCAT	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		tion)	11. County or Paris	11. County or Parish, and State	
Sec 5 T16S R31E M	/ler NMP NWNW 380FNL 90FW	L	EDDY COUN	JTY, NM	
12. CHI	ECK APPROPRIATE BOX(ES)	TO INDICATE NATURE OF	NOTICE, REPORT, OR OTH	HER DATA	
TYPE OF SUBMIS	SION	TYPE O	OF ACTION		
☑ Notice of Intent □ Subsequent Report □ Final Abandonmen		<ul> <li>Deepen</li> <li>Fracture Treat</li> <li>New Construction</li> <li>Plug and Abandon</li> <li>on</li> <li>Plug Back</li> </ul>	<ul> <li>Production (Start/Resume)</li> <li>Reclamation</li> <li>Recomplete</li> <li>Temporarily Abandon</li> <li>Water Disposal</li> </ul>	<ul> <li>Water Shut-Off</li> <li>Well Integrity</li> <li>Other</li> </ul>	
Attach the Bond under v following completion of testing has been complet determined that the site : 1) SET 4-1/2" CIBP 4-1/2" LNR.TOP); V 2) CIRC. WELL W/ 3) PUMP 50 SXS. ( 4) PUMP 50 SXS. ( 5) PUMP 50 SXS. ( 6) PUMP 60 SXS. ( 7) PUMP 60 SXS. ( 8) MIX X CIRC. TO 9) DIG OUT X CUT DRY HOLE MARKE	hich the work will be performed or pro- the involved operations. If the operatio ed. Final Abandonment Notices shall be s ready for final inspection.) @ 7,270'; PUMP 40 SXS. CMT. /OC X TAG TOP OF CMT. PXA FLUID. CMT. @ 6,170'-6,000' (T/TUBB). CMT. @ 6,170'-6,000' (T/TUBB). CMT. @ 4,955'-4,800' (T/GLOR.) CMT. @ 3,410'-3,245' (T/S.A.,9-5 CMT. @ 1,860'-1,630' (T/SALT/ANH) SURF. 25 SXS. CMT. @ 100'-3' OFF WELLHEAD 3' B.G.L.; WE CMT.	5/8"CSG.SHOE); WOC X TAG. X B/SALT/ANHY.); WOC X TAG Y.,13-3/8"CSG.SHOE); WOC X 1	A. Required subsequent reports shall sompletion in a new interval, a Form SEE ATTACHE CONDITIONS AG. S. X INSTALL RECLAMA	be filed within 30 days 3160-4 shall be filed once ed, and the operator has	
14. I hereby certify that the	foregoing is true and correct. Electronic Submissio	n #217001 verified by the BLM We	II Information System	DECENTER	
	For CO Committed to AFMSS f	G OPERATING LLC, sent to the Ca for processing by JOHNNY DICKE	arisbad RSON on 08/15/2013 ()	RECEIVEL	
Name(Printed/Typed) DAVID A EYLER		Title AGENT		ALIG 27 2013	
Signature	(Electronic Submission)	Date 08/14/2	013	NMOCD ARTES	
	THIS SPACE	FOR FEDERAL OR STATE	OFFICE USE		
ertify that the applicant hold.	nes <u>A</u> . <u>Annes</u> , are attached. Approval of this notice d s legal or equitable title to those rights in ant to conduct operations thereon.	loes not warrant or the subject lease Office CAC	1 <u>5</u>	Date 8-25-	
Title 18 U.S.C. Section 1001		it a crime for any person knowingly and		or agency of the United	

\*\* OPERATOR-SUBMITTED \*\* OPERATOR-SUBMITTED \*\* OPERATOR-SUBMITTED \*\*

### Additional data for EC transaction #217001 that would not fit on the form

#### 32. Additional remarks, continued


. • •

DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK AND HAUL CONTENTS TO THE REQUIRED DISPOSAL, PER OCD RULE 19.15.17.

•

.

# Trigg 5 Fed Com #1H

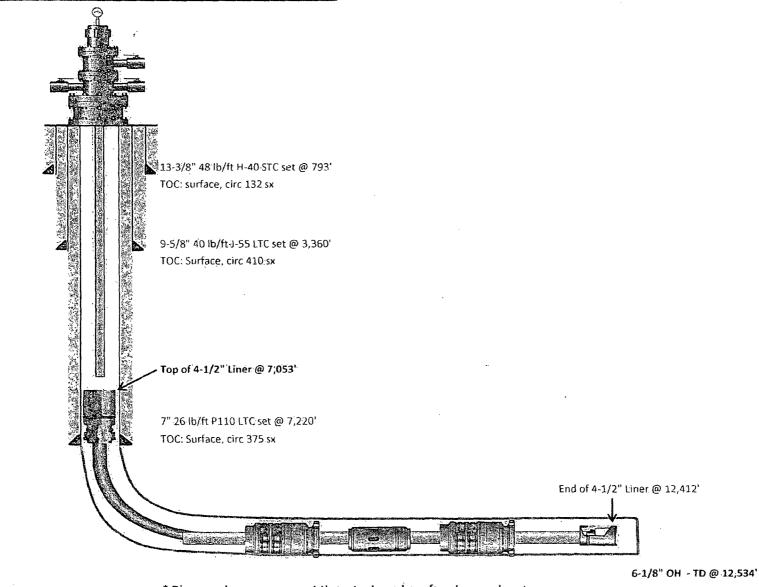

\* Diagram does no represent the actual number of packers and ports. See next tab for actual configuration and setting depths.

· Tri	DG OPERATING LLC gg 5 Fed Com #1H		
	80' FNL X 90' FWL 5-16S-31E County PI #: 30-015-39798.		
		Rustlee	737
13-2/8" 48 LN/FT H-40 STC. SET @793 TOC: SURFACE, CIRC 132 SX. PUMP 60 SXS. @ 903'-687'-TAG.		Rustler Salada Tansiil	823
PUMP 65 SXS. @ 1860-1630'-TAG.		Tansil	1681
		Yrtes	1810
9:5/6" 40 LB/FT7J-55 LTC SET @ 2 TOC. SURF. CIRC 410 SX:		772	Souto
PUMP 50 SXS. CMT. @ 4955'-4800'-TAG.		Qu	25-9/
		SA	3297
PUMP 50 SXS. CMT. @ 6170-6000'.		Gl Tubb Drink	4882
		Tubb	608 b
TOP OF 4-1/2" LINER @ 7,653 PUMP 40 SXS, CMT, @ 7270-7000		Drink	6176
		Abo	6790
		A60 h. A60	8187
SET 4-1/2" CIBP @ 7270		WC	8 208

,

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

J. Amos 3/6/11

## Requirements for ground level dry hole markers <u>Well Identification Markers</u> Conditions of Approval (COA)

The BLM Carlsbad Field Office (CFO) Conditions of Approval (COA) Requires that ground level dry hole markers be placed on well within the Lesser Prairie Chicken habitat area. The dry hole markers will be to the following specifications. The operator will construct the markers as follows:

- 1. An 8 inch X 8 inch steel plate 1/8 to 3/16 of an inch thick is to be placed on the old dry hole marker stand pipe 2 inches from ground level, in the Lesser Prairie Chicken habitat area.
- 2. Steel plate may be welded or bolted approximately 2 inches from ground level on the stand pipes. If plates are bolted to the stand pipe, the person installing the plate will be required to weld a pipe collar on the plate and place a minimum of two set screws/bolt on each collar. Aluminum data plates may be bolted with minimum <sup>1</sup>/<sub>4</sub> inch bolt and locking nuts or self tapping fine threaded screws. A minimum of one in each corner is to be installed on each plate.
- 3. An 8 inch x 8 inch aluminum plate, which is 12 gauge or .080 sign material (1/8 inch aluminum plate may be used in place of the .080 plate) with the required information for that well stamped or engraved in a minimum 3/8 inch tall letter or number.
- 4. The following information will be stamped or engraved on the 8 inch X 8 inch aluminum plate in the following order.
  - a. First row: Operators name
  - b. Second row: Well name and number
  - c. Third row: Legal location to include <sup>1</sup>/<sub>4</sub> <sup>1</sup>/<sub>4</sub>, Section, Township, and range. If the legal location cannot be placed on one row it can be split into two rows with the <sup>1</sup>/<sub>4</sub> <sup>1</sup>/<sub>4</sub> (example: 1980 FNL 1980 FWL) being on the top row.
  - d. Fourth row: Lease Number and API number.
    - i. Example marker plate: (attached)

NMOCD Order No. R-12965 also required the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a ground level dry hole marker was installed as required in the COA's from the BLM.



## **United States Department of the Interior**

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

#### **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

#### Inspection & Enforcement

Jim Amos Supervisory Environmental Protection Specialist 575-234-5909, 575-361-2648 (Cell)

Mike Burton Environmental Protection Specialist 575-234-2226

Jeffery Robertson Natural Resource Specialist 575-234-2230

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Doug Hoag Civil Engineering Technician 575-234-5979

Linda Denniston Environmental Protection Specialist 575-234-5974

Solomon Hughes Natural Resource Specialist 575-234-5951

#### Permitting

Cody Layton Natural Resource Specialist 575-234-5959

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Todd Suter Surface Protection Specialist 575-234-5987

Tanner Nygren Natural Resource Specialist 575-234-5975

Amanda Lynch Natural Resource Specialist 575-234-5922

Legion Brumley Environmental Protection Specialist 575-234-5957

**Realty, Compliance** Randy Pair Environmental Protection Specialist 575-234-6240