Form 3160-5 (August 2007) / DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an					FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010 5. Lease Serial No. NMNM030456 6. If Indian, Allottee or Tribe Name	
abandoned well. Use form 3160-3 (APD) for such proposals. 					7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well					891000303X 8. Well Name and No.	
🔀 Oil Well 🔲 Gas Well 🛄 Other					PLU BIG SINKS 12 25 30 USA 1H	
2. Name of Operator BOPCO LP	LOCKHART	-OCKHART 9. API Well No. 30-015-41598-00-X1				
3a. Address MIDLAND, TX 79702		3b. Phone N Ph: 432.6	o. (include area code) 83.2277		10. Field and Pool, or E POKER LAKE N	
4. Location of Well (Footage, Sec., 7	11. County or Parish,			nd State		
Sec 1 T25S R30E SWSW 165 32.091039 N Lat, 103.502139			EDDY COUNTY, NM			
12. CHECK APPI	ROPRIATE BOX(ES) TO	O INDICATI	E NATURE OF N	IOTICE, RE	EPORT, OR OTHER	R DATA
TYPE OF SUBMISSION	TYPE OF ACTION					
 Notice of Intent Subsequent Report Final Abandonment Notice 13. Describe Proposed or Completed Op 	alent Report Casing Casing Repair		 Fracture Treat Reclar New Construction Recon Plug and Abandon Tempo Plug Back Water nt details, including estimated starting date of any 		lete arily Abandon Disposal oposed work and approxi	 Water Shut-Off Well Integrity Other Change to Original A PD
Attach the Bond under which the wo following completion of the involved testing has been completed. Final Al determined that the site is ready for f BOPCO, L.P. respectfully requires Cameron MBS wellhead. BO casing to 3,000 psi high and 2 the well. Please find the attact representative and the BOP to the well.	rk will be performed or provide d operations. If the operation re bandonment Notices shall be fil inal inspection.) uests to change plans for PCO, L.P. respectfully red 50 psi low, which will cov thed schematic of the wel	the Bond No. c sults in a multip ed only after all BOP testing quests to nip er testing red lhead. The f	n file with BLM/BIA ole completion or reco requirements, includi due to the utilizat ple up and test BC quirements for the ield report from th	. Required sub mpletion in a n ing reclamation ion of the OPE on surfa duration of the Cameron	osequent reports shall be f lew interval, a Form 3160 n, have been completed, a ace	iled within 30 days -4 shall be filed once
	DEC 02	VED 2013 TESIA		SEE A COND	TTACHED FC DITIONS OF A	OR PPROVAL
14. Thereby certify that the foregoing is Comm Name(Printed/Typed) CHRISTO	by the BLM Well ent to the Carlsbac NY DICKERSON o Title DRILLIN	4	i (14JLD1523SE)			
Signature (Electronic S	Submission)		Date 11/07/20)13		
	THIS SPACE FO	DR FEDER	AL OR STATE (OFFICE US	SE	
Approved By_CHRISTOPHEB WALLS Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any pe States any false, fictitious or fraudulent statements or representations as to any matter wi			TitlePETROLEUM ENGINEER Date 11/26/2013 Office Carlsbad - erson knowingly and willfully to make to any department or agency of the United ithin its jurisdiction.			


1

** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **



CUSTOMER: BOPCO

Diagram "Z"

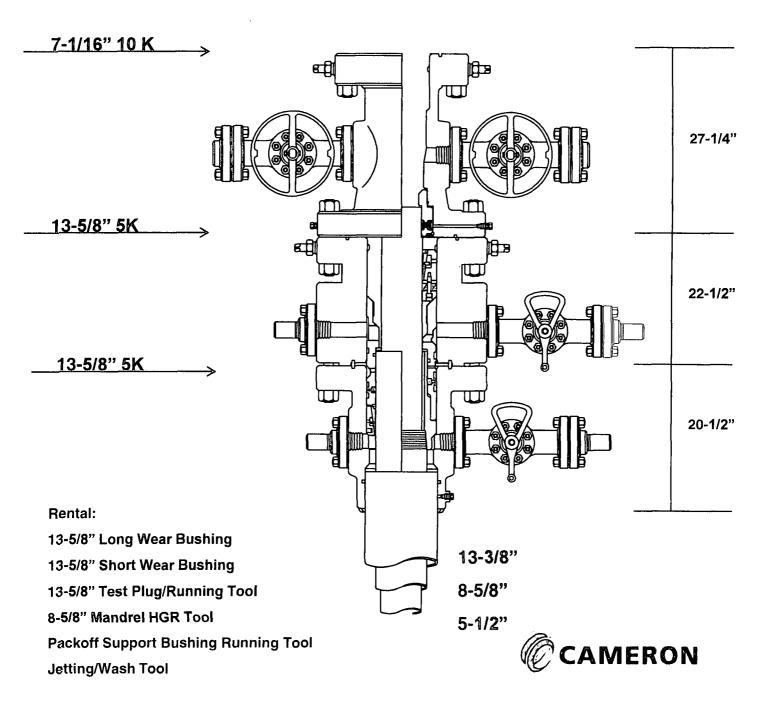

CONDITIONS OF APPROVAL

OPERATOR'S NAME:	BOPCO, L.P.
LEASE NO.:	NMNM-030456
WELL NAME & NO.:	PLU Big Sinks 12 25 30 USA 1H
SURFACE HOLE FOOTAGE:	0165' FSL & 1160' FWL
BOTTOM HOLE FOOTAGE	0070' FSL & 0660' FWL Sec. 12, T. 25 S., R 30 E.
LOCATION:	Section 01, T. 25 S., R 30 E., NMPM
COUNTY:	Eddy County, New Mexico

A. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. Variance approved to use flex line from BOP to choke manifold. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. If the BLM inspector questions the straightness of the hose, a BLM engineer will be contacted and will review in the field or via picture supplied by inspector to determine if changes are required (operator shall expect delays if this occurs).
- 3. Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 3000 (3M) psi.
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.

- 4. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
 - b. The tests shall be done by an independent service company utilizing a test plug **not a cup or J-packer**. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to Onshore Order 2 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (18 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
 - c. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock.
 - d. The results of the test shall be reported to the appropriate BLM office.
 - e. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
 - f. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.

CRW 111213