(August 2007) DE	UNITED STATES PARTMENT OF THE INTERIOR OCD Artesia UREAU OF LAND MANAGEMENT		OMB Expire	FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010		
	NOTICES AND REPOR		5. Lease Serial No. NMLC064243.	Α		
Do not use thi	s form for proposals to J. Use form 3160-3 (APL	drill or to re-enter an	6. If Indian, Allottee			
SUBMIT IN TRI	7. If Unit or CA/Ag	7. If Unit or CA/Agreement, Name and/or N				
1. Type of Well Gas Well Oth	er	, <u>, , , , , , , , , , , , , , , , , , ,</u>	8. Well Name and N INDIAN HILLS U			
2. Name of Operator OYX USA WTP LP	9. API Well No. 30-015-32656	9. API Well No. 30-015-32656				
 3a. Address P.O. BOX 50250 MIDLAND, TX 79710 		3b. Phone No. (include area code) Ph: 432-685-5717 Fx: 432-685-5742	10. Field and Pool, o INDIAN BASIN	10. Field and Pool, or Exploratory INDIAN BASIN UP PENN		
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description)		I1. County or Parish	11. County or Parish, and State		
Sec 33 T21S R24E NWSE 26 32.435680 N Lat, 104.499190			EDDY COUNT	Y, NM		
12. CHECK APPR	OPRIATE BOX(ES) TO	INDICATE NATURE OF N	IOTICE, REPORT, OR OTHI	ER DATA		
TYPE OF SUBMISSION	TYPE OF ACTION					
X Notice of Intent	□ Acidize	Deepen	Production (Start/Resume)	U Water Shut-Of		
Subsequent Report	Alter Casing	Fracture Treat		U Well Integrity		
	Casing Repair	■ New Construction	Recomplete	D Other		
☐ Final Abandonment Notice	Change Plans Convert to Injection	🛛 Plug and Abandon 🗖 Plug Back	Temporarily Abandon Water Disposal			
testing has been completed. Final Ab determined that the site is ready for fin TD-8600' PBTD-8554' Pe	rfs-7990-8306'	d only after all requirements, includi		·		
9-5/8" 36# csg @ 1815' w/ 112 7" 23-26# csg @ 8599' w/ 630s	:5sx, 12-1/4" hole, TOC-S sx,DVT @ 3854', TOC-1s	urf-Circ t-6267'-Calc ? 2nd-Surf-Circ	RECLAMATION PR ATTACHE			
1. RIH & set CIBP @ 7940', M	5' WOC-Tag					
 M&P 40sx cmt @ 7340-716 Perf @ 5595', sqz 60sx cmt M&P 35sx cmt @ 3904-376 M&P 45sx cmt @ 2940-274 M&P 30sx cmt @ 1865-174 M&P 70sx cmt @ 300' to Su 	4' WOC-Tag .0' WOC-Tag 5' WOC-Tag	DEC 16 201	³ CONDITIONS O	F APPROVAL		
 M&P 40sx cmt @ 7340-716 Perf @ 5595', sqz 60sx cmt M&P 35sx cmt @ 3904-376 M&P 45sx cmt @ 2940-274 M&P 30sx cmt @ 1865-174 M&P 70sx cmt @ 300' to Su 	4' WOC-Tag 0' WOC-Tag 5' WOC-Tag urface true and correct. Electronic Submission #2	DEC 16 201 NMOCD ARTE	CONDITIONS O	F APPROVAL		
 M&P 40sx cmt @ 7340-716 Perf @ 5595', sqz 60sx cmt M&P 35sx cmt @ 3904-376 M&P 45sx cmt @ 2940-274 M&P 30sx cmt @ 1865-174 M&P 70sx cmt @ 300' to Su 	4' WOC-Tag 0' WOC-Tag 5' WOC-Tag urface true and correct. Electronic Submission #2 For OYX (DEC 16 201 NMOCD ARTE	GONDITIONS O SIA Information System	F APPROVAL		
 M&P 40sx cmt @ 7340-716 Perf @ 5595', sqz 60sx cmt M&P 35sx cmt @ 3904-376 M&P 45sx cmt @ 2940-274 M&P 30sx cmt @ 1865-174 M&P 70sx cmt @ 300' to Su 	4' WOC-Tag 0' WOC-Tag 5' WOC-Tag urface true and correct. Electronic Submission #2 For OYX (Committed to AFMSS fo	DEC 16 201 NMOCD ARTE 27901 verified by the BLM Well USA WTP LP, sent to the Carls r processing by KURT SIMMOT	GONDITIONS O SIA Information System	F APPROVAL		
 M&P 40sx cmt @ 7340-716 Perf @ 5595', sqz 60sx cmt M&P 35sx cmt @ 3904-376 M&P 45sx cmt @ 2940-274 M&P 30sx cmt @ 1865-174 M&P 70sx cmt @ 300' to Su 	4' WOC-Tag 0' WOC-Tag 5' WOC-Tag urface true and correct. Electronic Submission #2 For OYX Committed to AFMSS fo EWART	DEC 16 201 NMOCD ARTE 27901 verified by the BLM Well USA WTP LP, sent to the Carls r processing by KURT SIMMOT	A CONDITIONS O SIA CONDITIONE	F APPROVAL		
 2. M&P 40sx cmt @ 7340-716 3. Perf @ 5595', sqz 60sx cmt 4. M&P 35sx cmt @ 3904-376 5. M&P 45sx cmt @ 2940-274 6. M&P 30sx cmt @ 1865-174 7. M&P 70sx cmt @ 300' to Su 14. I hereby certify that the foregoing is Name(Printed/Typed) DAVID STE 	4' WOC-Tag 0' WOC-Tag 5' WOC-Tag urface true and correct. Electronic Submission #2 For OYX (Committed to AFMSS fo EWART	DEC 16 201 NMOCD ARTE 27901 verified by the BLM Well USA WTP LP, sent to the Carls r processing by KURT SIMMOT Title SR. REC	3 CONDITIONS O SIA Information System bad IS on 12/02/2013 () GULATORY ADVISOR 13	F APPROVAL		
 M&P 40sx cmt @ 7340-716 Perf @ 5595', sqz 60sx cmt M&P 35sx cmt @ 3904-376 M&P 45sx cmt @ 2940-274 M&P 30sx cmt @ 1865-174 M&P 70sx cmt @ 300' to Su 14. I hereby certify that the foregoing is Name(Printed/Typed) DAVID STE	4' WOC-Tag 0' WOC-Tag 5' WOC-Tag urface true and correct. Electronic Submission #2 For OYX (Committed to AFMSS fo EWART	DEC 16 201 NMOCD ARTE 27901 verified by the BLM Well USA WTP LP r processing by KURT SIMMON Title SR. REC Date 11/25/20	3 CONDITIONS O ESIA No Information System A bad IS on 12/02/2013 () GULATORY ADVISOR 13 DFFICE USE	F APPROVAL		

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **

Additional data for EC transaction #227901 that would not fit on the form

.

• •

3

.

0

32. Additional remarks, continued

* , · ž

ı

10# MLF between plugs , Above ground steel tanks will be utilized

This Intent to P&A is being resubmitted it was originally approved 11/25/12. copy attached.

OXY USA WTP LP - Proposed Indian Hills Unit #44 API No. 30-015-32656

70sx @ 300'-Surface

, i

30sx @ 1865-1745' WOC-Tag

45sx @ 2940-2740' WOC-Tag


35sx @ 3904-3764' WOC-Tag

60sx @ 5595-5439' WOC-Tag

40sx @ 7340-7165' WOC-Tag

CIBP @ 7940' w/ 25sx to 7840'

PB-8554'

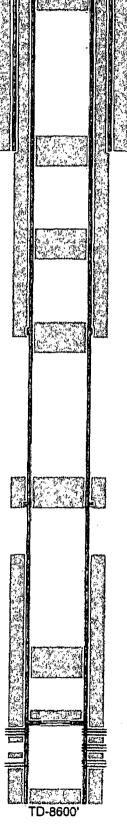

12-1/4" hole @ 1815' 9-5/8" csg @ 1815' w/ 1125sx-TOC-Surf-Circ

Perf @ 5595'

8-3/4" hole @ 8600' 7" csg @ 8599' DVT @ 3854' w/ 630sx-TOC-Surf-Circ

Perfs @ 7990-8306'

OXY USA WTP LP - Current Indian Hills Unit #44 API No. 30-015-32656

.

- - - - -

1.

Perfs @ 7990-8306' TD-8600'

.

- -

12-1/4" hole @ 1815' 9-5/8" csg @ 1815' w/ 1125sx-TOC-Surf-Circ

.

- --+

.

э

8-3/4" hole @ 8600' 7" csg @ 8599' DVT @ 3854' w/ 630sx-TOC-Surf-Circ

PB-8554'

		•			
Form 3160-5 (April 2004)	UNITED S DEPARTMENT O EUREAU OF LANI	F THE INTERIOR	Operator Conv	FORM APPROVED OM B No. 1004-0137 France M h 31 2007	
Do по	JNDRY NOTICES AND t use this form for propo loned well. Use Form 316	osals t		,	
SUBMI	TIN TRIPLICATE- Othe	ər insti			rNo.
1. Type of Well Oil Well	l. Gas Well ⁷	Other			
2. Name of Operator OX	Y USA WTP LP				÷4
3a. Address P.O. Box 50250 Mid	lland, TX 79710				
	ntage, Sec., T., R., M., or Survey Desc				
	1394 FEL NUSE . 646 FEL NENE			11. County or Parish, State Eddy NM	
-				REPORT, OR OTHER DATA	
TYPE OF SUBMIS		ES) TO INDICATE 1	TYPE OF ACTION	REPORT, OR OTHER DATA	
_	Acidize		TILD OF MOTION	Water Shut-Off	
Notice of Intent	Alter Casing			Well Integrity	
Subsequent Report	Casing Repair			Other	
Final Abandoungent	t Notice Change Plans	ion			
	ler which the work will be performed	w on provi.			
following completio testing has been corr	n of the involved operations. If the operation of the involved operation of the operation o		n requirements, including recta	s shall be filed within 30 a um 3160-4 shall be filed amation, have been completed, and the operator l	onco
following completio testing has been corr	npleted. Final Abandonment Notices site is ready for funal inspection.)	s shall be meening after a	n requirements, including recu	om 3160-4 shall be filed	onco
following completio testing has been corr	npleted. Final Abandonment Notices site is ready for final inspection.) TD-8600' PBT 9-5/8" 364	Sshall be meaning american D 8554' Perfs-79 # csg @ 1815' w/ 12	90-8306' 125sx, 12-1/4" hole, T(om 3160-4 shall be filed amation, have been completed, and the operator f DC-Surf-Circ	onco
following completio testing has been corr	npleted. Final Abandonment Notices site is ready for final inspection.) TD-8600' PBT 9-5/8"364 7" 23-26#	sshall be meaning attern D 8554' Perfs-79 # csg @ 1815' w/ 13 i csg @ 8599' w/ 63	990-8306' 125sx, 12-1/4" hole, T(0sx,DVT @ 3854', TOC 5sx cmt to 7840'	om 3160-4 shall be filed amation, have been completed, and the operator f DC-Surf-Circ 2-1 st -6267'-Calc – 2 nd -Surf-Circ	onco
following completio testing has been corr	npleted. Final Abandonment Notices site is ready for funal inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr	Shall be meaning attern D 8554' Perfs-79 # csg @ 1815' w/ 12 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W	990-8306' 125sx, 12-1/4" hole, T(0sx,DVT @ 3854', TOC 5sx cmt to 7840' /OC-Tag	om 3160-4 shall be filed amation, have been completed, and the operator f DC-Surf-Circ	onco
following completio testing has been corr	npleted. Final Abandonment Notices site is ready for funal inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr 3. Perf @ 5595	5 shall be meaning attern 5 8554' Perfs-79 # csg @ 1815' w/ 12 5 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W ', sqz 60sx cmt to 5	990-8306' 125sx, 12-1/4" hole, T(0sx,DVT @ 3854', TOC 5sx cmt to 7840' /OC-Tag 439' WOC-Tag	un 3160-4 shall be filed amation, have been completed, and the operator i DC-Surf-Circ C-1 st -6267'-Calc – 2 nd -Surf-Circ SEE ATTACHED FOR	has
following completio testing has been com	npleted. Final Abandonment Notices site is ready for funal inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr 3. Perf @ 5595 4. M&P 35sx cr	5 shall be meaning attern 5 D 8554' Perfs-79 # csg @ 1815' w/ 12 5 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W 1', sqz 60sx cmt to 5 mt @ 3904-3764' W	990-8306' 125sx, 12-1/4" hole, TC 0sx,DVT @ 3854', TOC 5sx cmt to 7840' /OC-Tag 439' WOC-Tag /OC-Tag	om 3160-4 shall be filed amation, have been completed, and the operator f DC-Surf-Circ 2-1 st -6267'-Calc – 2 nd -Surf-Circ	has
following completio testing has been corr	npleted. Final Abandonment Notices site is ready for funal inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr 3. Perf @ 5595 4. M&P 35sx cr 5. M&P 45sx cr 6. M&P 30sx cr	TD 8554' Perfs-79 # csg @ 1815' w/ 12 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W i', sqz 60sx cmt to 5 mt @ 3904-3764' W mt @ 2940-2740' W mt @ 1865-1745' W	990-8306' 125sx, 12-1/4" hole, To 0sx,DVT @ 3854', TOO 5sx cmt to 7840' /OC-Tag 439' WOC-Tag /OC-Tag /OC-Tag /OC-Tag	un 3160-4 shall be filed amation, have been completed, and the operator f DC-Surf-Circ C-1 st -6267'-Calc – 2 nd -Surf-Circ SEE ATTACHED FOR CONDITIONS OF APPRO	has
following completio testing has been com	npleted. Final Abandonment Notices site is ready for funal inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr 3. Perf @ 5595 4. M&P 35sx cr 5. M&P 45sx cr 6. M&P 30sx cr	TD 8554' Perfs-79 # csg @ 1815' w/ 12 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W ', sqz 60sx cmt to 5 mt @ 3904-3764' W mt @ 2940-2740' W mt @ 1865-1745' W mt @ 300' to Surfac	990-8306' 125sx, 12-1/4" hole, To 0sx,DVT @ 3854', TOO 5sx cmt to 7840' /OC-Tag 439' WOC-Tag /OC-Tag /OC-Tag /OC-Tag	un 3160-4 shall be filed amation, have been completed, and the operator i DC-Surf-Circ C-1 st -6267'-Calc – 2 nd -Surf-Circ SEE ATTACHED FOR	has
following completio testing has been com determined that the s letermined that the s	npleted. Final Abandonment Notices site is ready for final inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr 3. Perf @ 5595 4. M&P 40sx cr 5. M&P 40sx cr 5. M&P 30sx cr 6. M&P 30sx cr 7. M&P 70sx cr 10# MLF bet at the foregoing is true and correct yped)	TD 8554' Perfs-79 # csg @ 1815' w/ 12 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W ', sqz 60sx cmt to 5 mt @ 3904-3764' W mt @ 2940-2740' W mt @ 1865-1745' W mt @ 300' to Surfac ween plugs	990-8306' 125sx, 12-1/4" hole, T(0sx,DVT @ 3854', TOC 5sx cmt to 7840' /OC-Tag /OC-Tag /OC-Tag /OC-Tag /OC-Tag :e	amation, have been completed, and the operator f DC-Surf-Circ C-1 st -6267'-Calc – 2 nd -Surf-Circ SEE ATTACHED FOR CONDITIONS OF APPRO RECLAMATION PROCEDI ATTACHED	has
following completio testing has been com determined that the s determined that the s 14. I hereby certify tha Name (Printed/T) David S	npleted. Final Abandonment Notices site is ready for final inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr 3. Perf @ 5595 4. M&P 40sx cr 5. M&P 40sx cr 5. M&P 30sx cr 6. M&P 30sx cr 7. M&P 70sx cr 10# MLF bet at the foregoing is true and correct yped)	TD 8554' Perfs-79 # csg @ 1815' w/ 12 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W ', sqz 60sx cmt to 5 mt @ 3904-3764' W mt @ 2940-2740' W mt @ 1865-1745' W mt @ 300' to Surfac ween plugs	990-8306' 125sx, 12-1/4" hole, To 0sx,DVT @ 3854', TOO 5sx cmt to 7840' /OC-Tag 439' WOC-Tag /OC-Tag /OC-Tag /OC-Tag	amation, have been completed, and the operator f DC-Surf-Circ C-1 st -6267'-Calc – 2 nd -Surf-Circ SEE ATTACHED FOR CONDITIONS OF APPRO RECLAMATION PROCEDI ATTACHED	has
following completio testing has been com determined that the s letermined that the s	npleted. Final Abandonment Notices site is ready for final inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr 3. Perf @ 5595 4. M&P 40sx cr 5. M&P 40sx cr 5. M&P 30sx cr 6. M&P 30sx cr 7. M&P 70sx cr 10# MLF bet at the foregoing is true and correct yped) Stewart	TD 8554' Perfs-79 # csg @ 1815' w/ 12 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W i', sqz 60sx cmt to 5 mt @ 3904-3764' W mt @ 2940-2740' W mt @ 1865-1745' W mt @ 300' to Surfac ween plugs	190-8306' 125sx, 12-1/4" hole, To 0sx,DVT @ 3854', TOC 5sx cmt to 7840' /OC-Tag /OC-Tag /OC-Tag /OC-Tag /OC-Tag :e Title Regulatory Advisor Date	amation, have been completed, and the operator 1 DC-Surf-Circ 5-1 st -6267'-Calc – 2 nd -Surf-Circ SEE ATTACHED FOR CONDITIONS OF APPRO RECLAMATION PROCEDI ATTACHED	has
following completio testing has been com determined that the s determined that the s 14. I hereby certify tha Name (Printed/T) David S	npleted. Final Abandonment Notices site is ready for final inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr 3. Perf @ 5595 4. M&P 40sx cr 5. M&P 40sx cr 5. M&P 30sx cr 6. M&P 30sx cr 7. M&P 70sx cr 10# MLF bet at the foregoing is true and correct yped) Stewart	TD 8554' Perfs-79 # csg @ 1815' w/ 12 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W i', sqz 60sx cmt to 5 mt @ 3904-3764' W mt @ 2940-2740' W mt @ 1865-1745' W mt @ 300' to Surfac ween plugs	990-8306' 125sx, 12-1/4" hole, TC 0sx,DVT @ 3854', TOC 5sx cmt to 7840' /OC-Tag /OC-Tag /OC-Tag /OC-Tag :e Title Regulatory Advisor	amation, have been completed, and the operator 1 DC-Surf-Circ 5-1 st -6267'-Calc – 2 nd -Surf-Circ SEE ATTACHED FOR CONDITIONS OF APPRO RECLAMATION PROCEDI ATTACHED	has
following completio testing has been com determined that the s letermined that the s let	npleted. Final Abandonment Notices site is ready for funal inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CIE 2. M&P 40sx cr 3. Perf @ 5595 4. M&P 40sx cr 5. M&P 40sx cr 5. M&P 30sx cr 6. M&P 30sx cr 7. M&P 70sx cr 10# MLF bet at the foregoing is true and correct yped) Stewart THIS SPACE	TD 8554' Perfs-79 # csg @ 1815' w/ 12 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W ', sqz 60sx cmt to 5 mt @ 3904-3764' W mt @ 2940-2740' W mt @ 1865-1745' W mt @ 300' to Surfac ween plugs ct FOR FEDERAL	190-8306' 125sx, 12-1/4" hole, TC 0sx,DVT @ 3854', TOC 5sx cmt to 7840' /OC-Tag /	amation, have been completed, and the operator 1 DC-Surf-Circ 5-1 st -6267'-Calc – 2 nd -Surf-Circ SEE ATTACHED FOR CONDITIONS OF APPRO RECLAMATION PROCEDI ATTACHED	UR
following completio testing has been com determined that the s letermined that the s let	npleted. Final Abandonment Notices site is ready for funal inspection.) TD-8600' PBT 9-5/8" 364 7" 23-26# 1. RIH & set CHE 2. M&P 40sx cr 3. Perf @ 5595 4. M&P 40sx cr 5. M&P 40sx cr 5. M&P 30sx cr 6. M&P 30sx cr 7. M&P 70sx cr 10# MLF bet at the foregoing is true and correct yped) Stewart THIS SPACE	TD 8554' Perfs-79 # csg @ 1815' w/ 12 csg @ 8599' w/ 63 BP @ 7940', M&P 2 mt @ 7340-7165' W ', sqz 60sx cmt to 5 mt @ 3904-3764' W mt @ 2940-2740' W mt @ 1865-1745' W mt @ 300' to Surfac ween plugs ct FOR FEDERAL	190-8306' 125sx, 12-1/4" hole, TC 0sx,DVT @ 3854', TOC 5sx cmt to 7840' /OC-Tag /	amation, have been completed, and the operator 1 DC-Surf-Circ 2-1 st -6267'-Calc – 2 nd -Surf-Circ SEE ATTACHED FOR CONDITIONS OF APPRO RECLAMATION PROCED ATTACHED	VA

•

•

OXY USA WTP LP - Proposed Indian Hills Unit #44 API No. 30-015-32656

70sx @ 300'-Surface

4

.

30sx @ 1865-1745' WOC-Tag

45sx @ 2940-2740' WOC-Tag

35sx @ 3904-3764' WOC-Tag


.

60sx @ 5595-5439' WOC-Tag

40sx @ 7340-7165' WOC-Tag

CIBP @ 7940' w/ 25sx to 7840'

PB-8554'

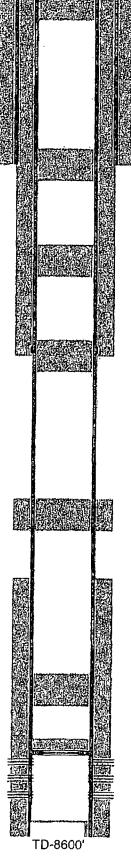


12-1/4" hole @ 1815' 9-5/8" csg @ 1815' w/ 1125sx-TOC-Surf-Circ

Perf @ 5595'

8-3/4" hole @ 8600' 7" csg @ 8599' DVT @ 3854' w/ 630sx-TOC-Surf-Circ

Perfs @ 7990-8306'

OXY USA WTP LP - Current Indian Hills Unit #44 API No. 30-015-32656

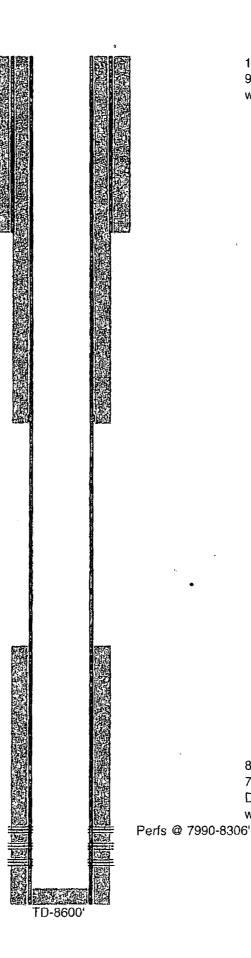

12-1/4" hole @ 1815' 9-5/8" csg @ 1815' w/ 1125sx-TOC-Surf-Circ

8-3/4" hole @ 8600' 7" csg @ 8599' DVT @ 3854' w/ 630sx-TOC-Surf-Circ

PB-8554'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

• •

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Inspection & Enforcement

Jim Amos Supervisory Environmental Protection Specialist 575-234-5909, 575-361-2648 (Cell)

Mike Burton Environmental Protection Specialist 575-234-2226

Jeffery Robertson Natural Resource Specialist 575-234-2230

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Doug Hoag Civil Engineering Technician 575-234-5979

Linda Denniston Environmental Protection Specialist 575-234-5974

Solomon Hughes Natural Resource Specialist 575-234-5951

Permitting

Cody Layton Natural Resource Specialist 575-234-5959

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Todd Suter Surface Protection Specialist 575-234-5987

Tanner Nygren Natural Resource Specialist 575-234-5975

Amanda Lynch Natural Resource Specialist 575-234-5922

Legion Brumley Environmental Protection Specialist 575-234-5957

<u>Realty, Compliance</u> Randy Pair Environmental Protection Specialist 575-234-6240

and the assessment of the