Form 3160-5 (August 2007)


UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

Lease Serial No. NMLC029387C

SUNDRY NOTICES AND REPORTS ON WELLS	TERM
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to refer the result of the control of the	AHIES

1. Type of Well		
Shuce of Operator Contact: DAVID A EYLER 9. API W 30-07	GART (APCO) "A" 001 Vell No.	
CIMAREX ENERGY CO OF COLORABONAII: DEYLER@MILAGRO-RES.COM 30-0' 31. Address 600 N. MARIENFELD, SUITE 600 MIDLAND, TX 79701 42. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 29 T18S R31E Mer NMP NENE 660FNL 660FEL 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR TYPE OF SUBMISSION TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Acidize Ac		
Sec 29 T18S R31E Mer NMP NENE 660FNL 660FEL 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OF SUBMISSION TYPE OF SUBMISSION Acidize	9. API Well No. 30-015-05629	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 29 T18S R31E Mer NMP NENE 660FNL 660FEL 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OF TYPE OF SUBMISSION TYPE OF SUBMISSION TYPE OF ACTION Acidize Deepen Production (Start/Prince of Intent Acidize Reclamation Recomplete Report Casing Repair New Construction Recomplete Convert to Injection Plug Back Water Disposal 13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed wo If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depth Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent refollowing completion of the involved operations. If the operation results in a multiple completion in a new intervatesting has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been determined that the site is ready for final inspection.) SET 5-1/2" CIBP @ 3,200", PUMP 25 SXS.CMT. @ 3,200"-3,070", CIRC. WELL. 2) PERF. X ATTEMP TO SQZ. 55 SXS.CMT. @ 3,200"-3,070", CIRC. WELL. 2) PERF. X CIRC. TO SURF., FILLING ALL ANNULI, 100 SXS.CMT. @ 100"-3". DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK.	10. Field and Pool, or Exploratory SHUGART; YATES-7R-QN-GB	
12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OF SUBMISSION TYPE OF SUBMISSION Acidize Deepen Production (Start/ Alter Casing Fracture Treat Reclamation Casing Repair New Construction Recomplete Change Plans Plug and Abandon Temporarily Abar Convert to Injection Plug Back Water Disposal Convert to Injection Plug Back Water Disposal Convert to Injection Plug Back Water Disposal Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed we if the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depth Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent re following completion of the involved operations. If the operation results in a multiple completion in a new intervatesting has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have bee determined that the site is ready for final inspection. 1) SET 5-1/2" CIBP 3,200'; PUMP 25 SXS.CMT. 3,200'-3,070'; CIRC. WELL. 2) PERF. X ATTEMPT TO SQZ. 55 SXS.CMT. 3,200'-1,990'(B/SALT,B/ANHY); WOC X TAG. 3) PERF. X CIRC. TO SURF., FILLING ALL ANNULI, 100 SXS.CMT. 3,100'-3'. 5) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; WELD STEEL PLATE ONTO CSGS. X INSTALL GROUN HOLE MARKER. DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK.	11. County or Parish, and State	
TYPE OF SUBMISSION Acidize	Y COUNTY, NM	
Notice of Intent Acidize Deepen Production (Start/ Alter Casing Fracture Treat Reclamation Recomplete Casing Repair New Construction Recomplete Final Abandonment Notice Change Plans Plug and Abandon Temporarily Abar Convert to Injection Plug Back Water Disposal Convert to Injection Plug Back Water Disposal Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent re following completion of the involved operations. If the operation results in a multiple completion or recompleted. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have bee determined that the site is ready for final inspection.) SET 5-1/2" CIBP @ 3,200'; PUMP 25 SXS.CMT. @ 3,200'-3,070'; CIRC. WELL. PERF. X ATTEMPT TO SQZ. 55 SXS.CMT. @ 2,050'-4,930' (B/SALT, B/ANHY); WOC X TAG. PERF. X CIRC. TO SURF., FILLING ALL ANNULI, 100 SXS.CMT. @ 100'-3'. SIGN WELL SYSTEM WITH A STEEL TANK BOURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK BURNING THE BURNING THE BROWN TO SALL BURNING THE BROWN THE BROWN THE	OR OTHER DATA	
Alter Casing Fracture Treat Reclamation Subsequent Report Casing Repair New Construction Recomplete Pinal Abandonment Notice Change Plans Plug and Abandon Temporarily Abart Plug Back Water Disposal		
□ Subsequent Report □ Casing Repair □ New Construction □ Recomplete □ Final Abandonment Notice □ Change Plans □ Plug and Abandon □ Temporarily Abar □ Convert to Injection □ Plug Back □ Water Disposal 13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed wo If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depth Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent refollowing completion of the involved operations. If the operation results in a multiple completion or recompletion in a new intervatesting has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been determined that the site is ready for final inspection.) 1) SET 5-1/2" CIBP ② 3,200'; PUMP 25 SXS CMT. ② 3,200'-3,070'; CIRC. WELL. 2) PERF. X ATTEMPT TO SQZ. 55 SXS.CMT. ② 2,050'-1,930'(B/SALT,B/ANHY); WOC X TAG. **POPPORT OF TO SURF.**, FILLING ALL ANNULI, 100 SXS.CMT. ② 100'-3'. 5) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; WELD STEEL PLATE ONTO CSGS. X INSTALL GROUN HOLE MARKER. DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK.	Resume)	
Final Abandonment Notice	■ Well Integrity	
Convert to Injection Plug Back Water Disposal	□ Other	
13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed wo If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depth Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent re following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new intervatesting has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been determined that the site is ready for final inspection.) 1) SET 5-1/2" CIBP @ 3,200'; PUMP 25 SXS.CMT. @ 3,200'-3,070'; CIRC. WELL. 2) PERF. X ATTEMPT TO SQZ. 55 SXS.CMT. @ 2,050'-1,930'(B/SALT,B/ANHY); WOC X TAG. 3) PERF. X ATTEMP TO SQZ. 65 SXS.CMT. @ 2,050'-1,930'(B/SALT,B-S/8"SHOE); WOC X TAG. 4) PERF. X CIRC. TO SURF., FILLING ALL ANNULI, 100 SXS.CMT. @ 100'-3'. 5) DIG OUT X CUT OFF WELLHEAD 3' B.G.L., WELD STEEL PLATE ONTO CSGS. X INSTALL GROUN HOLE MARKER. DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK.	ndon	
If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depth Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent re following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new intervatesting has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been determined that the site is ready for final inspection.) 1) SET 5-1/2" CIBP @ 3,200'; PUMP 25 SXS CMT. @ 3,200'-3,070'; CIRC. WELL. 2) PERF. X ATTEMPT TO SQZ. 55 SXS.CMT. @ 2,050'-1,930'(B/SALT,B/ANHY); WOC X TAG. 3) PERF. X ATTEMP TO SQZ. 65 SXS.CMT. @ 650'-760'(T/SALT,B-5/8"SHOE); WOC X TAG. 4) PERF. X CIRC. TO SURF., FILLING ALL ANNULI, 100 SXS.CMT. @ 100'-3'. 5) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; WELD STEEL PLATE ONTO CSGS. X INSTALL GROUN HOLE MARKER. DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK.		
DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM WITH A STEEL TANK	>- 1790 -670.	
THE RECORDED DISPOSAL PER OCD RITE 19 15 17	AND HAUL CONTENTS TO	
THE REQUIRED DISPOSAL, PER OCD RULE 19.15.17. SEE ATTACHED FOR		
CONDITIONS OF APPROVAL		
Ground level Dry Hole Marker Resuires	13 OF APPROVAL	
14. I hereby certify that the foregoing is true and correct. Electronic Submission #240736 verified by the BLM Well Information System For CIMAREX ENERGY CO OF COLORADO, sent to the Carlsbad Committed to AFMSS for processing by JAMES AMOS on 04/04/2014 ()	RECLAMATION PROCEDURE ATTACHED	
Name (Printed/Typed) DAVID A EYLER Title AGENT		
Signature (Electronic Submission) Date 04/01/2014	eccepted for record 5/4/	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE	NIVIOCD	
Approved By James Como Title SEPS	Date 5-6-14	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would critile the applicant to conduct operations thereon. Office		

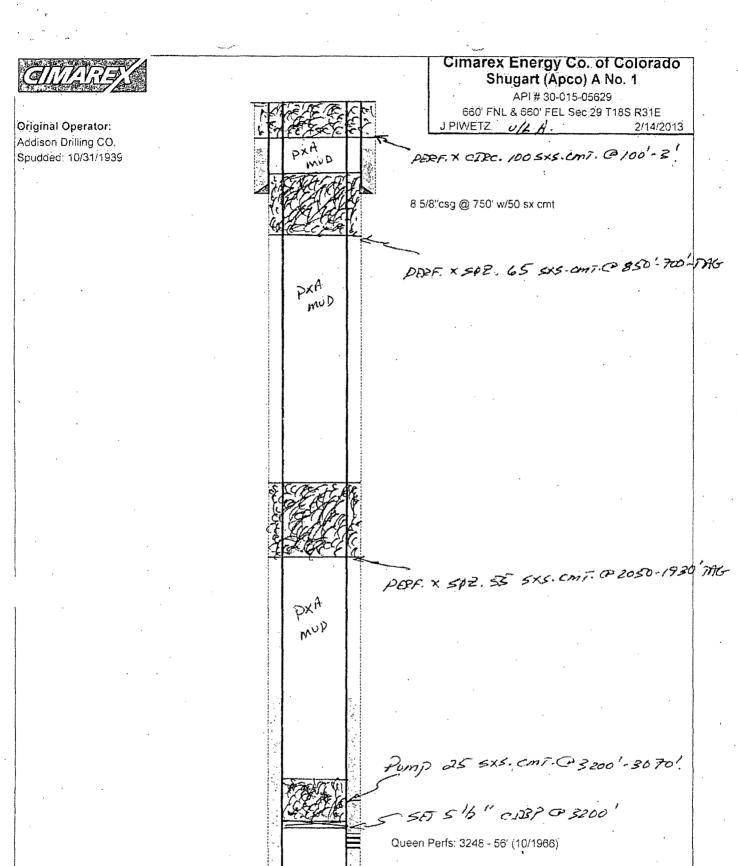

CIBP @ 3520' (10/1966) OPEN HOLE: 3535' - 3573'

PILIOTEO 3AG

Yates - 7 Rivers

5 1/2" csg @ 3535' w/100sx TOC @ ?



Original Operator: Addison Drilling CO. Spudded: 10/31/1939

Cimarex Energy Co. of Colorado Shugart (Apco) A No. 1

API # 30-015-05629

660' FNL & 660' FEL Sec 29 T18S R31E J PIWETZ 2/14/20

8 5/8"csg @ 750" w/50 sx cmt

TUBING DETAIL .

113 Jts 2-3/8" tubing 1 ea 2-3/8" SN 1 ea 2-3/8" Perf Sub 1 jt 2-3/8" MA

ROD DETAIL

1 ea 1-1/4" x 16' PSPR + 1-1/2" x 8" PRL 1 ea 3/4" x 4' x 6' Pony Rods 143 ea 3/4" x 25' Rods 1 ea 1" x 1' lift sub 1 ea 2" x 1-1/2" x 16' RWBC pump + 1' x 6' GA

5 1/2" csg @ 3535' w/100sx TOC @ ? Upper Queen Perfs: 3248 - 56' (10/1966)

CIBP @ 3520' (10/1966) OPEN HOLE: 3535' - 3573' Lower Queen

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLill office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.

Requirements for ground level dry hole markers <u>Well Identification Markers</u> Conditions of Approval (COA)

The BLM Carlsbad Field Office (CFO) Conditions of Approval (COA) Requires that ground level dry hole markers be placed on well within the Lesser Prairie Chicken habitat area. The dry hole markers will be to the following specifications. The operator will construct the markers as follows:

- 1. An 8 inch X 8 inch steel plate 1/8 to 3/16 of an inch thick is to be placed on the old dry hole marker stand pipe 2 inches from ground level, in the Lesser Prairie Chicken habitat area.
- 2. Steel plate may be welded or bolted approximately 2 inches from ground level on the stand pipes. If plates are bolted to the stand pipe, the person installing the plate will be required to weld a pipe collar on the plate and place a minimum of two set screws/bolt on each collar. Aluminum data plates may be bolted with minimum ¼ inch bolt and locking nuts or self tapping fine threaded screws. A minimum of one in each corner is to be installed on each plate.
- 3. An 8 inch x 8 inch aluminum plate, which is 12 gauge or .080 sign material (1/8 inch aluminum plate may be used in place of the .080 plate) with the required information for that well stamped or engraved in a minimum/3/8 inch tall letter or number.
- 4. The following information will be stamped or engraved on the 8 inch X 8 inch aluminum plate in the following order.
 - a. First row: Operators name
 - b. Second row: Well name and number
 - c. Third row: Legal location to include ¼ ¼, Section, Township, and range. If the legal location cannot be placed on one row it can be split into two rows with the ¼ ¼ (example: 1980 FNL 1980 FWL) being on the top row.
 - d. Fourth row. Lease Number and API number.
 - i. Example marker plate: (attached)

NMOCD Order No. R-12965 also required the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a ground level dry hole marker was installed as required in the COA's from the BLM.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Interim Reclamation Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses.

Interim reclamation consists of minimizing the footprint of disturbance by reclaiming all portions of the well site not needed for production operations. The portions of the cleared well site not needed for operational and safety purposes are recontoured to a final or intermediate contour that blends with the surrounding topography as much as possible. Sufficient level area remains for setup of a workover rig and to park equipment. Topsoil is respread over areas not needed for all-weather operations. Production facilities should be clustered to maximize the opportunity for interim reclamation. In order to inspect and operate the well or complete workover operations, it may be necessary to drive, park, and operate on restored, interim vegetation within the previously disturbed area. This is generally acceptable provided damage is repaired and reclaimed following use.

To reduce final reclamation costs; maintain healthy, biologically active topsoil; and to minimize habitat, visual, and forage loss during the life of the well, all salvaged topsoil should be spread over the area of interim reclamation, rather than stockpiled.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). Interim reclamation is to be completed within 6 months of well completion.
- 3. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with interim reclamation as per approved APD or Sundry Notice. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
- 4. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 5. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Linda Denniston Environmental Protection Specialist 575-234-5974

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Mike Burton Environmental Protection Specialist 575-234-2226

Jeffery Robertson Natural Resource Specialist

Solomon Hughes Natural Resource Specialist 575-234-5951

Douglas Hoag Civil Engineering Technician 575-234-5979